

# MECCANO

(TRADE MARKS 298321, 76, 12633, 19274, 55/13476, 599/13, 884/25, 2913, 80, 124, 936, 18066, 5403, 41812, 4174, 9048, 5549, 2389, 91637, 83171, 157149, 32822, 200639, 209733, 214061, 214062, 12892, 29064, 33316, 1818, 16737, 16900, 72286, 494933-4-5-6-7-6, 139426-1, 383/18, 5848, 50204, 10/12288, 22826, 18982, 20063/925, 2189, 7315, 499966).

HORNBY'S ORIGINAL SYSTEM-FIRST PATENTED IN 1901

## INSTRUCTIONS

FOR OUTFITS

Nos. 00 to 3

Price 1/6

Copyright by MECCANO LIMITED, LIVERPOOL, throughout the world

No. 29 A


ENGLISH EDITION

## MECCANO

## The Finest Hobby in The World for Boys

The Meccano system is composed of over two hundred and fifty different parts, mostly made of steel or brass, each one of which has a specific mechanical purpose. These parts combine to form a complete miniature engineering system with which practically any mechanical movement may be reproduced in model form. More can be accomplished with Meccano than with any other constructional toy, for no other system has such possibilities. The genius is in the parts and you can commence to build models as soon as you get your Outfit home. A screwdriver, provided in the Outfit, is the only tool necessary.

There is no limit to the number of models that can be built with Meccano—Cranes, Clocks, Motor Cars, Ship Coalers, Machine Tools, Locomotives—in fact everything that interests boys. The most wonderful feature about the system is that it is real engineering in miniature; it is fascinating and delightful and it gives you a satisfaction beyond anything that you have ever previously experienced.

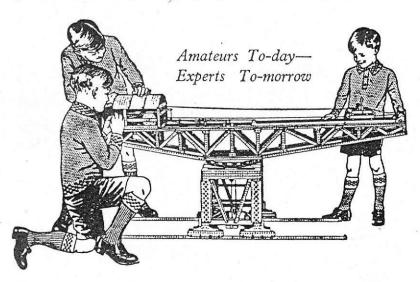

## Model-Building with Meccano

Make the simple models first—they will provide hours of fun—and then try to improve them. Every model can be made in a dozen different ways. It is important to screw up all the nuts and bolts tightly to ensure that your models will be strong and firm when they are completed.


Every keen and inventive Meccano model builder should obtain copies of the special Manuals "How to use Meccano Parts" and "Meccano Standard Mechanisms." In the former the principal uses of Meccano parts are outlined, while the latter shows a large number of real engineering mechanisms, built of Meccano parts, that can be incorporated in various models. You can obtain copies of these Manuals from your dealer, or direct from Meccano Ltd., Binns Road, Liverpool 13, England.

## How to Build up Your Outfit

Meccano is sold in ten different Outfits, numbered 000 to 7. All Meccano parts are of the same high quality and finish, but the larger Outfits contain a greater quantity and variety of parts, making possible the construction of more elaborate models. Each Outfit from No. 00 upwards may be converted into the one next higher by the purchase of an Accessory Outfit. Thus, a No. 00 may be converted into a No. 0 by adding to it a No. 00a. A No. 0a would then convert in into a No. 1, and so on. In this way, no matter with which Outfit you commence you may build it up by degrees until you possess a No. 7 Outfit. It is important to remember that Meccano Parts may be bought separately at any time in any quantity from your Meccano dealer.

## Meccano Service

The service of Meccano does not end with selling an Outfit and an Instruction Manual. When you want to know something more about engineering than is now shown in our books, or when you strike a tough problem of any kind, write to us. We receive over 200 letters from boys every day all the year round. Although all kinds of queries are put to us on all manner of subjects, the main interest is, of course, engineering. The wonderful knowledge of engineering matters possessed by our staff of experts is unique. This vast store of knowledge, gained only by many years of hard earned experience, is at your service. We want the Meccano boy of to-day to be the famous engineer of to-morrow.

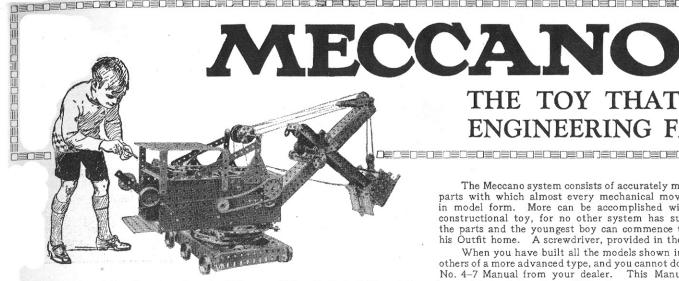

## THE TOY THAT MADE ENGINEERING FAMOUS

The Meccano system consists of accurately made and highly finished engineering parts with which almost every mechanical movement known may be reproduced in model form. More can be accomplished with Meccano than with any other constructional toy, for no other system has such possibilities. The genius is in the parts and the youngest boy can commence to build models as soon as he gets his Outfit home. A screwdriver, provided in the Outfit, is the only tool necessary.

When you have built all the models shown in this book you will want to build others of a more advanced type, and you cannot do better than purchase a copy of the No. 4-7 Manual from your dealer. This Manual contains illustrations of a fine

selection of models, a large number of which you will be able to build by adding a few extra parts to your equipment.

There is practically no limit to the number of models that can be built with Meccano. The most wonderful feature about the system is that it is real engineering: it is fascinating and delightful and it gives you a satisfaction beyond anything that you have ever previously experienced.

## IF IN DOUBT WRITE TO MECCANO LIMITED

The service of Meccano does not end with selling an Outfit and an Instruction Manual. When you want to know something more about engineering than is now shown in our books, or when you strike a rough problem of any kind, write to us. We receive over 200 letters from boys every day all the year round. Some write to us because they are in difficulty, others because they want advice on their work or pleasures, or about their choice of a career. Others, again, write to us just because they like to do so and we are glad to know that they regard us as their friends.

Although all kinds of queries are put to us on all manner of subjects, the main interest is, of course, engineering. No one has such a wonderful knowledge of engineering matters as that possessed by our staff of experts. This vast store of knowledge, gained only by many years of hard-earned experience, is at your service. We want the Meccano boy of to-day to be the famous engineer of to-morrow.

## HOW TO BUILD WITH MECCANO

Make the simple models first—there is loads of fun in them—and then try to improve them. Every model can be made in a dozen different ways. It is important to screw up all the nuts and bolts tightly to ensure that your models will be strong and firm when they are completed. When you want to add more parts to your Outfit so that you can build bigger models, you can always get them from your dealer.

Each Outfit may be converted into the one next higher by the purchase of an Accessory Outfit. Thus, a No. 2 may be converted into a No. 3 by adding to it a No. 2A. A No. 3A would then convert it into a No. 4 and so on. In this way, no matter with which Outfit you commence you may by degrees build it up until you have the largest Outfit.

All models shown in this Manual are numbered and for reference purposes each model number is preceded by the number of the Outfit with which it may be built. Thus, for example, model No. 00.60 may be built with No. 00 Outfit, and model No. 2.20 with No. 2 Outfit.



## THE "MECCANO MAGAZINE"

The Meccano Magazine is the Meccano boy's newspaper. It tells him of the latest Meccano models; what Meccano Clubs are doing how to correspond with other Meccano boys; the Competitions that are running, etc. It contains interesting articles on engineering and electrical subjects, and deals with many other topics of interest to boys, including suggestions from Meccano boys for new Meccano parts and correspondence columns in which the Editor replies to his readers' enquiries. Write to the Editor, Meccano Magazine, Binns Road, Liverpool, giving the names and addresses of three of your chums who are not Meccano boys and enclosing 1/- in stamps. He will then forward a specimen copy of the "M.M." post free. It is sent regularly to subscribers at the rate of 7/- for six issues, post free, or it may be ordered from any Meccano dealer, newsagent or bookstall, price 1/- per copy.



## MECCANO STANDARD MECHANISMS


There are a number of Meccano movements that have to a certain extent become standardised, that is to say they may be applied to more than one model, in most cases without any alteration, but in some few instances with only slight alterations to the original movement. These have been collected and classified, and may be obtained in the form of a Manual entitled "Meccano Standard Mechanisms." It will be observed that many of these Standard Mechanisms are referred to in the instructions for building the more intricate models in this book.

You may obtain a copy of the "Standard Mechanisms" Manual from your dealer, price 1/6, or direct from Meccano Ltd., Binns Road, Liverpool, price  $1/7\frac{1}{2}$  post free.



## IMPROVED MECCANO PARTS

A number of models included in this Manual show the new style  $5\frac{1}{2}'' \times 2\frac{1}{2}''$  Flanged Plate (with flanges at the ends as well as the sides) and improved Sector Plate (with two additional rows of holes), but it should be noted that, although the new parts are more adaptable, the old-style plates may still be used in their place if desired. When it is required to journal an Axle Rod in a slot in the new Flanged Plates, an ordinary Strip should first be bolted to the Plate so that one of its holes forms an additional bearing for the Rod.

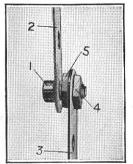

Standard Mechanisms No. 262

## SIMPLE MECCANO PIVOTS

In building Meccano models it is frequently required to attach two parts together so that one or both are quite free to swivel. A very simple way to do this is shown under detail number 262 in the Meccano Standard Mechanisms Manual, and for the benefit of those readers who are unable to consult the special Manual, we have reproduced this detail. As will be seen, it consists of a simple type of pivot or swivel bearing formed by a bolt and two nuts. The bolt is secured rigidly to a Strip or Plate, etc., by means of the nuts, which are secured tightly against opposite sides of the Strip, sufficient space being left beneath the head of the bolt to permit another Strip to turn freely about its shank.

A somewhat similar form of swivel-joint, also widely used, consists of a bolt and lock-nuts (Standard Mechanisms No. 263). The two Strips to be connected pivotally are placed on the bolt and held in position by two nuts locked together on the shank. The Strips must be allowed a certain amount of play so that they can pivot independently about the bolt. These pivoting devices will be found equally valuable in the simplest and the most elaborate models.

## STRIPS, GIRDERS AND BRACKETS JOD [0000000] WHEELS, GEARS ETC 26<sup>A</sup>

## Particulars and Prices of Meccano Parts

			,
	Perforated Strips		No. s. d.
No.	s. d. No. s.	d.	36a. Screwdrivers, Extra Long each 0 9
	12½" ½ doz. 1 6   3. 3½" ½ doz. 0	6	
1.	$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$		
la.	$9\frac{1}{2}$ , 1 3 4. 3 , 0	5	37. Nuts and Bolts, 7/32" per box (doz.) 0 9
1b.	$7\frac{1}{2}$ " " 1 0   5. $2\frac{1}{2}$ " " 0	5	37a. Nuts " " 0 5
2.	$5\frac{1}{2}$ " 0 9 6. 2" " 0	5	37b. Bolts, 7/32" ,, , 0 5
2a.	11" 0 0 0 0 1 0- 11"	5	*00 YV-1
Za.	45 ,, U 8   6a, 1½ ,, U		
_	Angle Girders		
7.	$24\frac{1}{2}''$ each 1 0   9a. $4\frac{1}{2}''$ $\frac{1}{2}$ doz. 1	3	41. Propeller Blades per pair 0 6
7a.	$18\frac{1}{2}$ " , 0 9   9b. $3\frac{1}{2}$ " , 1	0	43. Springs each 0 3
8.	12½" ½ doz. 2 9   9c. 3" , 1	0	#44 Cronled Dont String
8a.	01// 0 0 0 1 01 01// 1	0	45 Double " 0 0
		9	46. Double Angle Strips, 2½"×1" ½ doz. 0 9
8b.			46. Double Angle Strips, 2½"×1"½ doz. 0 9
9.	$5\frac{1}{2}''$ , 1 6   9f. $1\frac{1}{2}''$ , 0	9	47. " " 2½"×1½" " 1 3 47a. " " 1 3 3 ×1½" " 1 3
*10.	Flat Brackets , 0	3	47a. " " " $3'' \times 1\frac{1}{2}$ " " 1 3
*11.	Double Brackets 2 for 0	3	11" 1" 0 6
*12.		4	
	Tingle Diddictor, 2 / 2 / 1	6	48b " " 2½ ×½ " 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0
*12a.	" " 1″×1″ <u>1</u> doz. 0		48b. " " " $3\frac{1}{2}$ " $\times \frac{1}{2}$ " " 0 9
*12b.	" " 1"×1" " 0	4	48c. ", ", ", 4½"×½" ", 1 3
	Axle Rods		48d. ", ", $5\frac{1}{2}" \times \frac{1}{2}"$ ", 1 8
13.	$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$	1	50a. Eye Pieces, with boss each 0 6
13a.	8" 0 3 16b. 3" 0	î	50 Defended Element Dieter 51% (01% 0
	6½" " 0 2 17. 2" 3 for 0	2	
14.			
15.	$5^{"}$ , 0 2   18a. $1\frac{1}{2}^{"}$ , 0 4 $\frac{1}{2}^{"}$ , 0 1   18b. $1^{"}$ , 0	2	53. Perforated Flanged Plates, 3½"×2½" " 0 5
15a.	$4\frac{1}{2}$ , 0 1   18b. 1" , 0	2	53a. Flat Plates, $4\frac{1}{2}'' \times 2\frac{1}{2}''$ , 0 5 54. Perforated Flanged Sector Plates , 0 5
16.	91" 0 1		54. Perforated Flanged Sector Plates , 0 5
19.		3	55 Development of Ctuing slatted 51" lange 0 9
	Cruita ridireito, Derbe cuon	3	
19s.			55a. " " " 2" " " 0 2
19a.	Wheels, 3" diam., with set screws ,, 0	9	56. Instruction Manuals, No. 4-7 " " 2 3
20.	Flanged Wheels, 1\frac{1}{8}" diam ,, 0	.8	56a. " No. 00-3 " 2 3
20b.	3//	6	56b. ", No. 0 ", 0 6
200.	" Pulley Wheels "	~	56c. Meccano Standard Mechanisms Manual 1
4.01		0	
19b.	3" dia. with centre boss and set screw " 1		57. Hooks ,, 0 1
19c.	6" ,, ,, ,, ,, 3	0	57a. " Scientific " 0 2
20a.	2" ,, ,, ,, ,, ,, ,, 0	8	57b. " Loaded 0 5
21.	11"	6	58. Spring Cord per length 1 3
22.	1"	5	50 C-11
	1 " " " " " "		
23a.	1" " " " " " " 0	5	61. Windmill Sails 4 for 0 8
22a.	1" , without , , , , U	3	62. Cranks each 0 5
23.	1" " " " 0	3	62a. Threaded Cranks , 0 6
24.	Deals Wheels	6	62h Double Arm Croples
25.	Pinion Wheels, \frac{3}{2}" diam 0	9	63 Couplings " 0 6
	9/ 1	3	
25a.			63a. Octagonal Couplings " 1
	face " 1	0	63b. Strip Couplings ,, 1 (
26.	,, ,, ½" ,, ,, 0	6	63c. Threaded Couplings " 0 8
26a.	" double width		64. Threaded Bosses 0 8
2000	, face , 0	9	65 Contro Forles
	Gear Wheels		GG Weights 50 growings " 1 4
or m	Gear wheels	^	
27.	50 teeth to gear with \mathref{4}" pinion , 0	9	67. , 25 , , 1 6
27a.	50 teeth to gear with 2" pinion , 0 57 , " ," 12" ," 31" diam.), 1	9	68. Woodscrews, ½" doz. 0 5
27b.	133 ", ", ", ½" ", (3½" diam.)", 1	10	69. Set Screws 0 5
28.	Contrate Wheels, 1½" diam " 1	3	60a Cmuh Canaura 5/20"
	4" 0	9	7/00"
29.			690. " " 1/32" " 0 8
30.	Bevel Gears, 7, 26 teeth , 1	2	70. Flat Plates, 5½"×2½" each 0
30a.		9	1 72. " " 25" × 25" " 0 3
30c.	", ", 16", Can only be ", 0 ", 14", 48 ", sused together", 2 Gear Wheels, 1", 38 teeth 1 Worm Wheels	3	76. Triangular Plates, 2½" ,, 0
31.	Gear Wheels, 1", 38 teeth 1	6	77
	Transfer in the state of the st		Screwed Rods
32.	World Whools III III III III III	8	
34.	Spanners " 0	3	78. 11½" each 0 9   80a. 3½" each 0
34b.	Box Spanners " 0	6	79. 8" " 0 8 80b. 4½" " 0
35.	Spring Clips per box (doz.) 0	5	700 6" 0 6 91 9" 0
36.	0 0 1	5	90 5" " 0 5 90 1" "
30.			, , , , , , , , , , , , , , , , , , , ,
	Meccano Accessory Parts will be subblied	in co	colours unless nickelled parts are specially ordered.
	and the state of the state of the price		£,

Meccano Accessory Parts will be supplied in colours unless nickelled parts are specially ordered 
\*IMPORTANT—These parts are available with nickel finish only.

## Particulars and Prices of Meccano Parts (continued)

No.				s. d.	No.	S.	d.
	510 C 1 Ct 1	0// 1:	1-				
89.	5½" Curved Strips, 1			0 3			2
89a.	3" Curved Strips, c	ranked.	19"		127.	Simple Bell Cranks 0	2
		adius, 4 to	- I1.	0 3		Dana Dall Caralla	5
90.	$2\frac{1}{2}''$ ,, , 2	#" radius	*** 22	0 2	*129.	Rack Segments, 3" diam 0	8
90a.	01//	ranked,	1 3"		*130.		6
0000				0 0			
	ra	adius, 4 to c	arcle "	0 2	131.	Dredger Buckets ½ doz. 1	6
94.	Sprocket Chain	per	40" length	0 9	132.	Flywheels, 23" diam each 3	0
<b>*95.</b>	Sprocket Wheels, 2"	diam	eacn	0 8		Corner Brackets , 0	2
*95a.	" " 1½ " " 3″	" ,,		0 6	*134.	Crank Shafts, 1" stroke , 0	3
*95b.	" " 2	,,	,,,	0 9			
	" " 3"	,,	))			Theodolite Protractors ,, 0	3
<b>*96.</b>	" " 1"	,,	,,	0 5	136.	Handrail Supports 0	5
*96a.	2//		**	0 5		Wheel Flances " 0	5
	" " " 4	. 11	,,,,			Wheel Flanges ,, 0	
97.	Braced Girders, 31"	long	1 doz.	1 3	138.	Ship's Funnels ,, 0	5
97a.	0//	_		1 (	138a.	Cupard tupe	3
		**	*** 77			" Cunard type " 1	
98.	,, 2½"	**	*** >>	1 (	139.	Flanged Brackets (right) ,, 0	3
99.	101/			3 8	139a.		3
	" " " " " " " " " " " " " " " " " " " "	**	"				
99a.	,, ,, 9½"	,,	*** ;;	3 (		Universal Couplings " 1	3
99b.	", ", $7\frac{1}{2}$ "			3 (	141.	Wire Lines (for suspending clock	
100.	7.14	,,					^
			))			weights) , 1 Rubber Rings, 3" rim , 0	0
100a.	" " $4\frac{1}{2}$ "	,,	11	1 3	3 142.	Rubber Rings, 3" rim	- 5
101.	Healds, for looms	,,	2"			Dunley Trans to Ct Off 1	
							6
102.	Single Bent Strips		each	0 2	2 142b	9"	9
103.	Elat Cindons 51" 1					Cin la Ci 1 " " " " " " " " " " " " " " " " " "	
	Flat Girders, 51" lon	ıg	½ doz.			Circular Girders, 5½" diam " 1	6
103a.	" " 9½" "		11	1 5	144.		9
103b.	101/		.,	2 (		Cincolor Christ 77 diameter 1	
	" " 122 "		*** ))			Circular Strips, 7" diam. over all , 1	3
103c.	44"		,,	1 :	3 146.	" Plates, 6" " " 1	6
103d.	" " 3½" "		"			Deute with street built and a series of	
	" " 3½" "		*** ))			Pawls, with pivot bolt and nuts " 0	5
103e.	,, 3" ,,		,,	0 9	*147a	Pawls	3
103f.	" " - "						
			*** 11			. Pivot Bolt with 2 nuts ,, 0	3
103g.	9"		,,	0 (	3 148.		9
103h.	" " — "		,,			Ratchet Wheels " " "	
	,, ,, 1½",,		*** 77		149.	Collecting Shoes, for Electric Locos ,, 2	3
103k.	$\begin{array}{cccccccccccccccccccccccccccccccccccc$		*** "	1 (	3 150.		0
*104.	Shuttles, for looms				3 151.	Dulley Disale Cingle Change	
	Situtues, for footis		each			Pulley Blocks, Single Sheave , 1	0
105.	Reed Hooks, for loon	ms	*** 22	0 (	3 152.	" " Two " " " 1	3
106.				2	3 153.	775	
			*** 22		100.	" " Three " " 1	6
106a.	Sand Rollers	*** ***	*** 33		*154a	Corner Angle Brackets, 1, right	
107.	Tables for Designing		,,	2	3	hand 1 doz. 0	9
			*** ***			hand 12 doz. 0	
108.	Architraves		*** 33	0	3   *154b	. Corner Angle Brackets, ½" left hand " ,, 0	9
109.	Face Plates, 21" dias	m		0	3 155.	Rubber Rings, §" each 0	
	Darl Carlos 01"		"			Rubber Rings, 4 each o	
110.	Rack Strips, 31"		*** >>		*156.	Pointers, 21" over all, with boss ,, 0	- 6
111.	Bolts, 4"		***	0	1 157.	Fans, 2" diam 0	6
	1//						
111a.	" 2		3 for		2   158a		
111c.	,, §		doz.	0	5   158b	Distant	8
113.	Girder Frames				5 *159.		
	Graci Flames			-		Circular Saws " 1	
*114.	Hinges		per pair	0	6   160.	Channel Bearings, $1\frac{1}{2}"\times 1"\times \frac{1}{2}"$ " 0	3
115.	Threaded Pins		each		3 162.		
*116.	Fork Pieces, Large		*** 22	0	5   162a	. Boiler ends 0	5
116a.	Small		*** "	0	5 163.		
	Charl Dalla 2/ 1					Sleeve Pieces pair 0	
117.	Steel Balls, & diam.		doz.		9   164.	Chimney Adaptors each 0	3
118.	Hub Discs, 5½"				9 165.	Surivel Boarings 0	
		1 4 i i i	11/				
119.	Channel Segments (8				166.	End " " 0	5
	diam.)			0	6 167.	Canrod Poller Poorings 20	
100	Derfferm		,,			Geated Roller Bearings " " 30	
120.	Buffers		*** ,,	0	3   167a		9
120a.	Spring Buffers		per pair	1	0 167b	Ring Frames for Pollers	
120b.			each		2   167c		6
121.	Train Couplings			0	3 168.		
	Ministra T - 1 1 0						
122.	Miniature Loaded S	acks	,,		3   168a	. Ball Races, flanged " 0	9
*123.	Cone Pulleys		11	2	0 168b	goored 1	3
	Deverged April Des	aliata 1"					
*124.	Reversed Angle Bra	ickets, I	½ doz.		6   168c		
125.		1"		0	5   169.	Diamon Donalosto	3 0
126.	Trunnions "	" 3"			3 *170.	Bassadaira 1// 41	
120.	municus		each	0	0   -1/0.	Eccentrics, ½" throw ,, 1	3
		D		. 77 . 4	Z 1	inless nickelled parts are specially ordered.	

Meccano Accessory Parts will be supplied in colours unless nickelled parts are specially ordered.

\*IMPORTANT.-These parts are available with nickel finish only.











Guild Leader's Badge



Meccano Guild Member's Certificate

#### WHAT THE GUILD MEANS

THE Meccano Guild is an organisation for boys, started at the request of boys, and conducted as far as possible by boys. In joining the Guild a Meccano boy becomes a member of a great brotherhood of world-wide extent, every member of which has promised to observe its three great objects:—

- (1) To make every boy's life brighter and happier.
- (2) To foster clean-mindedness, truthfulness, ambition, and initiative in boys.
- (3) To encourage boys in the pursuit of their studies and hobbies, and especially in the development of their knowledge of mechanical and engineering principles.

#### HOW TO BECOME A MEMBER

MEMBERSHIP of the Guild is open to every boy possessing a Meccano Outfit, or Hornby Train Set, who satisfactorily fills in the prescribed application form. The only conditions are that members promise to observe the objects of the Guild and to wear their badges on all possible occasions.

The price of the Guild membership badge is 7d. post free in the United Kingdom, but members abroad will be required to pay 5d. extra for registered postage. A remittance for the necessary amount should be sent along with the form of application. The Guild badge is beautifully enamelled in blue and white and is made for wearing in the lapel of the coat.

#### MECCANO CLUBS

MECCANO CLUBS are founded and established under the guidance of the Guild Secretary at Headquarters and at the present time there are active Clubs in over one hundred towns and villages in the United Kingdom and in many countries Overseas. Each Club has its Leader, Secretary, Treasurer, and other officials all of whom, with the exception of the Leader, are boys. Write for information how to form a club, if there is no club near you.

Special awards are given to Club members for good work in connection with their Club and medallions are awarded in connection with the Recruiting Campaign, full particulars of which will be sent on request.




RECRUITING MEDALLION





SPECIAL MERIT MEDALLION

## A Selection of Choice Meccano Models

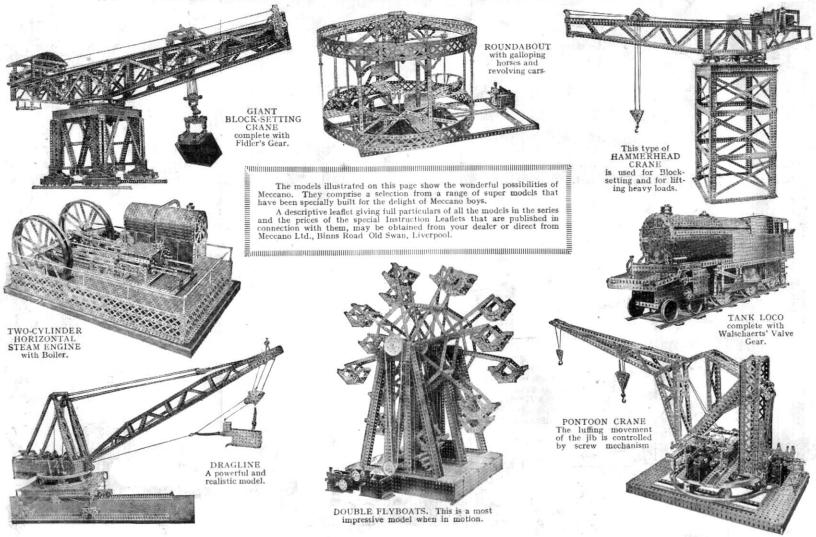



All these Models can be built with MECCANO Outfit No. 00

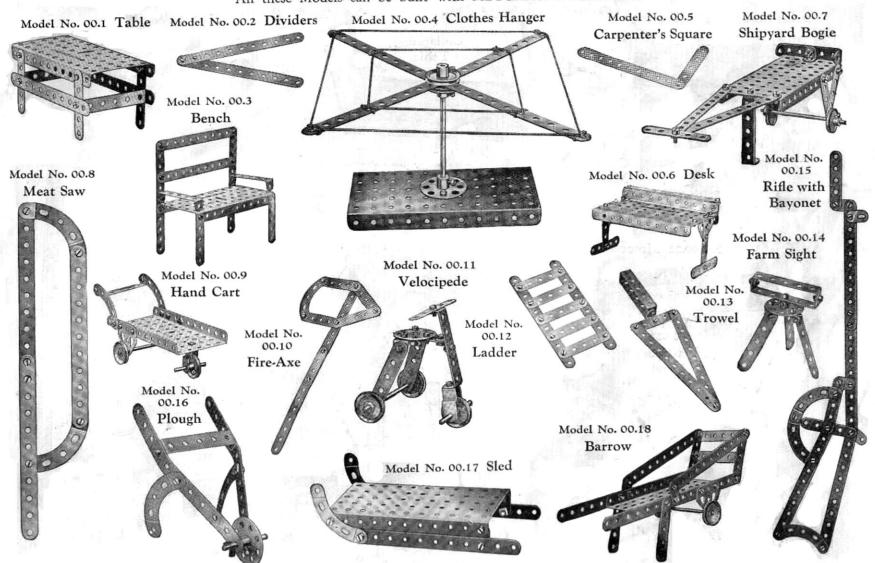


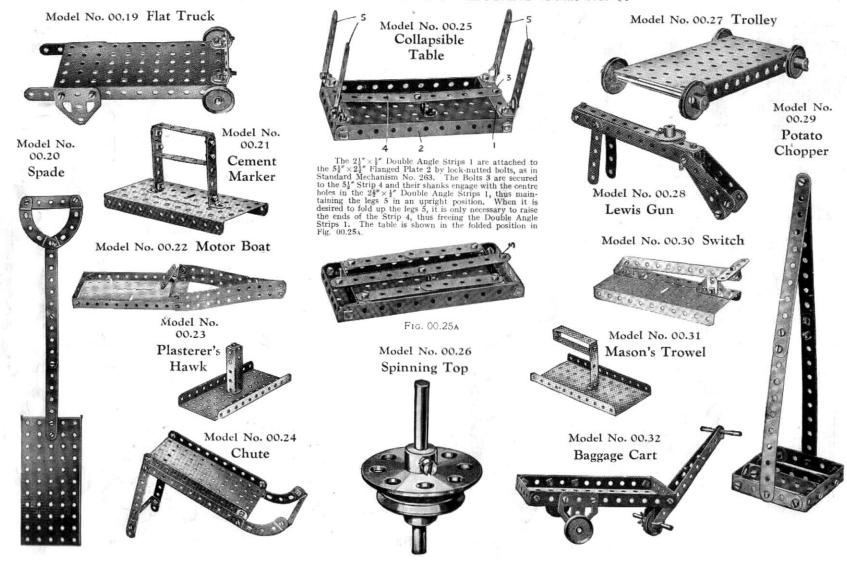



9 All these Models can be built with MECCANO Outfit No. 00 Model No. 00.38 Roulette Wheel Coat Model No. 0 . . . . . . 00.42 Hanger 30 Model No. 00.33 Axe Model No. 00.35 Horse Model No. 00.43 Roman Balance Model No. 00.34 Fork 976 Model No. 00.44 Grill Cut out a circular piece of cardboard, and mark as shown to form secting board. This is clamped between two 1" Pulley Wheels. The pointer revolves freely on the upright spindle and is held in position by another 1" Pulley Wheel. Model No. 00.45 Hoe Model No. 00.39 Pulley Shafting Model No. 00.36 Timber Truck Model No. 00.40 Furrow Roller Model No. 00.46 Planing Bench Model No. 00.37 Bogie Truck Model No. 00.41 Two-Hand Saw 

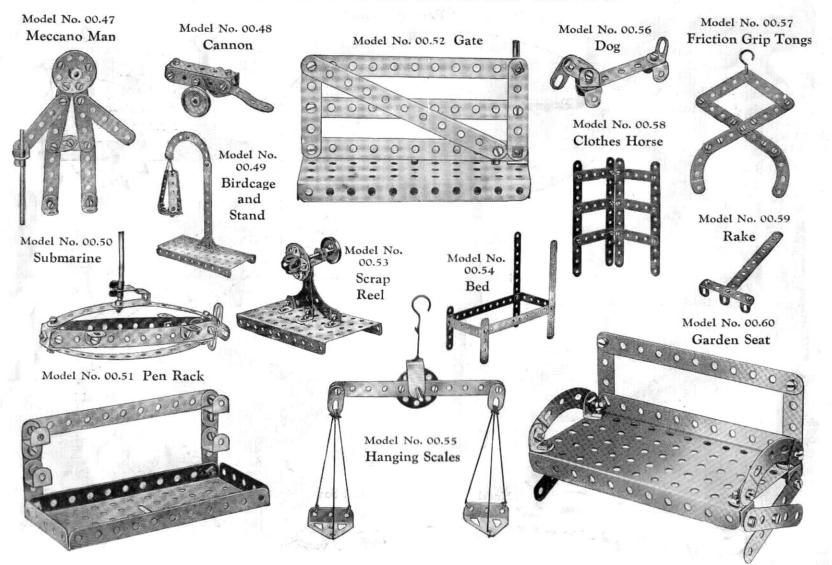


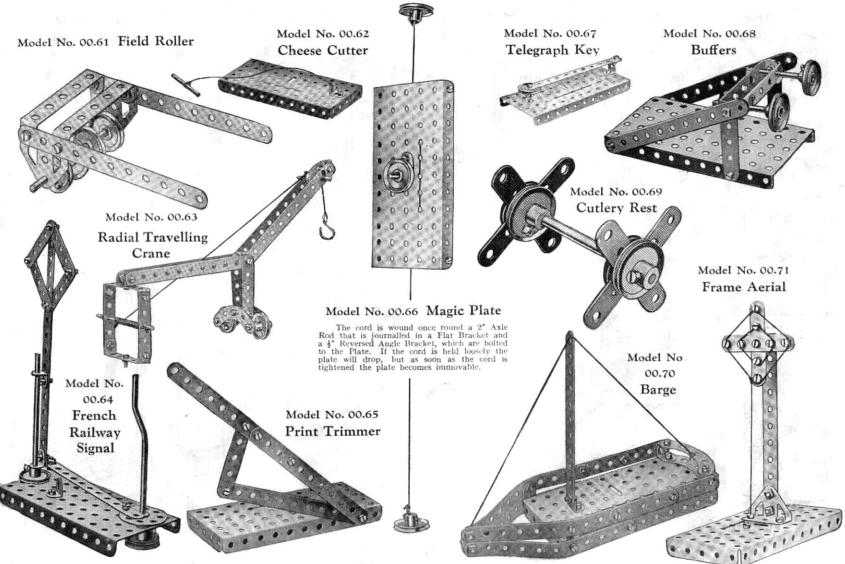

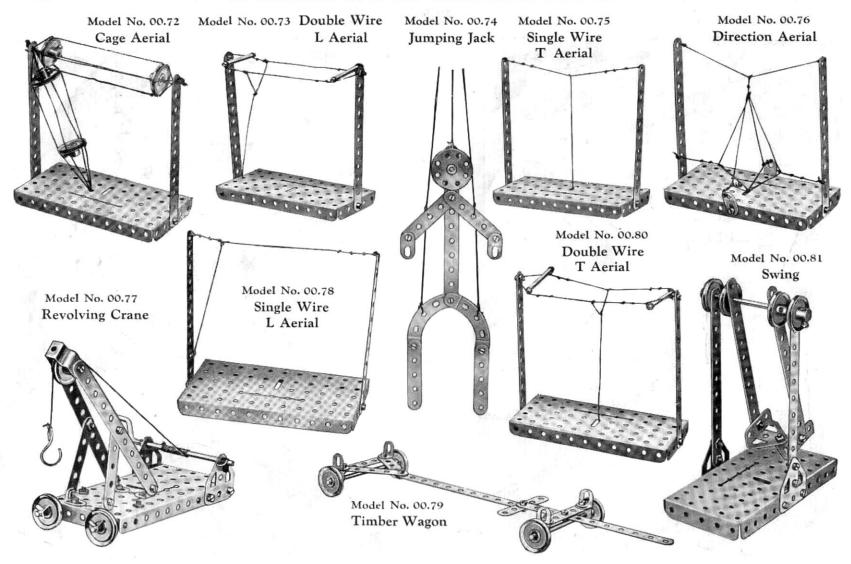


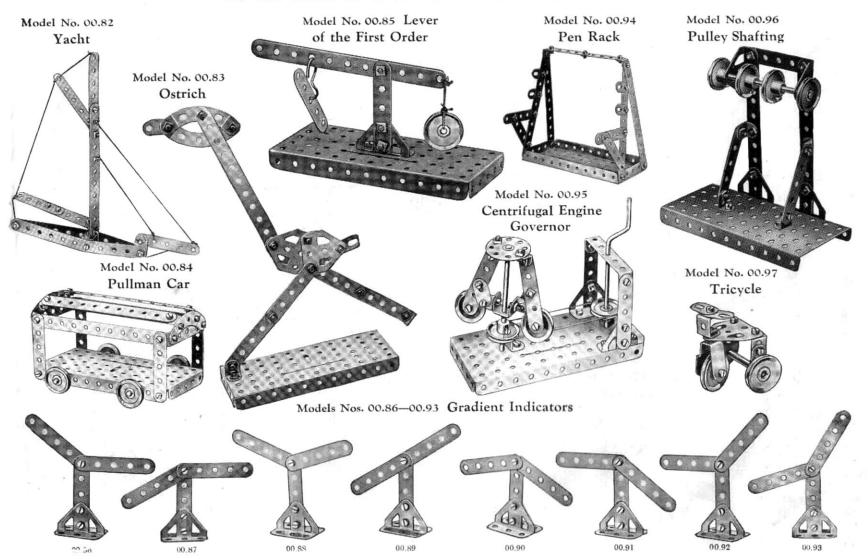


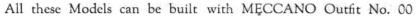

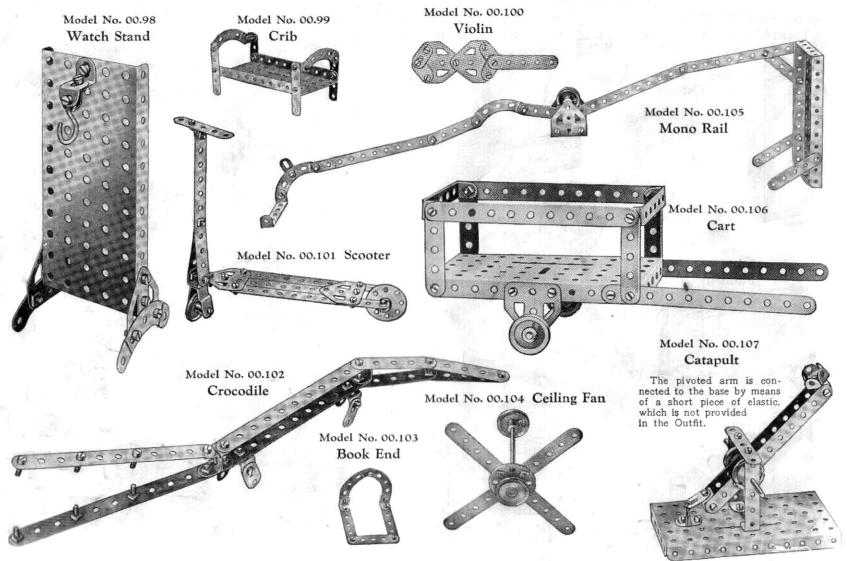

All these Models can be built with MECCANO Outfit No. 00

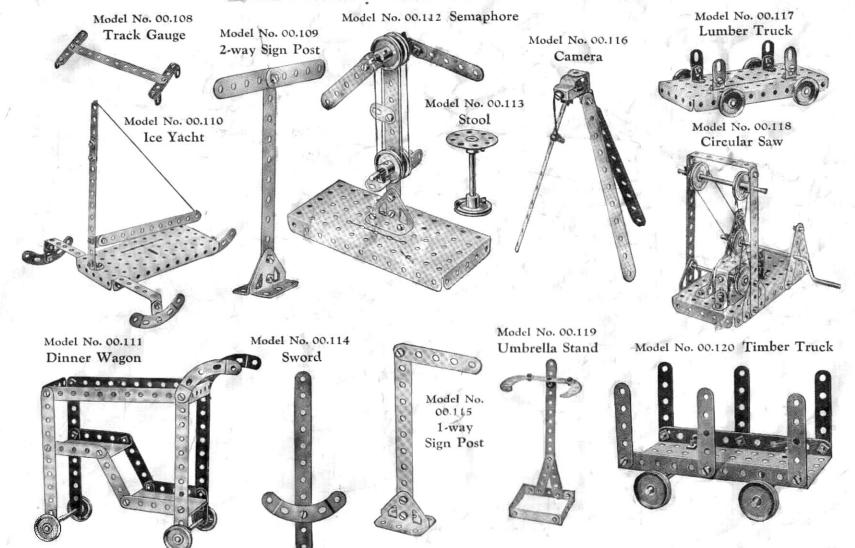

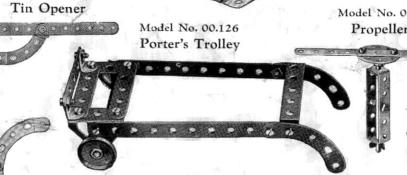

16

Model No. 00.121


Road Sign


0 60 1


Model No. 00.125

Model No. 00.127 Walking Stick


All these Models can be built with MECCANO Outfit No. 00

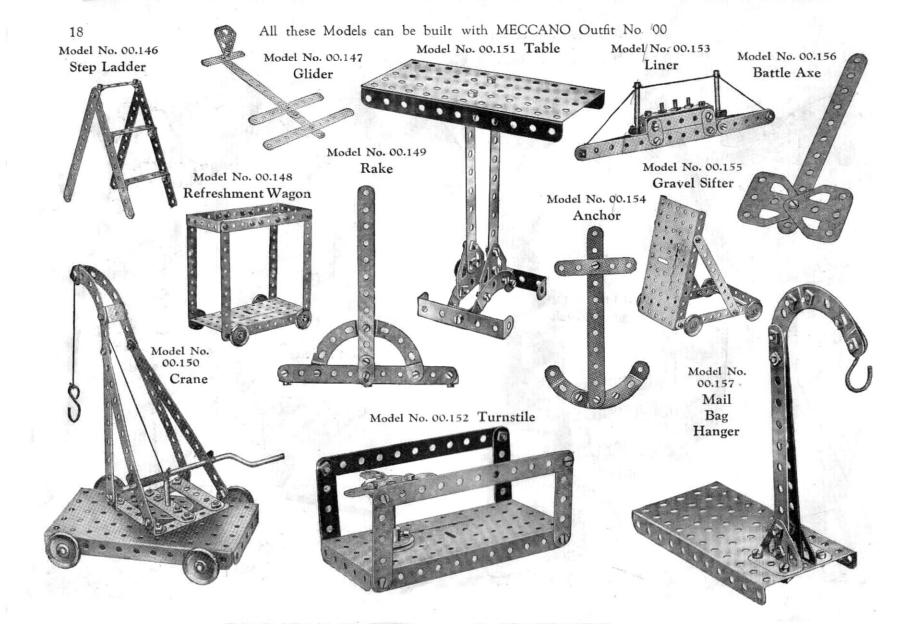


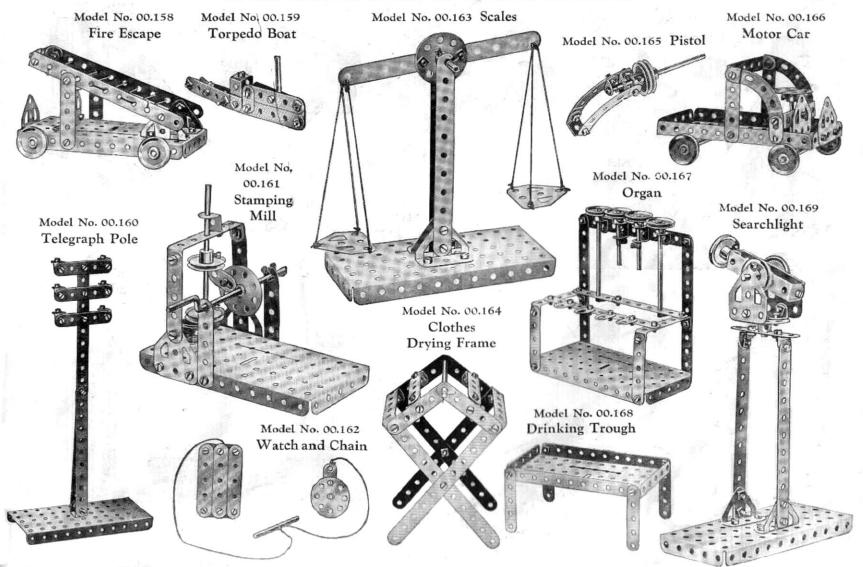

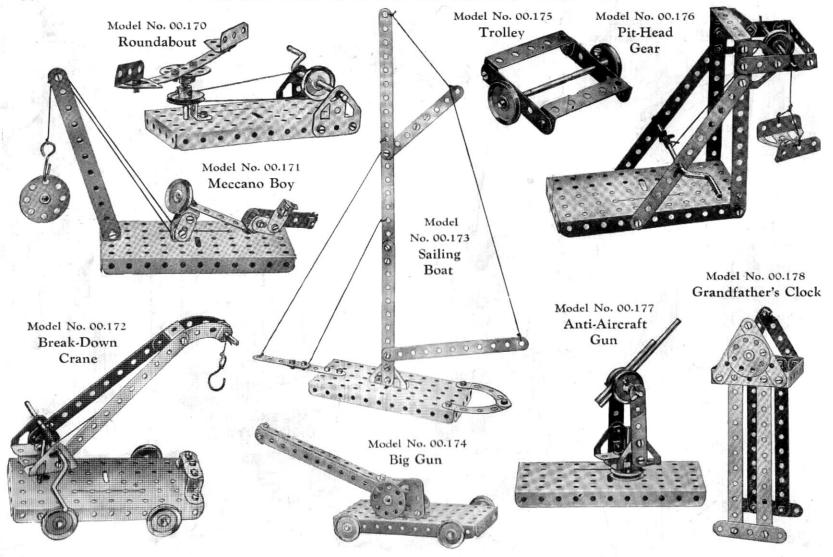

All these Models can be built with MECCANO Outfit No. 00

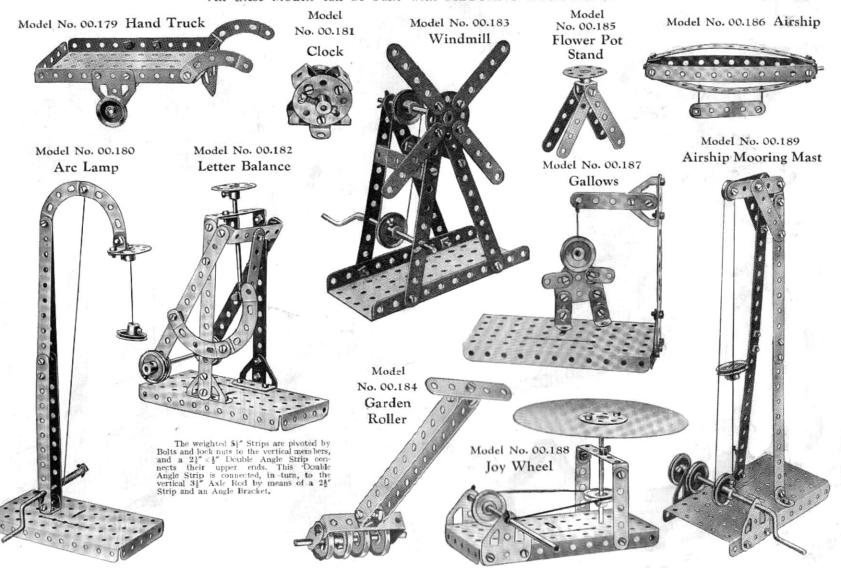


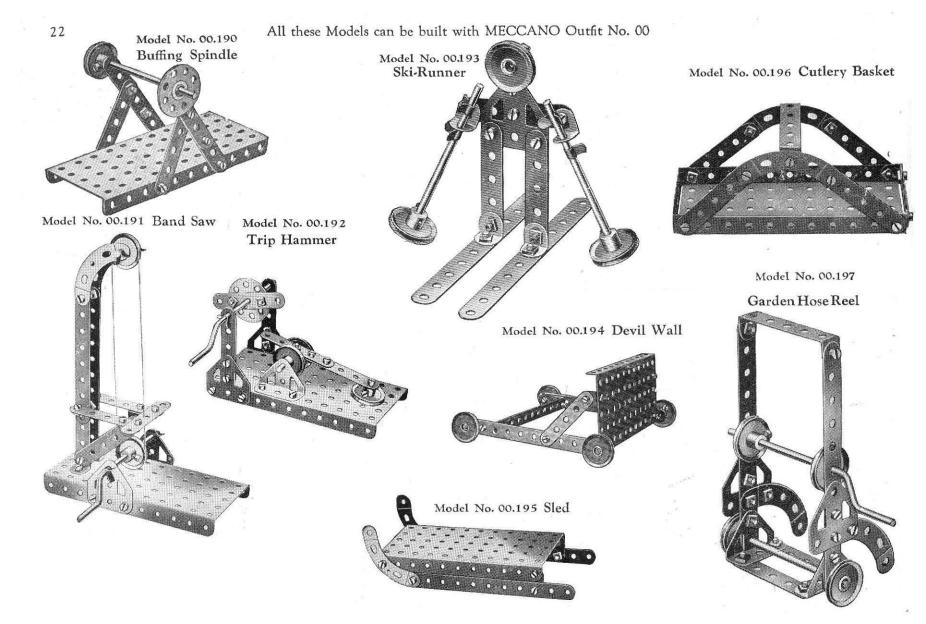




#### HOW TO CONTINUE

This completes our examples of models that may be made with MECCANO Outfit No. 00. The next models are a little more advanced, requiring a number of extra parts to construct them. The necessary parts are all contained in a No. 00A Accessory Outfit, the price of which will be found in the list at the end of this Manual.

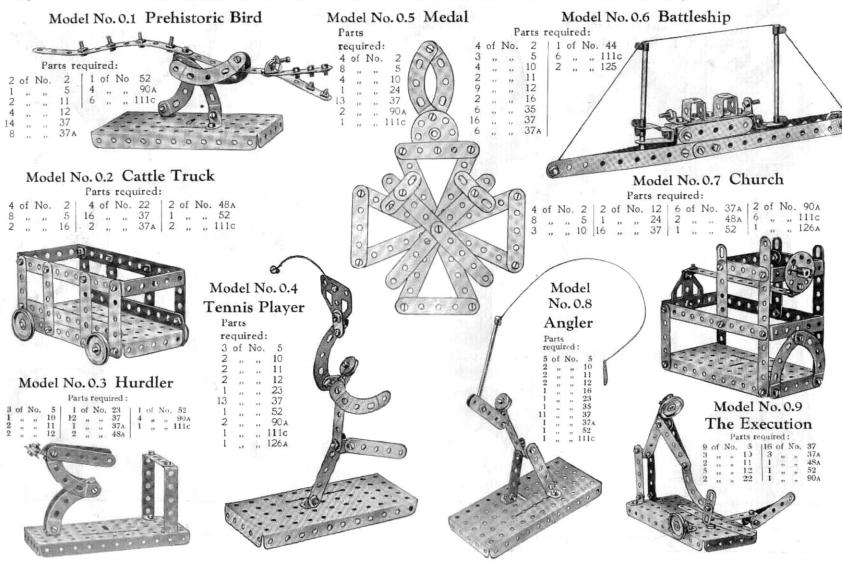

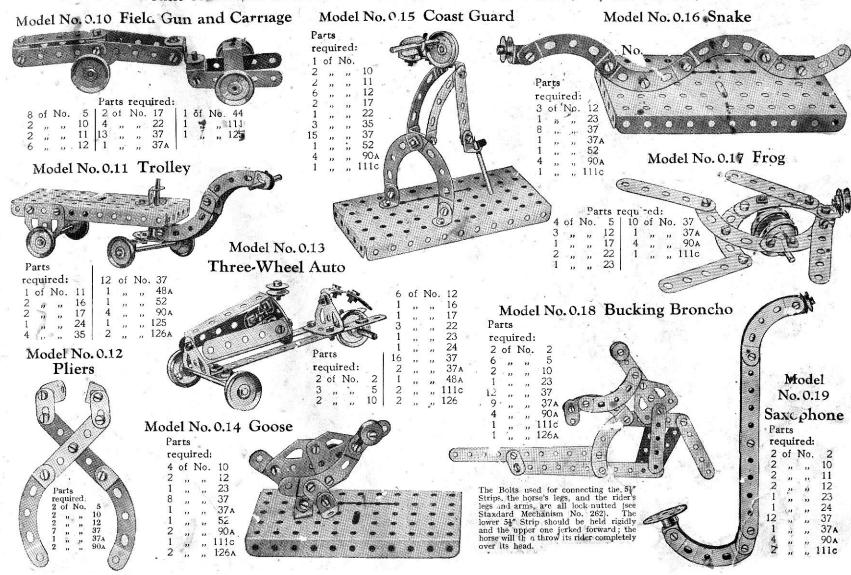

4 of No. 2 | 8 of No. 37


required:


2 | 1 of No. 23

11 | 1 ,, ,, 111c

,, ,, 37

,, ,, 10 16 ,, ,, ,, ,, 11 1 of No. 125

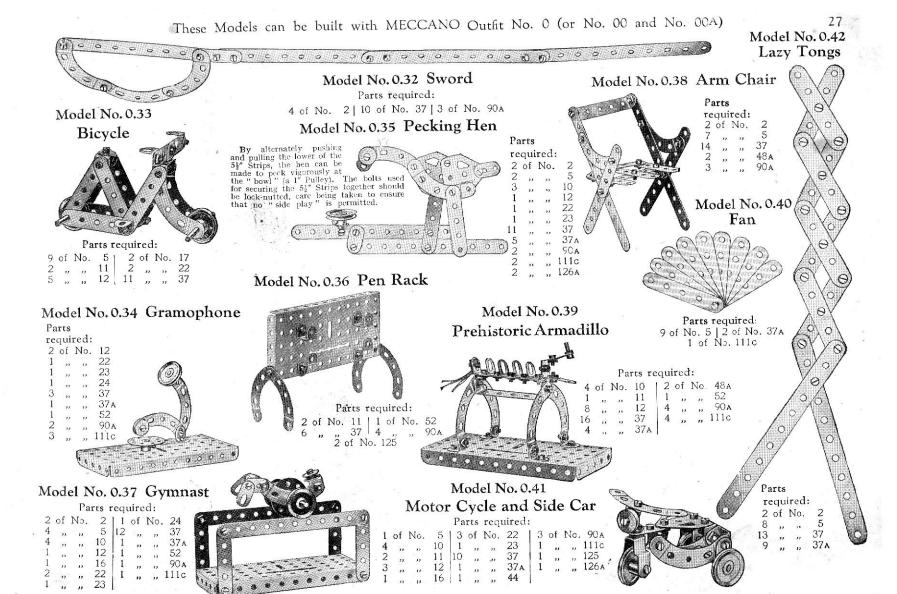

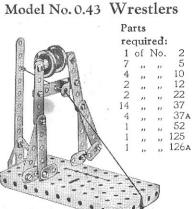


28

## Model No. 0.44 A Chase

## Parts required:

1	of	No.	5	16	of	No.	37
1	,,	,,,	10	1	11	,,	37A
2	,,	. ,,	11	1	23	,,	52
7	22	,,,	12	4	23	D	90 A
1	,,	22	22	2	23	11	111c
1	٠,,	,,	23	1-2	,,	,,	126A

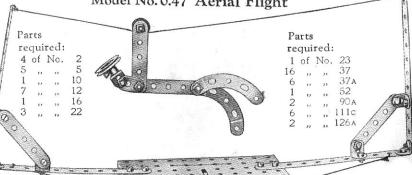

00000000

## Model No. 0.49 Galvanometer

## Parts required: 1 cf No. 12 " "111c

## Model No. 0.50 Steeple-chaser

Link

Parts

required: 4 of No. 5

## Parts required:

	7	of	No.	5	1	of	No.	37A	
	4	,,	,,	10	1	,,	21	48A	
9	1	,,	,,	12	1	,,	,,	52	
	1	,,	23	23	4	,,,	,,	90 A	
	13	,,	"	37	1	,,	,,,	111c	
					1	11.00		126A	



Model No. 0.45

3	of	No.	2	2	of	No.	37A	
9	1)	,,	5	1	,,	,,	37A 52 111c	
1	1)	,,	16	2	,,	,,	111c	
2	,,	"	22	2	2)	,,	126a	
16	**	**	31					


Bullock Cart


## Model No. 0.46 Coster's Barrow




#### Parts required:


2	of	No.	5	13	of	No.	37
1	,,	,,	11	1	,,	1)	52
1	,,	,,	17	4	"	"	90A
1	-	.,	24	2	"	,,	126A

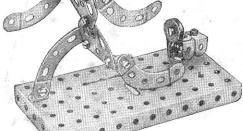

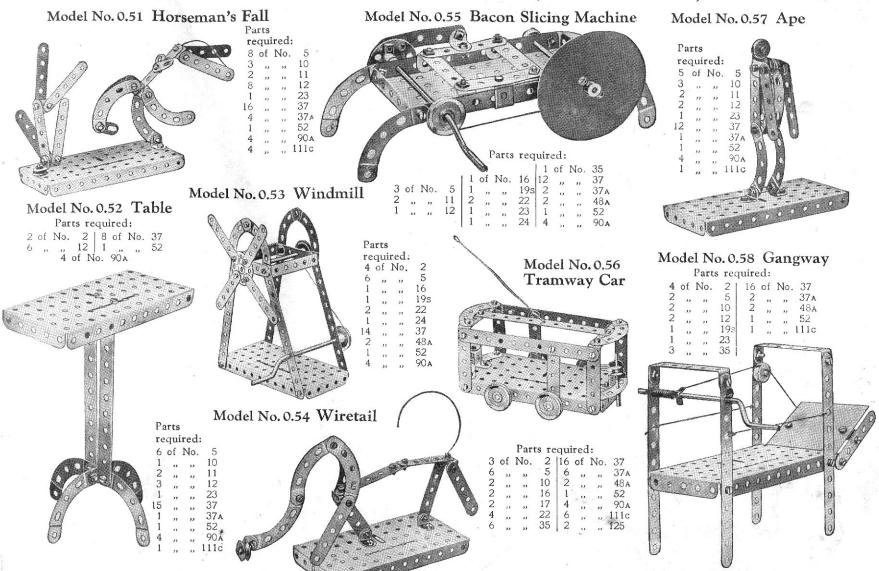


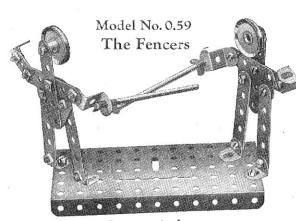

## Model No. 0.61 Rattle

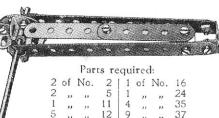

Model No. 0.62 Single Sheave Pulley Block

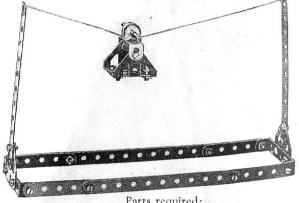

Model No. 0.65 Aerial Ropeway

#### Parts required:

4	of	No.	2	1 1	of	No.	23	2	of	No.	48 A
4	,,	,,	5	2	,,	1)	35	2	12	2.1	125
2	,,	"	10	22	,,	,,	37	2	12	**	126
- 1			17	1			12	2			126 1

## Parts required:

8	of	No.		4	of	No.	
		22	10	30	"	. 100	37
6		12	12	1	- 12	2.5	52
2	,,,	12	16	2	,,	22	125
2	,,	11	22	12	"	"	126A



2	of	No.	5	7	cf	No.	374
1	,,	No.	23	1	23	**	57
		3 0	f N	0	111	0	


Model No. 0.64


Arm Chair

## Model No. 0.66 Shearing Machine

4	of	No.	2	2	of	No.	48A
7	,,	"	5	1	"	11	52
17	,,	2.7	37	2	"	D	90A



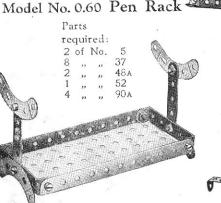

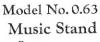



Parts required: 1 of No. 2




Parts



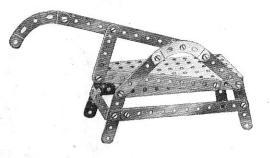

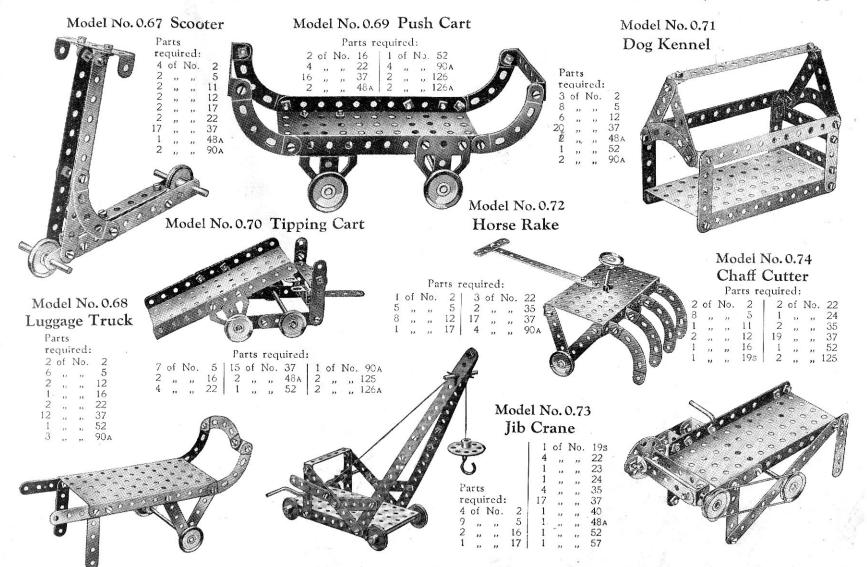

## Model No. 0.75 Trolley

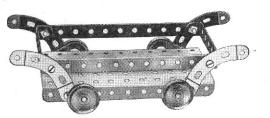

## Parts required.


2	of	No.	2	8	of	No.	37
2	,,	"	2 16 22 of N	2	,,	12	48
4	,,	,,	22	1	,,,	11	52
		4	of D	lo.	90	A	




Hat Rack

Parts
required:
2 of No. 2
4 " " 5
2 " " 11
5 " " 12
1 " " 22
20 " " 37
2 " " 48A
4 " " 90A

## Model No. 0.77 Luggage Truck

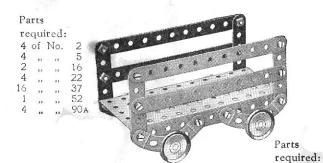


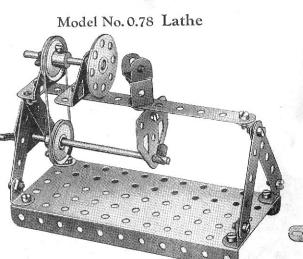

### Parts required:

1	of	No.	2	2	of	No.	22
4	,,,	21	5	1	,,	12	24
2	,,,	21	11	3	,,,	33	35
7	,,	"	12	16	29	12	37
1	12	"	17	1	**	11	54
1	32	"	19s	2	2/"	3.5	126
		2.	of No	). L.	26 a		

## Model No. 0.79 Swing

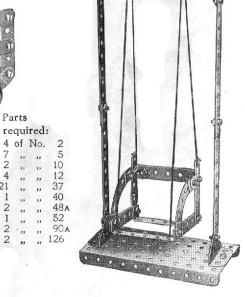


## Model No. 0.80 Plough

2	of	No	2	1	of	No	17
1	,,	37	5	1	17	27	22
2	,,	1)	10	15	,,	21	37
2	32	93	11	1	23	32	44
3	**	",	12	No.	90'A	10	48




## Model No. 0.81 Arch

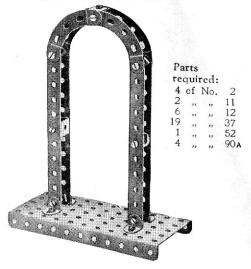


## Model No. 0.82 Tea Wagon

#### Parts required:

8	of	No.	5	10	of	No.	37
2	,,		16				
4		122	22	4		100	904

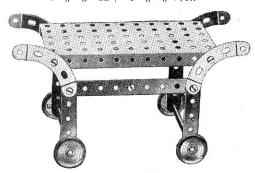


## Model No. 0.83 Horizontal Engine

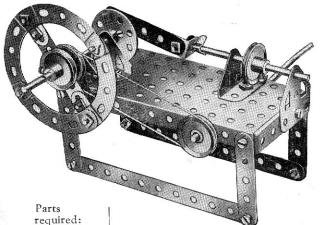

equired:										-	<b>3</b>	
		No.	2									
6	,,	- 10	5	4	of	No.	22	i				
2	,,	12	10	1	,,	,,	24	1	of	No.	52	
1	12	12	12	3	**	,,	35	4	,,	,,	90 A	
2	,,	9.9	16	21	21	17	37	2	,,		126	
1	"	**	19s	1	,,	12	48A	2	,,	2.5	126A	


## Model No. 0.85 Notice Board

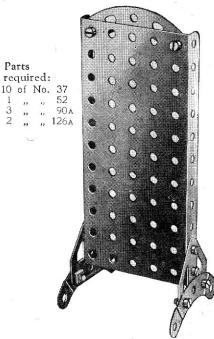



## Model No. 0.86 Drafting Table


#### Parts required:

4	of	No.	5	1 1	of	No.	52
12	,,	,,	37 48 A	4	23	,,,	90 A
1	,,	23	48A	2	,,	21	126A

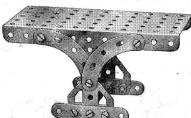

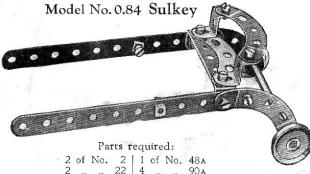

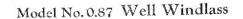


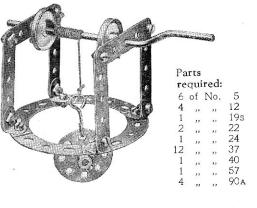

# Model No. 0.89 Pulley Block



# Model No. 0.90 Derricking Crane

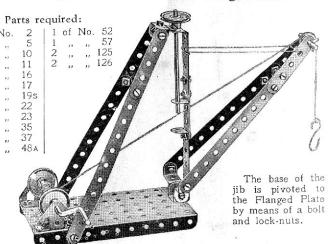

# Model No. 0.88 See-Saw


		Pa	rts re	qui	rec	l:	
4	of	No.	2 .	1	of	No.	52
1	,,	22	16	4	,,	22	90A
2	,,	27	22	2	1)	75	126
12	13	"	37				_
1	,,	,,,	48A				24
							4

#### Parts required:


				i ai		color						
1	of	No.	2	1	of	No.	22	1	of	No.	52	
2	,,	,,	5	1		,,	23		,,	,,	57	
2	,,,	12	11	1	,,	11	24	2	1,1		90A	
1	,,	1,	17.	- 5	,,	2.5	35	2	"		126 126A	
1	11	**	19s	20	,,	5.5	37	2	2.5	"	120A	

#### Model No. 0.91 Rock Drill


						cqu	u.cu.				
1	of	No.	11	4	of	No.	22	2	of	No.	48A
		. ,,				,,					
1	,,	,,,	17	2	,,	"	35	2	,,	11	125
1			190	5			37				

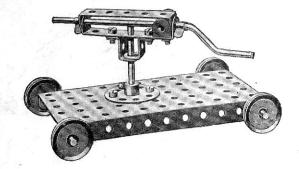


#### Model No. 0.92 Drilling Machine

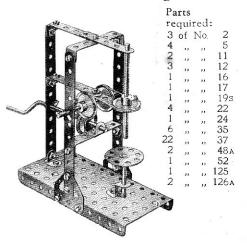

# Model No. 0.94 Scales

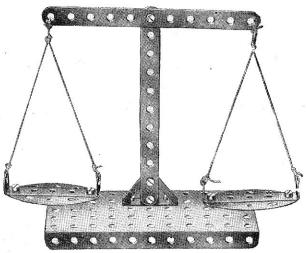

#### Model No. 0.96 Cot

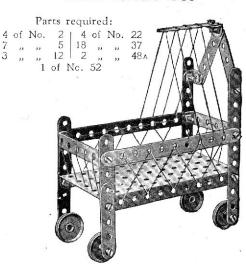

# Model No. 0.93 Counter Scales

Parts	ree	quir	ec	1:

	1	of	No.	2	7	of	No.	37						
	2	12	2.7	10	1	21	,,	44						
	2	1)	13	12	1	,,	11	52						
	1	,,	13	17	2	,,	1)	126						
							~~			-		- /		
						O.	A			Mark N		7		
1					S	'n	$M_{\bullet}$		0			M .		
V		The same of		ø,			- (Z					]		
		4	•		٠,			196	-		83	1		
					D.				*	•	~			
	4		*		8			6	•		_	$\circ$		
		•	***	-	. 4			4	$\circ$	۰.	_	, 0	<b>&gt;</b>	
		-			-				$\Box$			and P		
	-		C			ο.	0		المحمد				9	
		0	C			94						September 1		
1.			200						No. of Concession, Name of Street, or other Persons, Name of Street, or ot					

#### Parts required:


2	of	No.	2	2	of	No.	48A
9	2)	31	2 37 37a	1	,,	1)	52
1	2)						90 a
		1	of N	lo.	166	5	


# Model No. 0.95 Single Sheave Pulley Block




required:
1 of No. 23
12 , , , 37A
1 , , , 57
4 , , 111c
2 , , 126A

#### Model No. 0.97 Couch

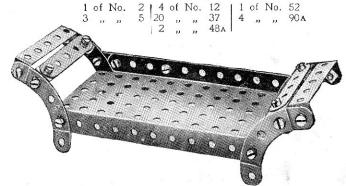


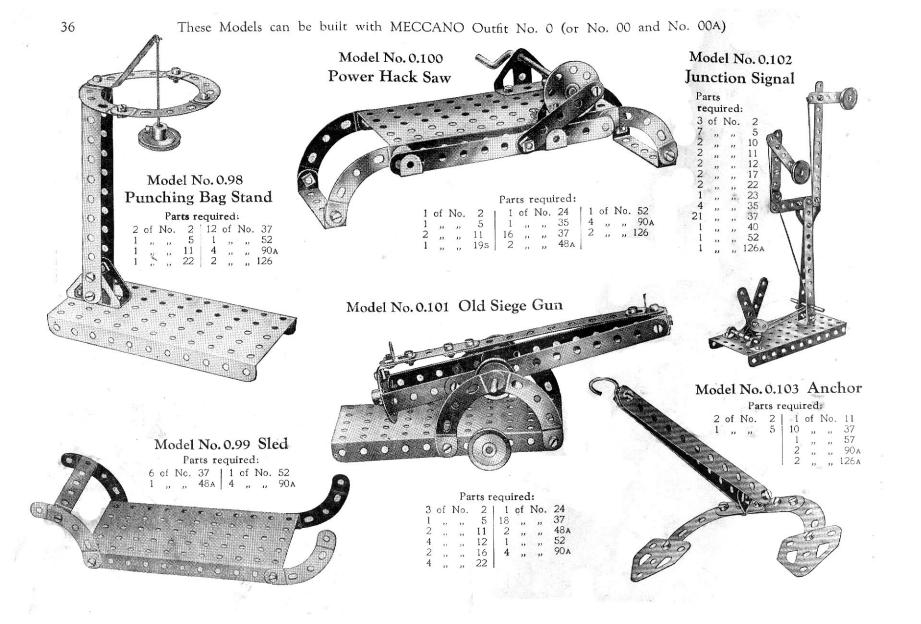

# Model No. 0.104 Aeroplane

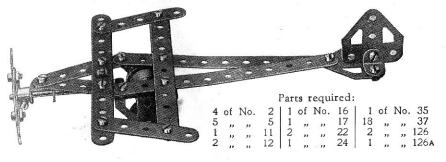



#### Model No. 0.107 Bath Chair

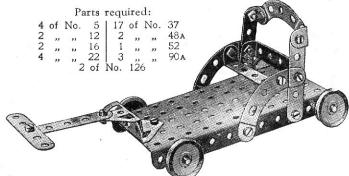


# Model No. 0.106 Dump Car


#### Model No. 0.105 Bench Lathe

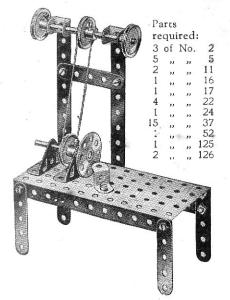


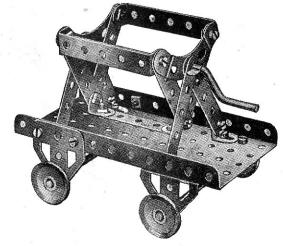


						1					
9	of	No.	5	2	of	No.	35	2	of	No.	90 a
6	,,	17	12	22	,,	23	35 37 48A 52	2	,,	1,	126
1	,,	,,	19s	2	,,	"	48A	2	,,	12	126A
4			22	1.			52	8			

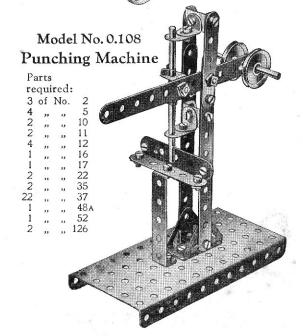


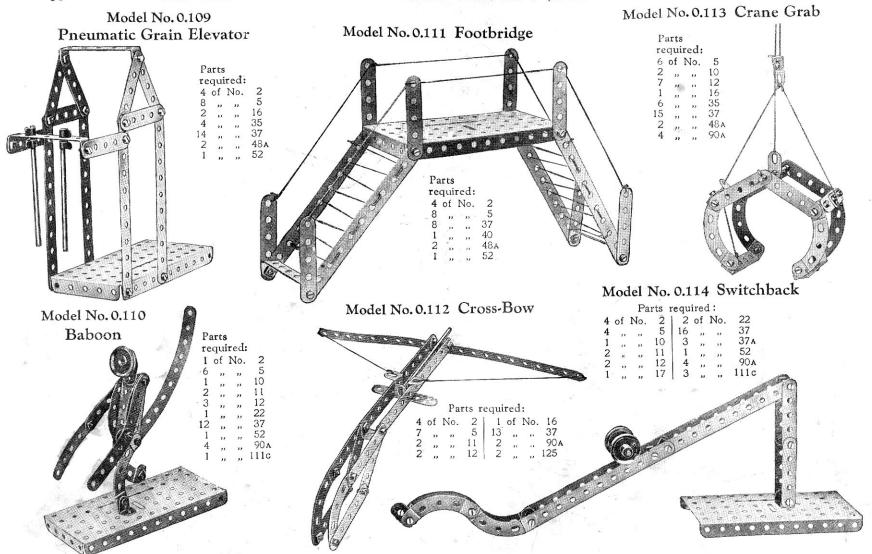

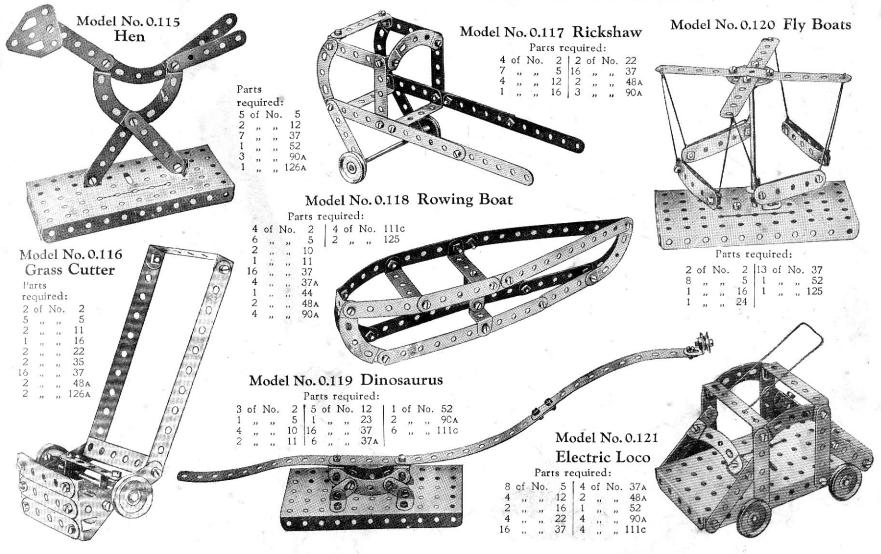

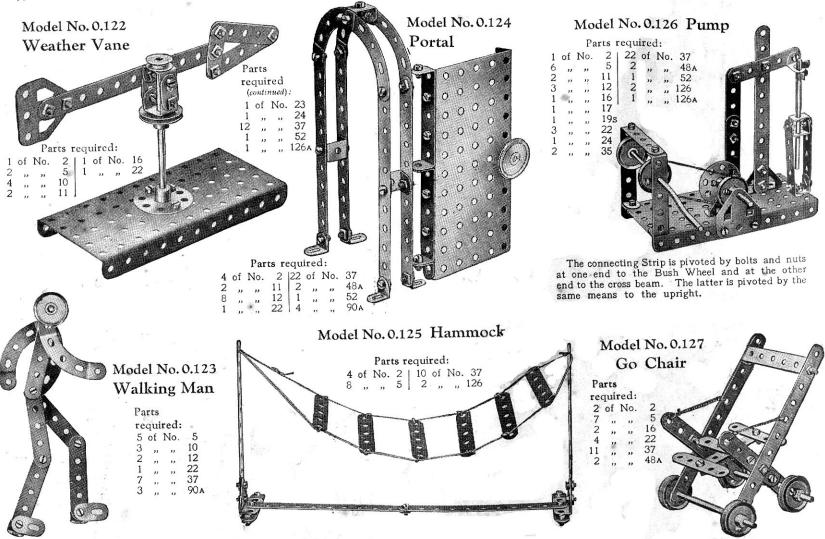


#### Model No. 0.128 Machine Gun

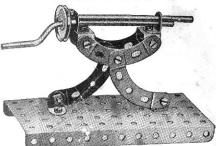

#### Parts required:

2	of	No.	11	1	of	No.	22
4	,,	11	12	12	,,	,, ∉	37
1	,,	1)	16	1	23	,,	52
1		21	19s	4	21		90A

#### Model No. 0.129 Bench

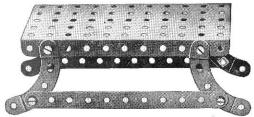


#### Parts required:

LC.	y ui	LCU.	
2	of	No.	2
8	2)	"	37
1	23	12	52
4			90 A

# Model No. 0.130 Swivelling Crane

7
7
_
227
7
t
t
t

# Model No. 0.132 Prancing Horse

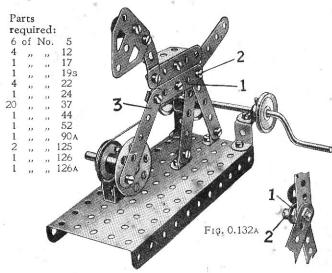

The Strip 1 forming part of the body is free to move about the Bolt 2, but two nuts on the latter secure the rear legs and tail rigidly together. The arrangement of the various Strips about this Bolt 2 is shown more clearly in Fig. 0.132A. The Strip 3 is free to move at each end about pivots formed from bolts and nuts.


of No. 48A


,, 125

# Model No. 0.131 Battleship

		Ω	
Parts	4 of No. 10	3 of	No. 22   2
required: 🌁	1 , , 11	1 ,,	,, 24 1
4 of No. 2	1 ,, ,, 16	1 ,,	,, 35 2
2 5	1 ,, 17	22 ,,	., 37   1
			2 of No.
		Care	

## Model No. 0.133 Viaduct

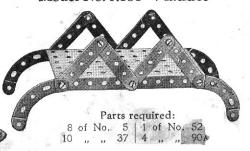


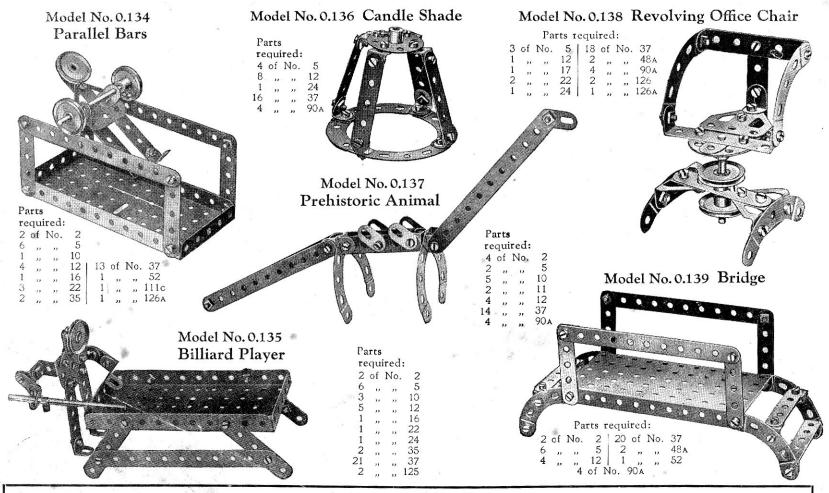

#### HOW TO CONTINUE

This completes our examples of models that may be made with MECCANO Outfit No. 0. The next models are a little more advanced, requiring a number of extra parts to construct them. The necessary parts are all contained in a No. 0A Accessory Outfit, the price of which will be found in the list at the end of this Manual.

#### Model No. 1.1 Jockey Pulley

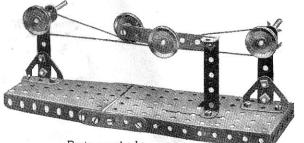


#### Parts required:

1	of	No.	3	, 2	of	No.	35	1	of	No.	52
4	,,	,,	5	20	,,	,,	35 37 37 <sub>A</sub> 48 <sub>A</sub>	1	,,	E.	54
2	,,	,,	17	1	,,	,,	37a	2	,,	,,	111c
4	,,	,,	22	1	,,	"	48A	2	,,	,,	126


The weight of the pivoted 3½" Strip, augmented by the 1" fast Pulley Wheel, causes the jockey pulley to press on the belt. Hence the latter is kept always taut.

# Model No. 1.2 Triangle of Forces

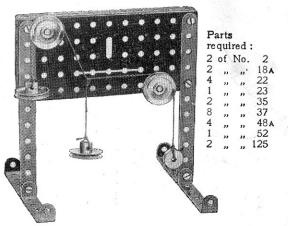


The suspended weights represent three forces acting on a central point. If a triangle is drawn with its sides respectively parallel to the three converging cords, i.e., parallel to the directions of the three forces, the lengths of the sides will be found to be proportional to the respective magnitudes of the forces.

# Model No. 1.5 Belt Gear Right-angle Drive Transmission

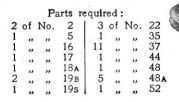

Model No. 1.3


Band Brake

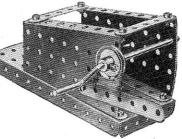

Model No. 1.4

"H" Girder


Parts
required:
6 of No. 2
2 , , 10
8 , , 12
12 , 37

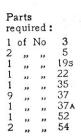


Model No. 1.6

Bacon Slicer

6	of	No.	5	2	of	No.	22	
2	,,	,,	10	1	-21	,,	35	
1	,,	,,	16	10	- ,,	,,	37	
1	,,	,,	19в	1	,,	,,	. 52	
1	. ,,		19s	2		2000	125	

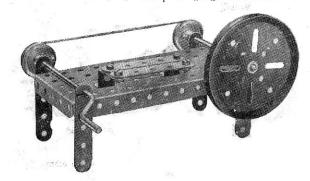




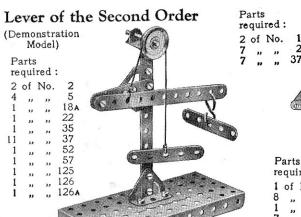


The fulcrum is at one end, the load at the other and the power lies between the two.


# Model No. 1.9 Compound Triangulated Truss

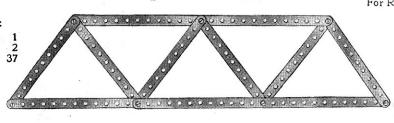

# Model No. 1.10 Howe Truss

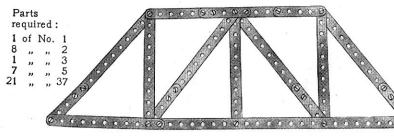

# Model No. 1.11 Triangulated Truss

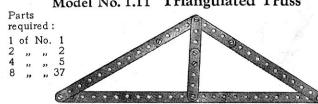

Model No. 1.12 45° Set-Square


Model No. 1.13
60°
Set-Square
Parts

Parts required:
3 of No. 2 | 1 of No. 3
5 of No. 37

Parts
required:
2 of No. 2
1 ,, 3
2 ,, 10
5 , 37


# Model No. 1.14 Belt Gear

For Reversing Motion of Driven Shaft

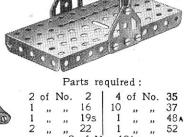

# Model No. 1.15 Belt Gear

For Driving Shafts at Right Angles

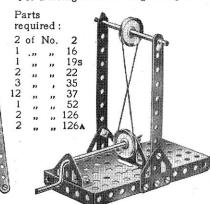

## Lever of the Third Order (Demonstration Model)


Model No. 1.8

Parts required: 2 of No. 2 4 , , 5 1 , , 18A 1 , , , 22 1 , , , 37 1 , , , 57 1 , , , 57

The fulcrum is at one end, the load at the other and the power lies between the two.

# Model No. 1.16 Pulley Block

Demonstration Model: 1 Fixed and 3 Movable Sheaves. Theoretical Mechanical advantage: 8 to 1

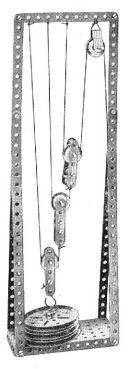

#### Parts required:


4	of	No.	1	2	of	No.	18 <sub>A</sub>
3		36	2	3	,,	"	19в
6		,,	5	4	"	,,	22
2	"		11	15	,,	,,	37 44
2	"	"	12	1	"	"	52
2	,,	"	17	1	"	"	57

# Model No. 1.17 Pulley Block

Demonstration Model:
3 Fixed and 2 Movable Sheaves.
Theoretical Mechanical advantage: 5 to 1


#### Parts required:

	of	No.	1	4	of	No.	19в
7	,,	,,,	2	4	,,	"	22
6	,,	**	5	6	,,	"	35
22222	,,	,,	10	22	,,	,,	37
2	,,	,,	11	1	,,	,,	44
2	,,	"	16	1	,,	"	52
2	"	,,	17	1	,,	,,	57
2	"	"	18 <sub>A</sub>	2	,,	"	126a

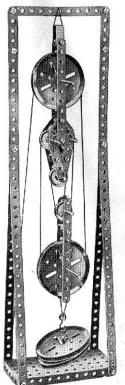

# Model No. 1.18 Pulley Block


Demonstration Model: 1 Fixed Sheave and 2 Suspended Blocks. Theoretical Mechanical advantage: 4 to 1

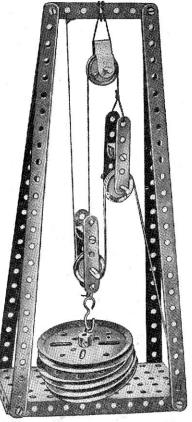


#### Parts required:

4	of	No.	1	4	of	No.	19B	
1	,,	,,	3	3	,,	,,	22	
4	,,	,,	5	10	,,,	,,,	37	
2	,,	,,	11	1	,,	33	44	
1	,,	,,	17	1	,,	,,	52	
2	,,	,,	18A	1	,,	49.	57	


#### Model No. 1.19 Belt Gear

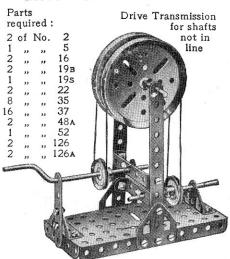

# Model No. 1.20 Belt Gear

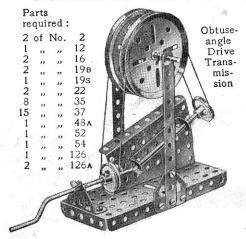


#### Model No. 1.21 Invalid Chair

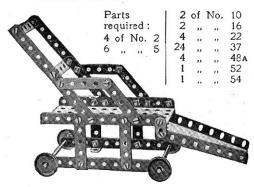


# Model No. 1.22 Letter Balance

				· Pa	arts	req	uired	:			
6	of	No.	2	4	of	No	22	1 2	of	No.	48A
3.	,,		5	1	,,	23	24	1	,,,	D	52
1	,,		10	26	,,	1)	37	2	,,		111c
2	"		12	4	,,	1)	37A	2	,,		126
1	,,		18A	1	1,	21	38	2	**		126A
1	"	125	19в	1	17	**	44				

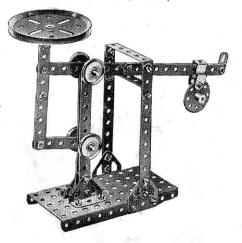


#### Model No. 1.23 Ticca Gharry

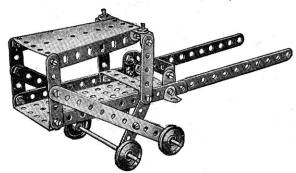


			Parts						
of	No.	2	6 of	No.	12	122	of	No.	3
	79.25	5	12		16	1			-

6 ,, ,, 5 2 ,, ,, 16 1 ,, ,, 52 2 ,, ,, 16 1 ,, ,, 52 2 ,, ,, 10 4 ,, ,, 22 1 ,, ,, 54

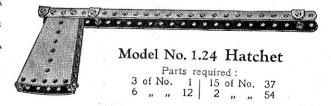


# Model No. 1.25 Truck with Sides

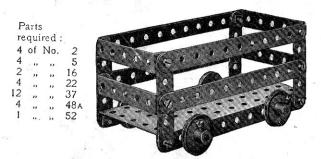


#### Model No. 1.26 Mechanical Saw

				Par	ts	requi	red:				
1	of	No.	2	1	of	No.	17	4	of	No.	38
8	3 ,,	,,	5	1	,,	,,	19s	1	,,	,,	44
1	,,	,,	10	3	,,	,,	22	4	,,	,,	48A
1	,,	,,,	11	1	.,,	,,	24	1	,,	,,	52
4	ŀ,,	,,	12	3	,,	,,	35	2	,,	.,	125
1			16	22			37	1		10	126A

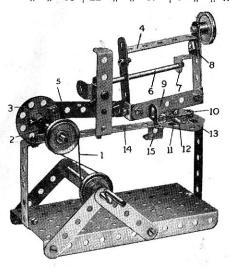


The Strip 9 represents the saw. The Crank Handle drives through a belt 1 a short Rod journalled in a Double Bracket 2 and carrying a Bush Wheel 3. The latter imparts a reciprocating motion to the saw frame 4 through a 2½° Strip 5 loosely mounted on bolts secured to the Bush Wheel and to an Angle Bracket bolted to the saw frame. This frame slides on a 3½° Rod 6, which acts as a guide, passing through the frame and supported in a reversed Angle Bracket 7. A washer is placed on the Bolt 8 behind the Bracket 7. A vice to secure the objects in position for cutting consists of a Flat Bracket 10 mounted on a Bolt 11, a few turns of which causes the Flat Bracket to grip the object 12. The Bolt 11 enters a nut held between the Flat Trunnion 13 and 5½° Strip 14, which are spaced apart for the purpose by washers placed on the two bolts holding the Truannion in position. The saw frame rests on the stop 15 when not in use. A 1° Pulley secured to the top of the frame acts as a weight and helps to steady the saw.

#### Model No. 1.27 Dinner Wagon

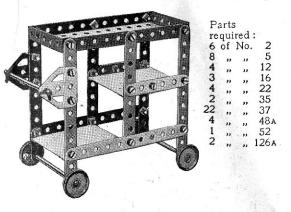


The two lower platforms are constructed out of pieces of ordinary cardboard, their outer edges resting on  $2\frac{1}{2}$  Double Angle Strips and their inner edges on Angle Brackets.

# Model No. 1.28 Tip Wagon

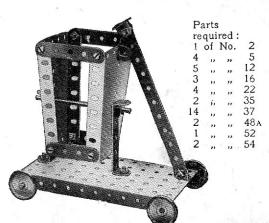


#### Model No. 1.29 Aeroplane

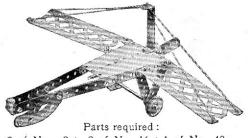


				Parts required:									
2	of	No.	2	1 2	of	No.	16	1	of	No.	48A		
5	,,	,,	5	2	,,	,,	22	1	,,	,,	54		
1	,,	,,	11	1	,,	,,	24	2	,,	,,	90A		
6	,,	,,,	12	21	,,	,,	37	2	,,	,,	100		

# Model No. 1.30 Timber Drag

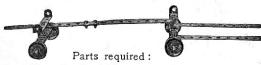


4 of No. 2 | 2 of No. 16 | 8 of No. 37 2 , , 11 | 4 , , 22 | 4 , , 48A

#### Model No. 1.31 Lawn Mower

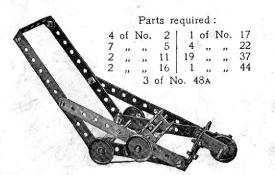


# Model No. 1.32 Tandem Car

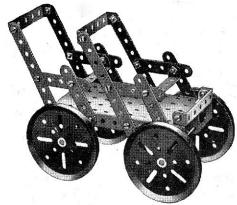


Parts required:

8 ,, 5 5 ,, ,,	37	No.	of	26	2	No.	of	4	
2 12 1 1	48A	1)	,,	5	5	,,	,,	8	
		- 10	21	1			12	2	
2 , , 16 2 , , 1	126a	12	. 11	2	10 n		"	4	

# Model No. 1.33 Mechanical Hammer

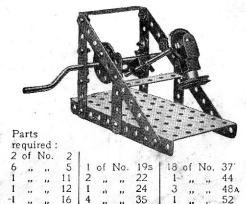

#### Model No. 1.34 Hand Loom

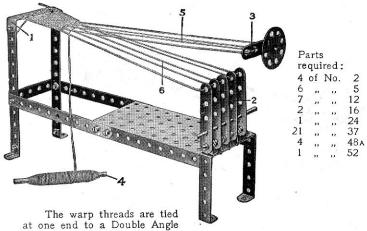


Strip 1, whilst their other ends are secured alternately to the


tops of the upright Strips 2, and the 21" Strip 3. The "shedding" movement of the warp is obtained by moving the Strip 3 up or down each time the shuttle—a 3½" Rod 4— is passed between the two layers of warp 5 and 6. Wool or similar material is particularly suited to this apparatus. The strands 6 should be kept very taut, and the weft threads may be closed up with the woven portion by means of an ordinary comb each time the shuttle passes.

#### Model No. 1.35 Gong


# Parts required:

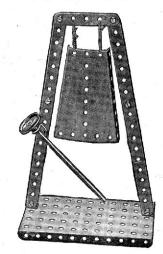

# Model No. 1.37 Punching Machine

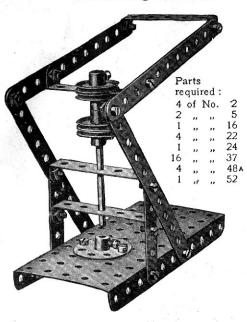


#### Model No. 1.36 Roundabout

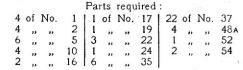


Begin to build this model by making the platform from a Flanged Plate and  $12\frac{1}{2}$  Strips. The drive from the Pulley on the Crank Handle is taken to a 1" Pulley fast on the vertical 2" Rod, another similar Pulley being secured to this Rod beneath the Plate.

The arms are formed of four 51 Strips bolted to a Bush Wheel fast on the 2" Rod.

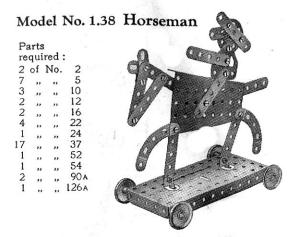


# Model No. 1.39 Revolving See-Saw

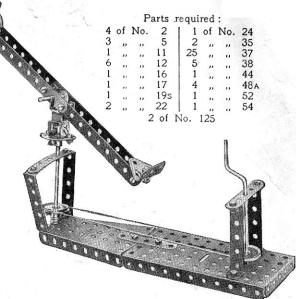



# 


# Model No. 1.41 King Meccano

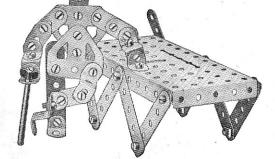

1	of	No.	3	1	of	No.	35	
9	,,	**	5	30	,,	,,	37	
5	,,	11	10	1	,,		52	
8	,,	13	12	2	,,		111c	
1	"	17	17	2	,,		125	
1	"	"	22	2	,,	,,	126A	

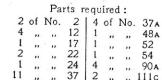


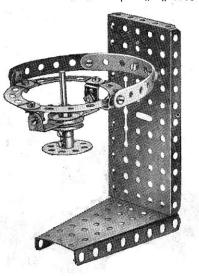

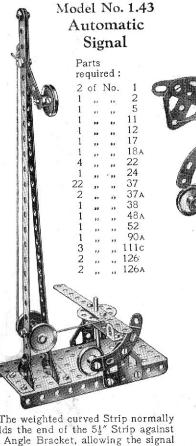


The weighted curved Strip normally holds the end of the 5½" Strip against an Angle Bracket, allowing the signal arm to fall to the "all clear" position. Any train passing the signal however, strikes the opposite end of the 5½" Strip, and by means of the cord shown, raises the arm to indicate "danger." The Curved Strip moves to allow the end of the 5½" Strip to pass over it, and is returned to its original position by reason of its weighted end. The signal then remains at "danger" until the mechanism is re-set.

#### Model No. 1.44 Horse and Cart

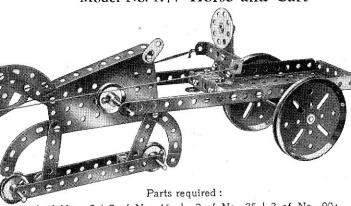



4	of	No.	2	12	of	No.	16	2	of	No.	35	3	of	No.	90A
3			.5	12			18a	26			31			13	IIIC
3	-		10	12			19B	1	12	"	48A	2	27	12	125
2			11	1 4			22	1			52	2			120
2	,,	,,	12	1	.,	,,	24	1	**	••	54	2			126A

#### Model No. 1.45 Drill

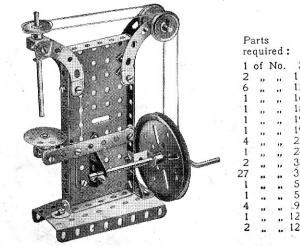


#### Model No. 1.46 Patent Luffing Crane

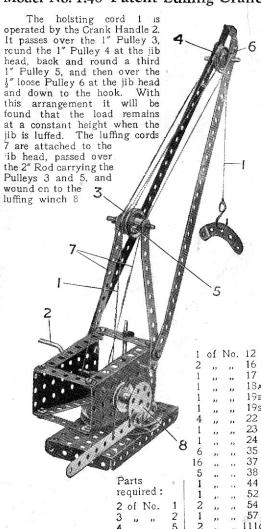

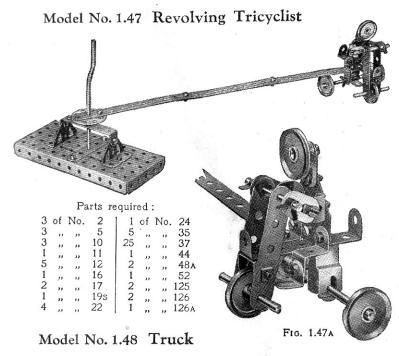


# Parts required: 2 of No. 16 4 " 198 8 " 37 2 " 48A 1 " 52 2 " 100


# Model No. 1.49 Steam Shovel

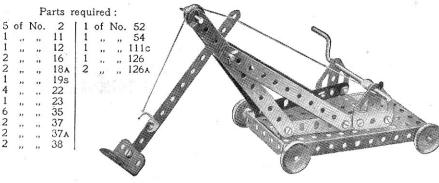

# Model No. 1.50 Cot on Wheels

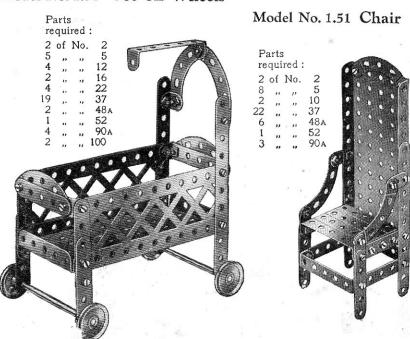


#### Model No. 1.52 Bow Girder

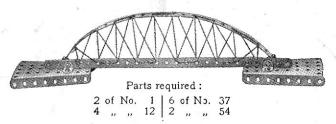

#### Model No. 1.53 Coaster

The figure 1 is loosely attached by lock-nutted Bolts 2 to the Sector Plate 3 and is connected to the Bush Wheel 4 by the pivotally-attached  $2\frac{1}{2}$  Strip 5. The  $1\frac{1}{2}$  Rod carrying the Bush Wheel 4 is journalled in the Cranked Bent Strip 6, the 1" fast Pulley 7 being connected to the road wheel by a cord as shown


#### Parts required:

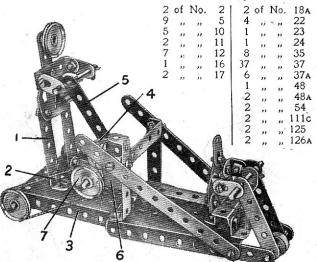

# Model No. 1.54 Hooke's Coupling

#### Parts required:


2	of	No.	11	7	of	No.	35	
			12					
3	,,		16	1		13	48	
2	,,,	,,	19в	2	.,	,,	48a	
1	,,,	,,	19s	1	,,	,,	52	
			2 of	No.	54			

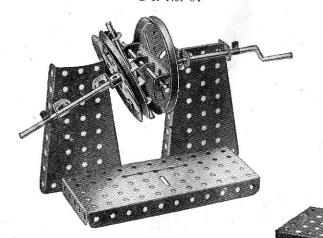

# Model No. 1.55 Quick Return Device



# Model No. 1.56 Arc Lamp

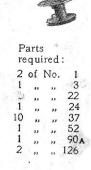

2	of	No.	2	1	of	No.	24
1	,,		3	6	,,	,,	35
2	,,	,,	5	15	,,	,,	37
2	,,	,,	11	2	,,	,,	37A
2	1)	,,	12	3	,,	,,	48A
1	. , , ,	,,	17	1	. ,,	,,	52
2	,,	,,	18A	2	,,	.,	125

# Model No. 1.57 Bow and Arrow

Parts required:
1 of No. 1 | 1 of No. 16




# Model No. 1.58 Friction Grip Tongs

The hoisting cord is attached to the Double Bracket 1. The joints 2, 3 are lock-nutted, so that when the grip is raised the ½" loose Pulley Wheel 4 slides upward between the 2½" Strips 5, and the grip closes upon the block of wood or other material placed between its jaws.

#### Parts required:

3 of No. 2 | 1 of No. 11 8 ,, 5 | 1 ,, 23 4 ,, 10 | 2 ,, 35 12 of No. 37

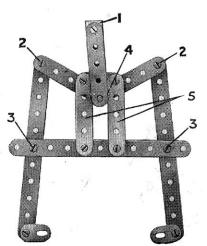


#### Model No. 1.59

#### Cum Bak


Parts required:

1 of No. 18A
2 , , 19B
2 , , 22
1 , , 23
1 , , 35
8 , , 37
4 , , 48A

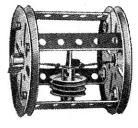


A short length of elastic is doubled and stretched between the centres of the 3" Pulley Wheels. weight, consisting of two 1" fast Pulley Wheels and a 11" Rod, is suspended from it in the middle of the drum. When the Cum Bak is rolled along any smooth level surface, the elastic becomes twisted and stores up sufficient energy to return the drum to its starting point. If the mechanism is concealed by a thin cardboard covering, the model will cause much amusement by its mystifying behaviour.

#### Model No. 1.60 Aeroplane

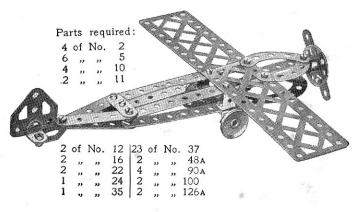

#### Model No. 1.61 Gangway


4	of	No.	2	1	of	No.	16	22	of	No.	37	12	of	No.	100
2	,,	,,	5	1	,,	"	22	4	,,	,,	48A	1	,,	,,	111c 126A
3	,,	"	10	1	39	,,,	23	1	,,	"	52	2	,,	**	126A
- 1			12	4			35	1 1			54	1			

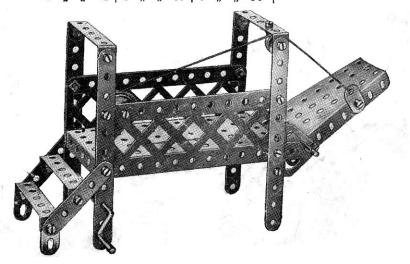




# Model No. 1.64 Cable Railway


#### Model No. 1.67 Man and Boy

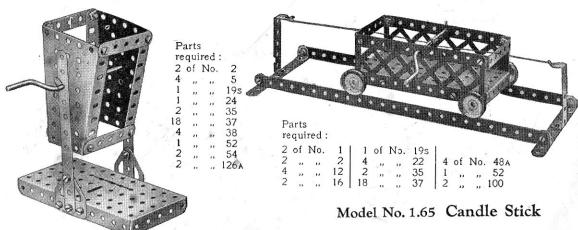

# Model No. 1.63 Inverted Centrifugal Governor

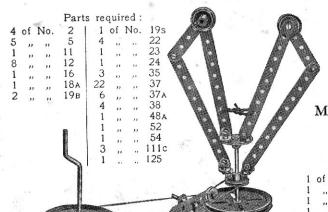


	arts		
re	qui	red	
2	of	No.	11
4	,,	,,	12
1	,,	11	19B
4	"	,,	. 37
1	,,	**	111c
l			125

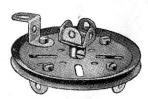

Parts
required:
4 of No. 2
1 " " 3
1 " " 5
5 " " 10
1 " " 12
1 " " 22
1 " " 24
26 " 37
1 " " 52
2 " " 54
1 " " 90
2 " " 125
1 " " 126
1 " " 126
1 " " 126

Model No. 1.66 Machine for Tracing a Locus

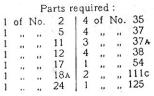

The  $5\frac{1}{2}''$  Strip is pivoted to the  $2\frac{1}{2}''$  Strip by means of a Bolt and two Nuts, and the  $2\frac{1}{2}''$  Strip is similarly pivoted to the Sector Plate. By revolving the  $2\frac{1}{2}''$  Strip about its pivot, the vertical  $1\frac{1}{2}''$  Rod can be made to trace a locus. If the positions of the  $1\frac{1}{2}''$  Rod and

the 5½" Strip are altered, several different loci may be traced. Machines of this type are of advantage in assisting in the design of engine connecting rods.


# Model No. 1.68 Gramophone


# Model No. 1.70 Lancer

		Parts	requir	ed:		
4	lo. 10 " 12 " 19в	6 of 1 ,,	No. 3	7   1 0	f No.	52 11c
1 "	" 12 " 19в " 23 " 24		(1)			
				尺		
		Market St.		(1)		
		=	(6)			

		Pa	arts re	quir	ed:	:			
1	of	No.	2	4	of	No.	22		
1	"	"	5	. 1	,,,	"	24 35		
9	22	,,,	5	1	,,	,,,		-	
2	,,	"	10	27	,,	"	37	600	
92252	,,	"	11	1	. ,,		48A	(0.03)	11
5	,,	"	12	1	. ,,	"	52 54		,
5	. ,,	,,	16	1	,,	,,,			
1	,,	",	19s of No	4	24,	. ,,	90A	200	6
		1	OI IN	J. 14	AOS				1
					2	- 4		/5 7	

# Model No. 1.71 Stamping Machine

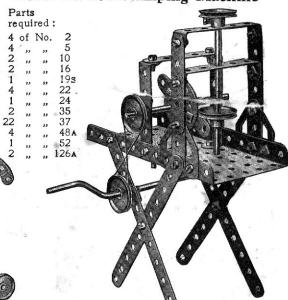

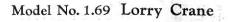



		F	arts	requ	ire	1:		
4	of	No.	2 5	2	of	No.	16	
8 2 2	,,	"	5	1	,,	"	17	
2	,,	"	10	1	,,	,,	18A	
2	,,	2)	12	1	,,	,,	19s	
	21	4		13	"	2)	22	
-				1	"	23	23	
	1			1	,,	23	24	
1		1	i i	3	"	1)	35	
ú				29	, ,,	"	37	
ä				1	,,	"	44	
-	7			5	"	"	48A	
				1	"	"	52	
1		/		1	,,	"	54	
				1	"	,,	57	
			100	2	**	"	125	
				4	.,	,,	126	


# Model No. 1.72 Lazy Tongs

Danta	
\$ Parts	required

				-		-094	nou.				
	2 of 1 4 "	No. 1		1	of	No.	23	. 2	of	No.	48A
53	4 ,,	,, 2	2	12	23	"	37	2			111c
	4	5		10			37A			.,	




# Model No. 1.73 Rowing Boat

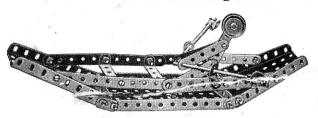

#### Parts required:

4	of	No.	2	4	of	No.	35
4	,,	,,	5	24		,,	37
4	,,	,,	10	3	,,	,,	48A
7	,,	,,	12	1	,,	,,	52
2	,,		16	2	,,	"	54
1	,,	,,	. 22	1	,,	,,	111c

#### Model No. 1.74 Tower Wagon

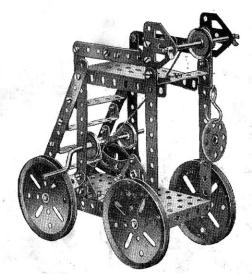

#### Parts required:

6	of	No.	2
6	٠,,	,,	5
3	"	,,	16
4	,,	,,,	19в
1	,,	,,	19s
3	,,	,,	22
2	,,	,,,	35
3	,,	,,	37
5	,,	,,	48A
1	,,	17	52
1	, ,,	"	57
1	,,	,,	125
2	,,	,,	126
2			126 A


# Model No. 1.75

# Weather Vane

#### Parts required:

3	of	No.	1	14	of	No.	37
2	,,	,,	2	1	"	,,	52
1	,,	,,	11	. 1	,,	,,	54 111c 126
2	,,	,,	12	1	,,	,,	111c
1	,,	,,	24	2	,,	,,	126

# Model No. 1.76 Violin and Bow

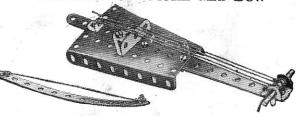


#### Parts required:


4	of No.	2	1	of	No.	12	5	of	No.	37
1	,, ,,	5	1	,,	12	18A	1	,,	"	54
1	10.00	11	2			35	1			126

# Model No. 1.77 Beam Engine

The connecting Strip 1 is attached pivotally by a Bolt and two Nuts (Standard Mechanism No. 262) to one end of the beam 2 and to the Bush Wheel 3. The Strip 4 is similarly connected to the other end of the beam 2 and to the Double Bracket 5 attached to the piston rod. The short rod carrying the flywheel 6 is journalled in a  $2\frac{1}{2}$ " Strip supported by the Trunnion 7 and in a reversed Angle Bracket bolted to the  $2\frac{1}{2}$ " Strip.

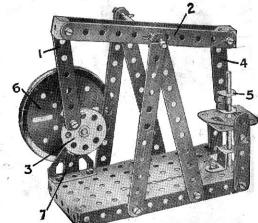

# Model No. 1.78 Motor Lorry

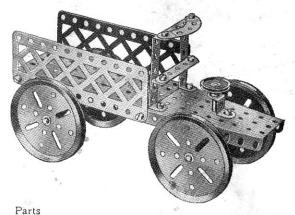

#### Parts required.

2 of No. 2 2 ,, 5 2 ,, 12 2 ,, 16 1 ,, 18A 4 ,, 19B 1 ,, 24 25 ,, 37 2 ,, 38 3 ,, 48A 1 ,, 52

.. .. 100

125


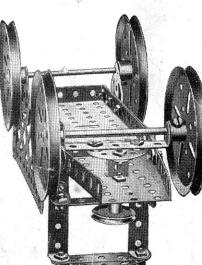


FIG. 1.78A


#### Model No. 1.79 Scales

Parts required:
2 of No. 2
2 , , 12
1 , , 18A
2 , , 35
8 , , 37
1 , , 52
2 , , 54
2 , , 126

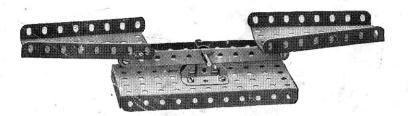

# Model No. 1.80 Spinning Buttons

The Sector Plates 1 and 2 are mounted pivotally on the Rods 3. Two large buttons 4 are placed on lengths of thread or thin elastic stretched between the arms of the Meccanitians 5. Start the model as follows: twist the threads a little with your fingers, pull the Meccanitians outward, then release them sharply. As soon as the buttons are spinning a slight downward touch on the feet of each Meccanitian is sufficient to keep them going. The ends of the Sector Plates 1 and 2 are connected to the Flanged Plate 6 by means of pieces of elastic 7.

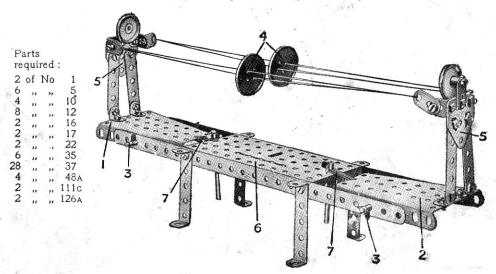

Parts

required:

4 of No.

23

35


48A

54

125

126A

#### Model No. 1.81 Windlass

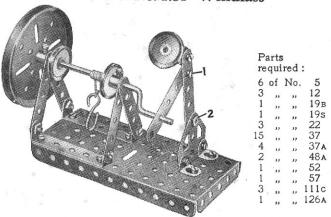

The figure at the right of the model is arranged to work to and fro when the Crank Handle is rotated. The Bolts 1 and 2 are both secured by two nuts as in Standard Mechanism No. 262.

# Model No. 1.82 Top


Parts required:

1 of No. 2 | 1 of No. 19B

1 ,, 16 | 1 ,, 37


1 of No. 125

To spin the top wind a length of cord round the rod, as shown, place on a smooth surface and give the cord a sharp pull. When the cord is clear of the rod remove the 5½" Strip and the top will continue to spin for a considerable period.

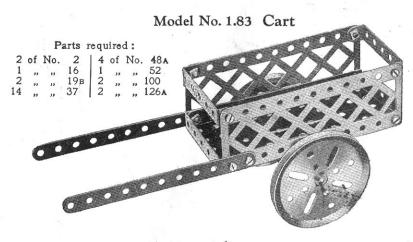

Model No. 1.84 The Invalid

When wheeled along the table the "invalid" appears to push himself energetically along. His neck is a Flat Bracket: his right (or propelling) arm consists of one Angle

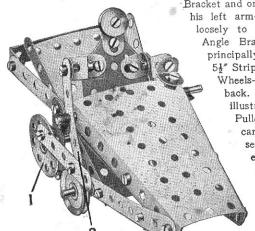

·Bracket and one &" Reversed Angle Bracket, and his left arm-the hand of which is bolted loosely to the chair-is formed by three Angle Brackets. The chair is composed principally of two Sector Plates and four 54" Strips, and it runs on three 1" Pulley Wheels-one in front and two at the back. One of these (not visible in the illustration) drives by cord another 1" Pulley Wheel, the shaft of which also carries a Bush Wheel 1. As will be seen, a 21" Strip is pivoted at one end to this Bush Wheel and at the other end to a second-21 Strip 2, which, rocking about an axle journalled through its centre hole, is again pivoted to the invalid's hands.



				Pa	irts	req	uired:				
2	of	No	1	1	of	No	10	1	of	No	23
2		,,	2	1	,,		11	8	**	27.5	35
4	,,	•••	5	2	,,	13	12	22	33	**	37 44
\				3	,,	**	16 18A	1	**	"	48A
	\	\		1	"	37	198	1	"	**	52
			\	4	"	,,	22	2		"	54
\				_	,,	"		1	,,		57

# Model No. 1.87 Mountain Transport

				Pat	ts 1	requi	red	:			
2	of	No	. 1	3	of	No.	5	12	of	No.	16
2		**	2	2	,,,	1 1	11	4	. **	**	22
de		18	of	No.	37	1	of	No.	52		
10	-	3	,,	,,	484	1	"	.,,	54		
100											

# Model No. 1.85 Ladder on Wheels


Parts required: of No. 1 |16 of No. 37




Model No. 1.88 Tower Wagon

This model will provide many hours of enjoyment. The cords may be made to any length to allow the load to be carried from one side of the room to the other, and, if necessary, a better grip may be obtained by winding the operating cord twice round the Pulley on the Crank Handle. The open sides of the bucket may be closed with cardboard so that it may be loaded with marbles, beads, etc. The bed of the Telpher may be screwed on to a solid base with ordinary wood screws to give better support. The Pulley Bracket, and that securing the cord on which the bucket travels should be screwed in a suitable position on the opposite

side of the room.

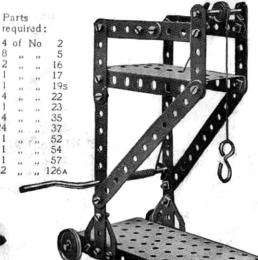


# Model No. 1.89 Fire Alarm

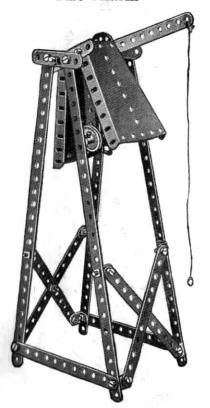

Parts required:


4	of	No.	1	1	of	No.	22	
7		**	2	1		**	24	
1	**	**	3	4			35	
3		**	5	27	**	**	37	
8	**	**	12	2	**	**	54	
١		**	-16	l				

# Model No. 1.90 Swivelling Crane

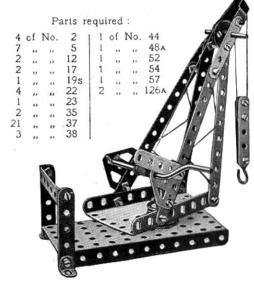


The Sector Plate of the Crane in this model is pivoted to the base with a fast Pulley above and below.


# Model No. 1.91 Quick-Firing Gun

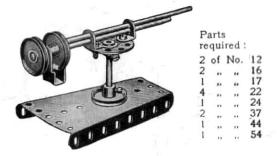



#### Model No. 1.92 Toast Rack

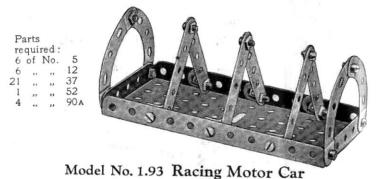

The Double Angle Strip 1 carries the front road Wheels and is bolted pivotally to the  $5\frac{1}{2}$ " Strip 2, whilst the rear axle is journalled in two Angle Brackets rigidly secured to the Strip 2. A Cranked Bent Strip 3 represents a seat. The steering

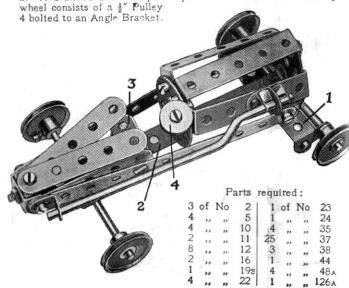


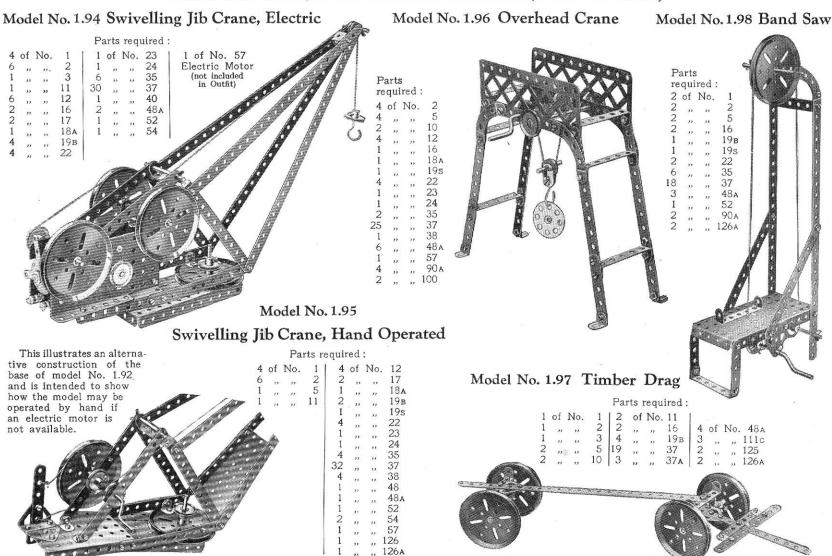

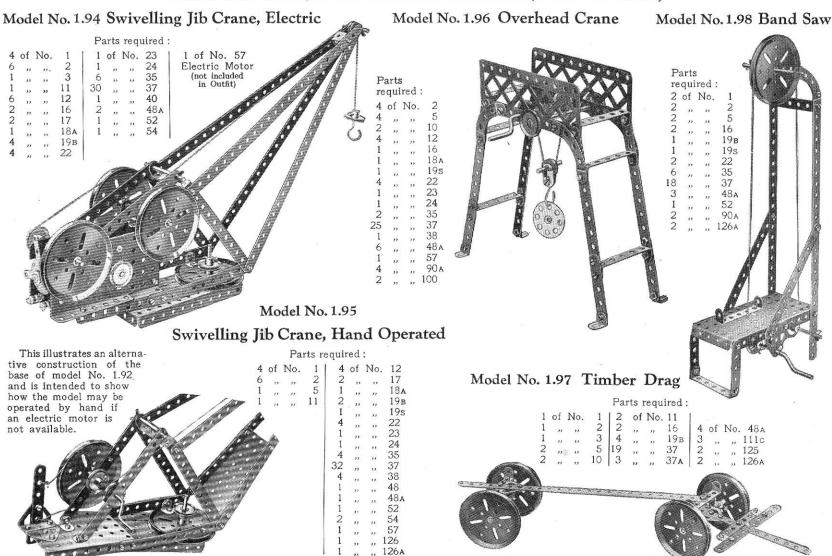

#### Model No. 1.99

# Try-Your-Strength Machine

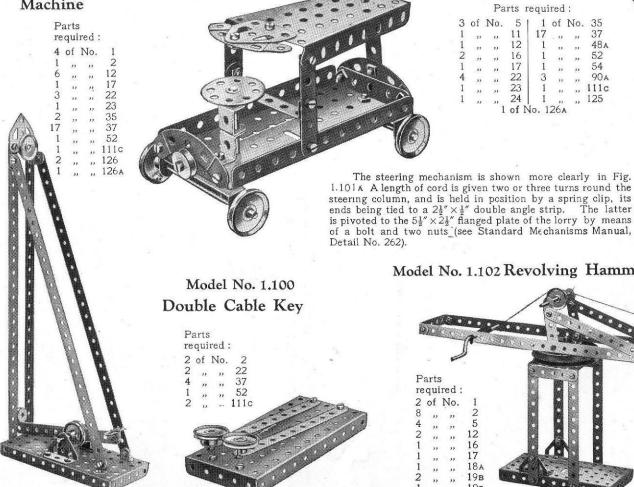

#### Model No.1.101 Motor Van

3	of	No.	5	1	of	No.	35
1	,,,	23	11	17	, ,,	>>	37
1	,,	2.3	12	1	2.3	22	48A
2	,,,	2)	16	1	25	"	52
1	"	73	17	1	,,,	1)	54
4	,,	23	22	3	,,	,,	90A
1	,,	2)	23	1	,,	,,,	111c
1	,,	,,,	24	1	"	,,,	125



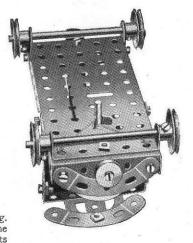


FIG. 1.101A

# Model No. 1.102 Revolving Hammer-Head Crane

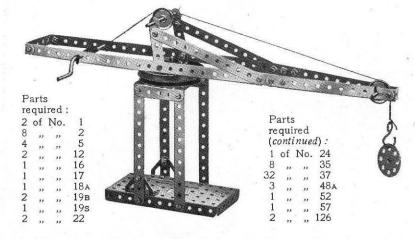

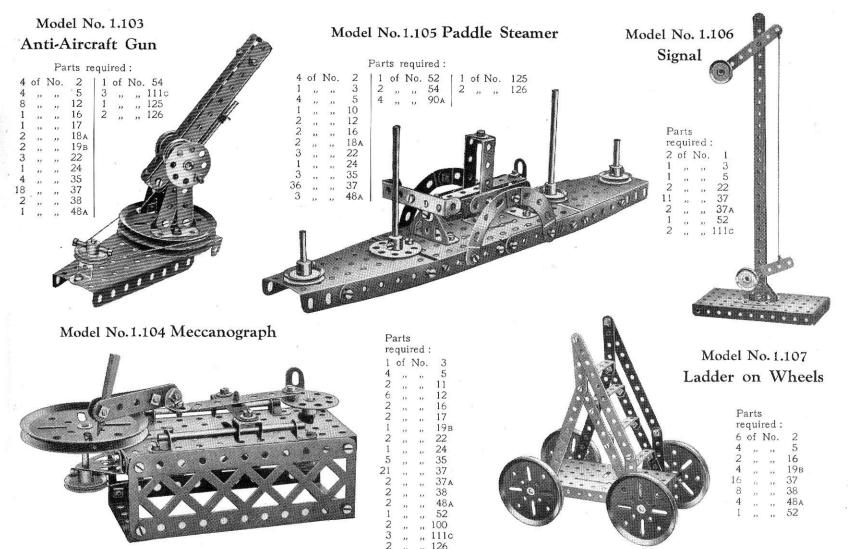


#### Model No. 1.108 Eccentric Dancers

#### Parts required:

6	of	No.	5	4	of	No.	22	12	of	No.	1110
4	,,		10	1	,,		22 23 37 48 <sub>A</sub>	1			125
6	,,	,,	12	20	,,	12	37	2	,,	.,	126A
				4	,,	,,	48A				


# Model No. 1.110 Crosshead Demonstration Model

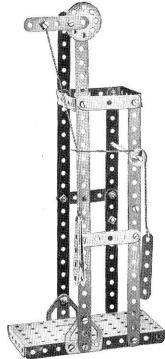

This is an apparatus for determining the forces that act at the crosshead of a reciprocating engine. The upper inclined length of cord represents the connecting rod and the lower, or vertical portion, the piston rod. The pull on the third cord indicates the pressure exerted on the slide bars of the engine due to the angularity of the connecting rod the connecting rod.


# Model No. 1.111 Drop Stamp

Parts

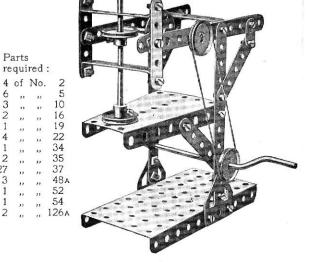



# Model No. 1.112 Blacksmith


# Parts required: 1 of No. 35 2 of No. 126A

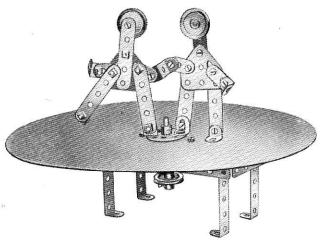


#### Model No. 1.109 Bellows

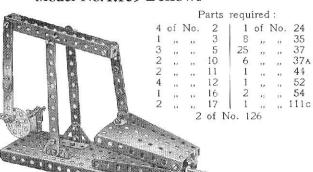

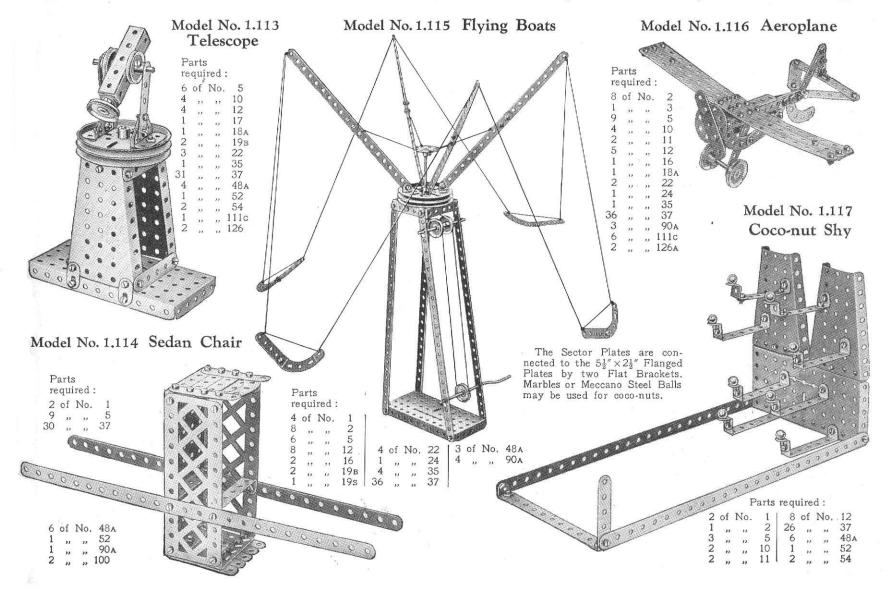


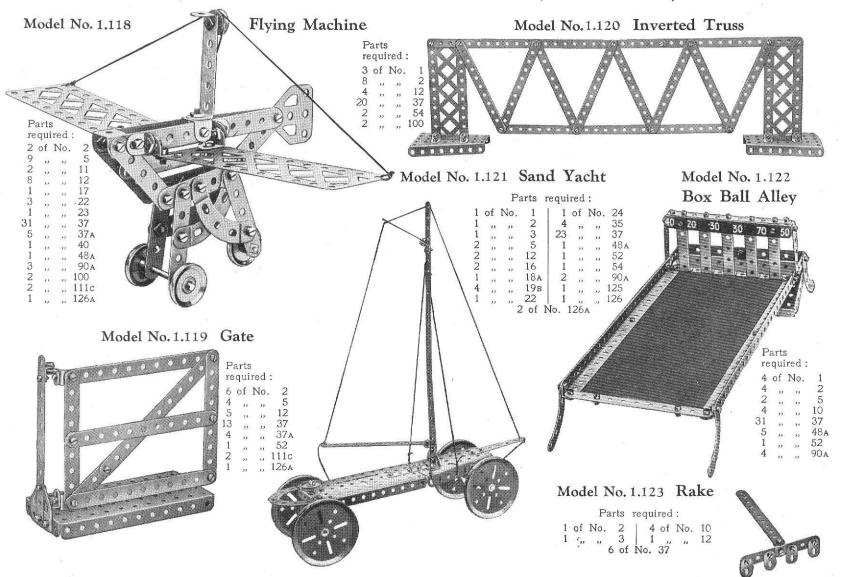



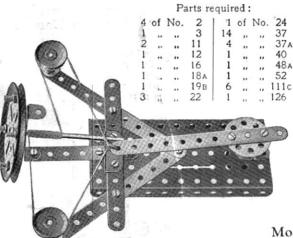

#### Model No. 1.126 Gyroscope

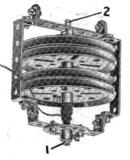


Parts required: 4 of No. 12 ,, ,, 16


The 7/32" Bolt 1 is gripped by the Set-Screw of the Bush Wheel. The lower end of the Rod 2 of the Gyroscope enters the boss of the Bush Wheel and rests on the shank of the Bolt 1.

# Model No. 1.127

Parts required: 4 of No.

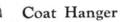


#### Model No. 1.125 Band Brake

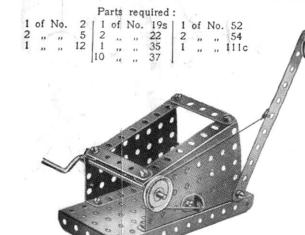


# Parts required:


1 of No. 1 2 of No. 5 2 ,, ,, 2 6 ,, ,, 37 1 of No. 57

# Model No. 1.129 Aerial Flight

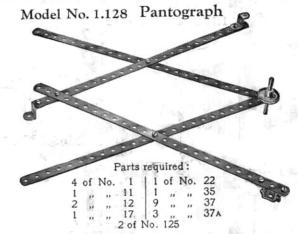


The pantograph enables plans, drawings, etc., to be reproduced on a larger or smaller scale than the original. If a pencil, suitably whittled down, is fixed in the Reversed Angle Bracket at the top of the illustration, and the I 1" Rod is made to follow the outlines of the drawing, the pencil will draw an accurately enlarged sketch. If the positions of the Rod and the pencil be reversed, the latter can be made to trace a reduced sketch of the original drawing.

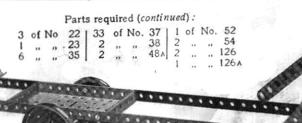

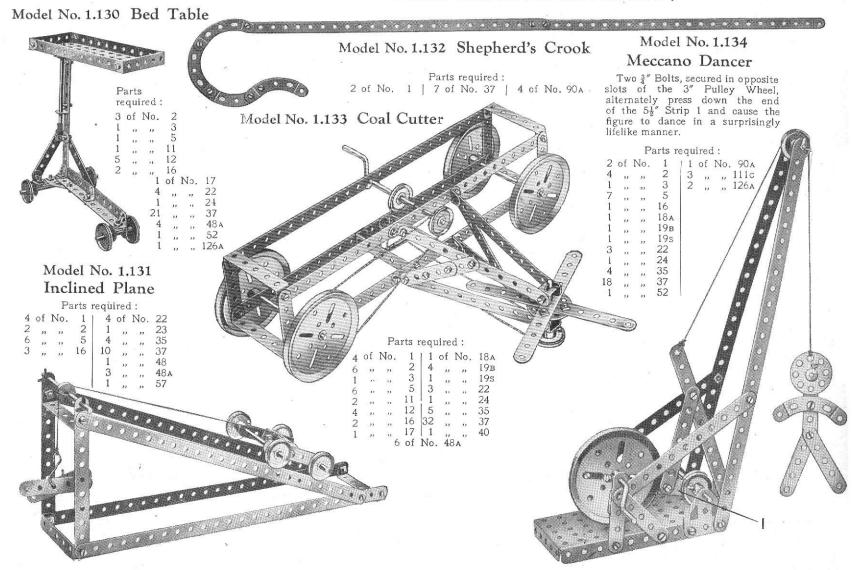

of No.

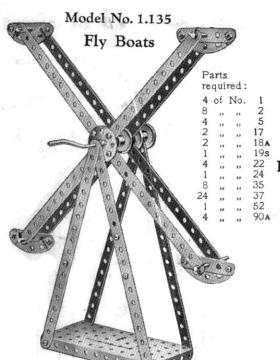


# Model No. 1.136 Tappet Valve Demonstration Model

Parte required:

1	of	No.	3	1	of	No.	24
1	,,	33	5	5	,,	.,,	35
1		.,	10	15		.,,	37
1	,,	**	11	5	,,,	,,	37A
3		"	12	4	,,	,,	38
2	,,	,,,	16	1	,,	11	48A
1	,,	,,	17	1	,,	**	52
1	,,	,,	18A	1	24	**	54
4	,,,	,,	22	2		,,	111c

#### Model No. 1.136

The upper end of the Strip 1 is connected pivotally by a Bolt and two Nuts to the crosshead Bracket 2. The crankshaft is built up as follows: Two Angle Brackets are each secured rigidly to the boss of a Pulley Wheel and are connected to each other by a § Bolt carrying three Nuts. The Nuts are screwed tightly against the Brackets, sufficient space being left between the inner pair to enable the connecting Strip 1 to turn freely. The valve Rod 5 is operated by the Flat Bracket 4 that is clamped between two further 1 Pulleys on the crankshaft in such a way that its protruding end serves as a cam.

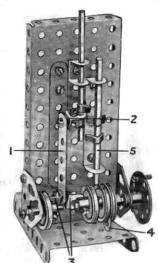

#### Model No. 1.138

Model No. 1.137 Double Draw Bridge

1 | 1 of No. 19s| 2 of No. 38

Parts required:

Cord is passed round the Pulley on the drill spindle 4 and thence over the Pulleys 3 and round the shaft of the Pulley 1. The lever 2 (a 31" Strip) is pivoted by a Bolt and two Nuts at its inner end to an Angle Bracket, and the latter is bolted o a 14" x 1" Double Angle Strip which, in turn, is bolted between the vertical 21" Double Angle Strips. The arm of the lever engages between two Washers on the drill spindle, and on pressing the lever, the drill spindle with its 1" Pulley is forced downwards, thus tightening the Cord, which then transmits the drive to the drill spindle. Immediately pressure on the lever is released, the drill comes to rest.



Parts required:

of No. 3 | 1 of No. 24

" " 5 | 4 " " 35

" " 11 | 16 | " " 37

" 12 | 1 " " 37

" 16 | 1 " " 48


" 18A | 1 " 48

" 19B | 2 " 48

" 22 | 1 " " 111


2 of No. 126A



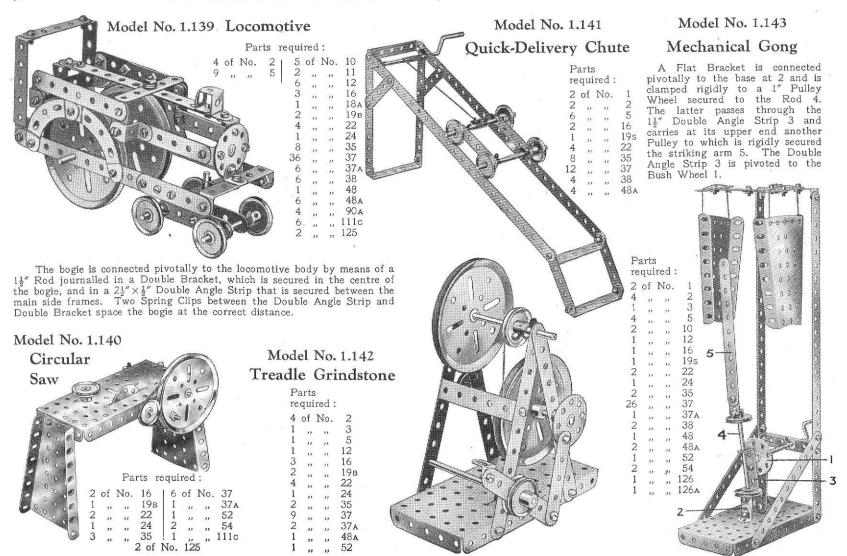


### Model No. 1.147 Horse Rake


## Model No. 1.144 Pile Driver

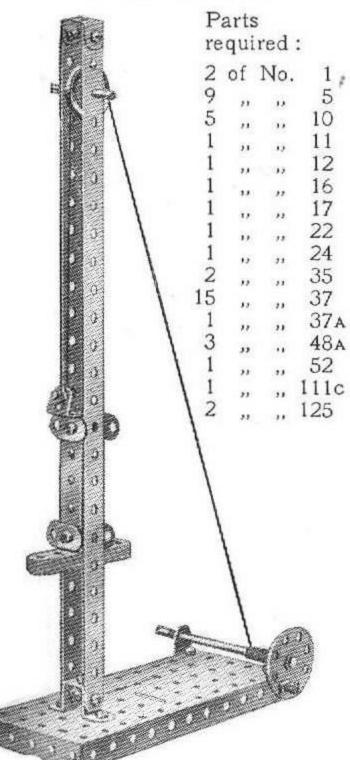



The winding cord is passed round the Pulley at the top of the model and is fastened to an Angle Bracket that is hooked under the protruding portion of a Flat Bracket bolted to the top of the driving head. When the Angle Bracket reaches the Pulley at the top it is pushed out a little, thus releasing the driving head.

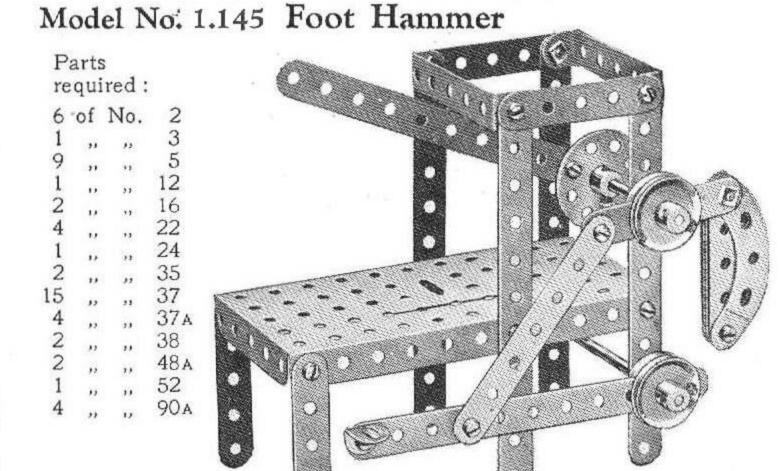


The treadle lever is connected pivotally to a  $3\frac{1}{2}$ " Strip by a Bolt and two Nuts. The upper end of this Strip 2 is similarly connected to a  $2\frac{1}{2}$ " Strip that is clamped tightly between two Pulleys on the hammer Rod 4. Pressure on the treadle causes the hammer to descend on the work. When the treadle is released a weight pulls the hammer back to its original position.

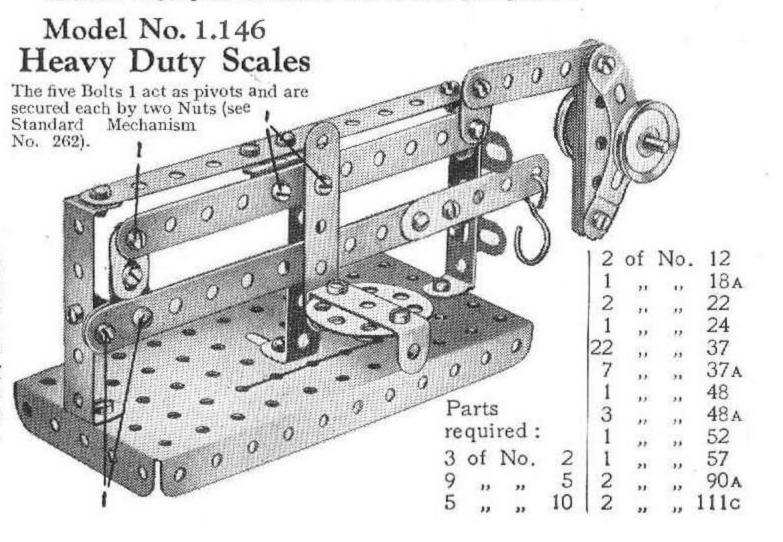

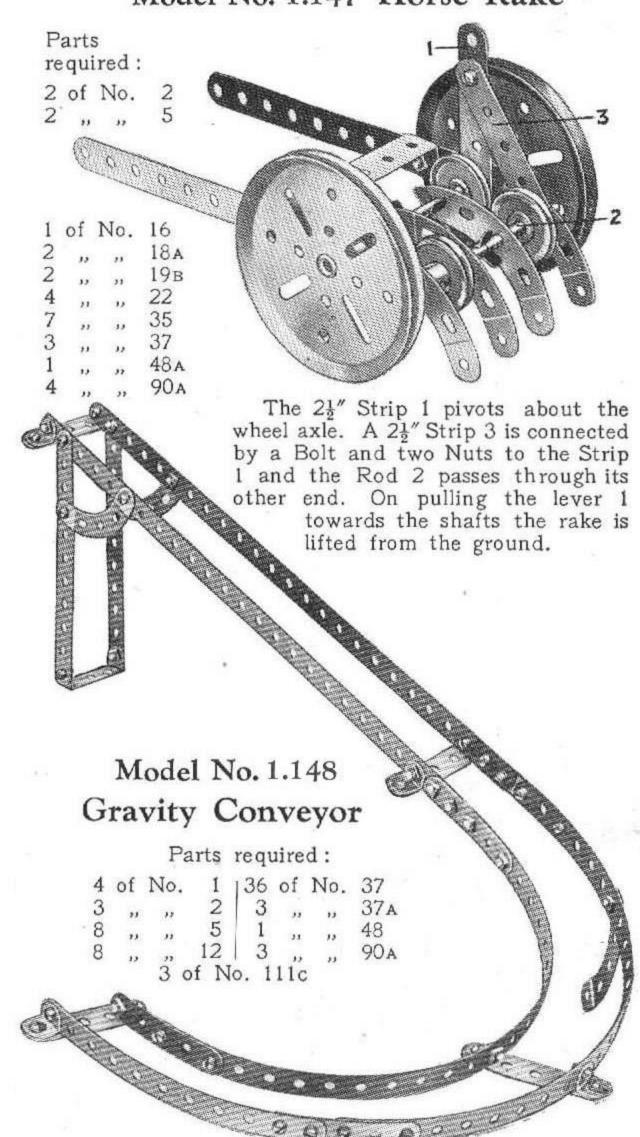

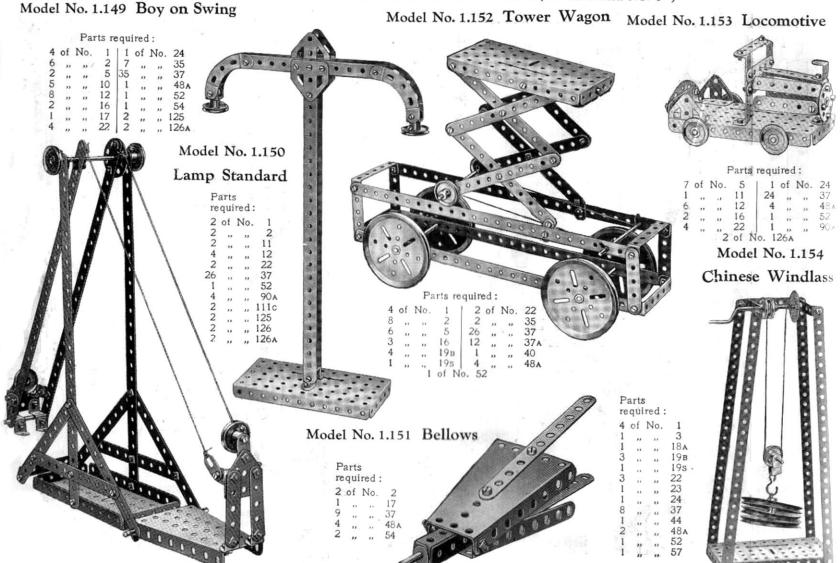

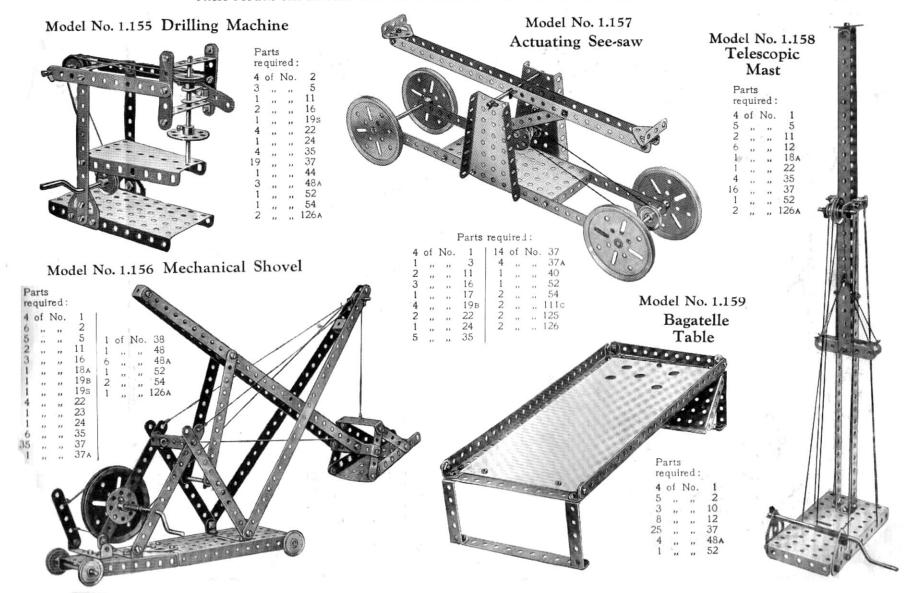


#### Model No. 1.160 Man Climbing Pole




Parts required!

		100					
2	of	No.	1	26	of	No.	37
5	**	**	10	4			48A
ı	**	.,	11	1			52
6	.,	**	12	2	**	1.0	125
1			18A	2	**	**	126
3	10	11	22	1	"	11	126A

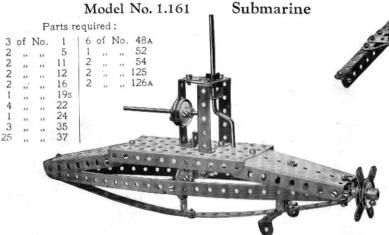

#### Model No. 1.162 Centrifugal Governor-

The 3" Pulley Wheel is bolted to the  $5\frac{1}{2}"\times2\frac{1}{2}"$  Flanged Plate as shown, and the Rod 6 is free to rotate in its boss. The Bolts 1, 2, 3, are provided with lock-nuts. When the engine to which the governor is attached works at too great a speed, the 1" fast Pulley Wheels 4 fly outward and lift the two Double Brackets 5. In actual practice this movement is utilised to close the engine valves and so reduce speed.

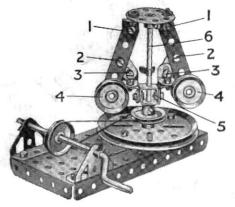



		red	
2	of	No.	5
2	**	,,	10
2	**	**	11
6	**		12
1	**	**	16
1	**	**	19B
1	**	- 21	19s
4		**	22
1	**	**	24
3	**	**	35
18	**	**	37
6		**	37A
2			111c
2			126

Parts required:

1 of No. 1 | 2 of No. 12
2 ", ", 2 | 8 ", ", 37
1 of No. 126A

Model No. 1.164 Jib Crane

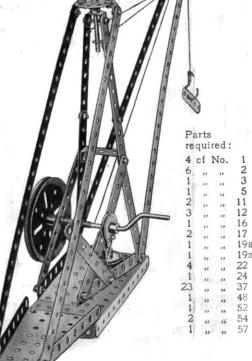

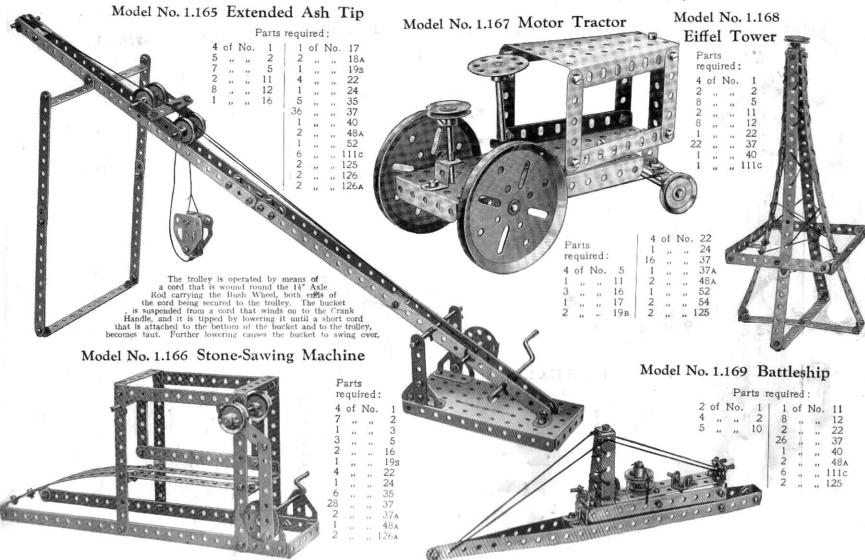

#### Model No. 1.170 Electric Elevator


#### Model No. 1.171 Mounted Cowboy

Two pairs of cords 1 are stretched tightly on each side of the lift shaft to guide the cage 2 and two other cords 3 are secured at the top and bottom of the shaft and passed behind 2½" Strips 4 bolted to the cage. The drive from the motor is transmitted to the 3" Pulley Wheel 5 by means of a cord passed round a ½" Pulley on the motor armature.

#### Parts required:

4	of	No.	1	3	of	No.	35	
6	,,	,,	2	34			37	
4	,,	,,	5	1	,,	,,	38	
2	,,	,,	12	1		,,	48	
4233	,,	21	16	6	,,	,,	48A	
	,,	"	19в	1	,,	,,	52	
4	"	,,	22	2	,,	,,	54	
1	,,		24	2	,,		100	
		2	of N	lo. 1	25		~	

Electric Motor (not included in Outfit)

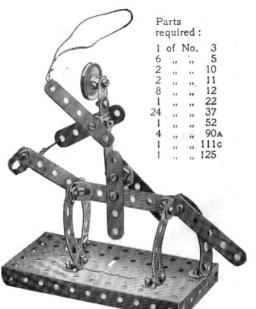

#### Model No. 1.172 Howitzer

2	-6	NI.	~
	01	No.	
6	**	660	5
4	,,	**	10
2	**	**	11
4	23	.,,	12
1	21	,,,	16
2	"	**	19 <sub>B</sub>
2	**	**	22
2	**	**	35
14	**	23	37
2	**	33	38
2	19	,,	111c
2			125



#### Parts required: 9 of No.

-9	of	No.	5
1	,,	,,	10
2	,,	"	11
8	,,	**	12
2	**	**	22
20	"	n	37
3	,,	. ,,	37A
1	,,		52
1	**	11	90A
4	**	**	111c
1	**	**	125

#### Model No. 1.173

#### Safety Catch for Winding Gear

art	s ired	:	
of	No.	. 5	
,,	**	19s	
"		24	
,,	"	35	
**		37	
	**	37A	
,,	***	52	
,,	4.9	54	
,,	,,	111c	3 6




The hoisting cord of a crane, etc. may be wound on the shaft of the 'Crank Handle. To lock the handle in position, the Bush Wheel should be pushed inward so that one of its holes engages with the shank of a 3 8" Bolt projecting from the Sector Plate.

#### Model No. 1.174




Model No. 1.175 Windmill Pump

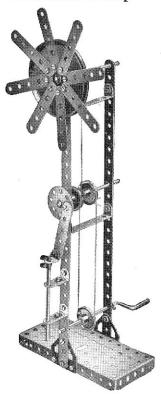

#### Parts required:


2	of	No.	1	1	of	No.	24
9	,,	,,	5	4	,,	• ,	35
2	,,	.,	10	24	13	,,	37
3	23	1)	12	4	,,	,,	-37A
3.	2.9	•2	16	2	10	>2	48A
1	2.7	33	19в	1	- 32	,,	52
1	1)	,,,	19s	2	33	22	111c
4	17	12	22	2	12	22	126A

#### Model No. 1.176 Coaster

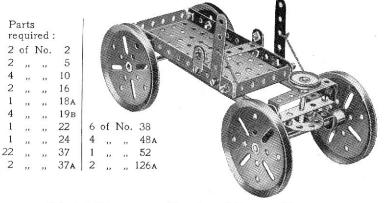

#### Model No. 1.177 Racing Motor Car

The steering column 1 is journalled in an angle bracket 2 bolted to the  $5\frac{1}{2}'' \times 2\frac{1}{2}'''$  flanged plate 3, and in the second hole of the  $2\frac{1}{2}'' \times \frac{1}{2}'''$  double angle strip 4. A bush wheel 5, secured to the lower end of the steering column, is connected by two short lengths of cord to a second  $2\frac{1}{2}'' \times \frac{1}{2}''$  double angle strip carrying the front axle. The strip is pivoted to a similar double angle strip 6 by means of a bolt and nuts (Standard Mechanism No. 262).

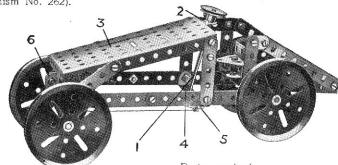

#### Parts required:

4	of	No.	2	3	of	No.	16	25	of	No.	37	1	of	No.	52
7	,,,	2.5	5	4	11	>2	19в	2	,,	12	37A	2			54
1	,,,	11	10	1	12	,,	22	4	,,	12	38	1			111c
1	,,	,,	11	1	,,	,,	24	4	,,	,,	48A	1	,,	,,	125
							1 of								

#### Model No. 1.178

Swivelling Crane

	arts qui	red:	
2	of	No.	. 1
6	17	33	2
6	,,	23	5
2	,,,	2.9	11
1	32	2.3	12
1	22	1.7	16
1	"	12	17
3	,,,	10	19E
1			195

1 , , 19s 4 , , 22 1 , , 24 2 , , 35 5 , , 37 1 , , 37A 2 , , 48A


1 ,, ,, 52 2 ,, ,, 54 1 ,, ,, 57 2 ,90

1 ,, ,, 111c


#### Model No.1.179 Elevated Crane

merely to support the weight of the jib.

#### Model No. 1.181 Acrobat on See-Saw

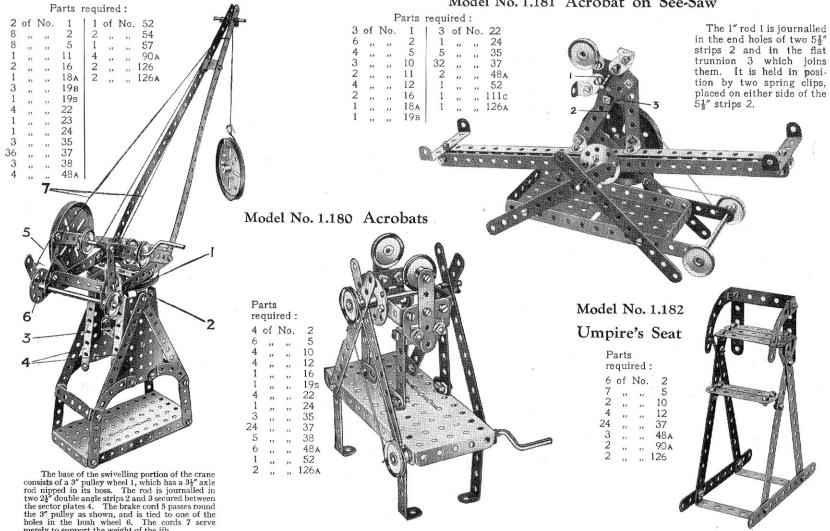


#### Model No. 1.183 Travelling Crane

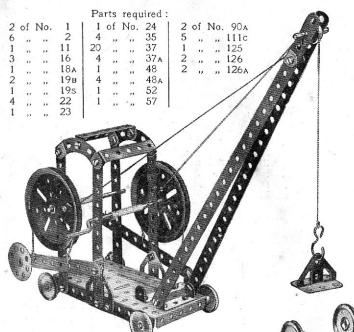

. P	arts	5 .	
re	qui	red:	
.3	of	No.	5
1	. ,,	. ,,	10
2	,,	,,	12
2	,,	,,	16
1	,,	,,	18A
4	. ,,	,,	19в
1	,,	.,,	22
1	**	12	24
15	. , ,	,,	37
2	ė.,	23	37A
6		2.0	38
4	13	.,	48 A
1	,,	,,,	52
1	, .	,,	54
1		,,	111c
2	- 21	.,	126
1	* ,,	.,,	126A


#### Model No. 1.185 Motor Tractor

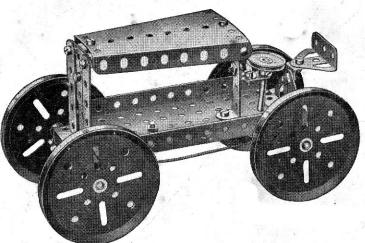


The steering gear is shown in Fig. 1.185A. The front wheels are carried in a  $2\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strip 1, which is mounted pivotally by a Bolt and two Nuts (S.M. 262) to a  $2\frac{1}{2}''$  Strip 2 secured to the  $5\frac{1}{2}'' \times 2\frac{1}{2}''$  Flanged Plate.

#### Model No. 1.184 Motor Cyclist and Pillion Rider

4	of	No.	2	4	of	No:	22
9	**	,,	.5	1	,,	.,	24
1	.,,		10	2	,,	n'	35
2	,,	,,	11	30	,,	8	-37
3	,,	**	12	2	21		48A
1	"	,,	16	2	,,	.,,	90A
2	.,	,,,	17	2			125

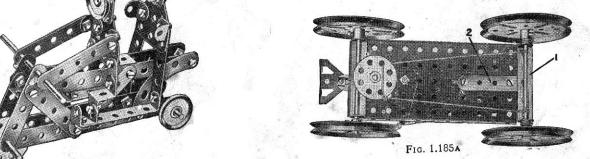

#### Model No. 1.186 A Sudden Appearance

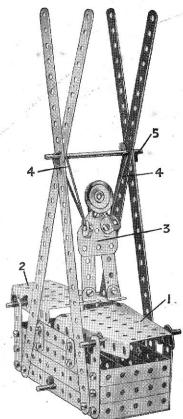

#### Parts required;

4	of	No.	1			No.	
4	,,	,,	2	29		,,	37
9	,,	"	5	6	į,	"	43 A
. 5	. ,;	13"	10	1	"	"	52
4	,,	"	12	2	. 33	,,,	54 111c
4	, ,,	,,	16	1	"	13	126A
1	11	me 15	22	1	,,	12	IZOA

The Sector Plate 1, forming the lid, is carried pivotally on an axle rod that passes through its sides three holes from the end, and the rear Sector Plate 2 is pivoted in a similar manner, excepting that the rod in this case passes through the fourth hole from the end. Pieces of thin elastic are tied to the end holes in each side of the front Sector Plate at its widest end, and are connected to the ends of screws at the bottom of the box. The "Meccanitian" 3 is placed face downward inside the box with his feet towards the far end of the model, The tension of the elastic holding the lid 1 should be sufficient to keep him in this position. On tilting the Plate 1 slightly, however, he will suddenly shoot out of the box, drawn by the elastic bands 4 connected to the 31," Axle Rod 5.


#### Model No. 1.187 Bath Chair

Parts required:


4 of No. 2.16 of No. 48A

	7	01 .	110.	E 1	1	0.		52		
	7	22	**	5	1 1	**	"	126		
	2	**		16	1	**	11	120		
	1	**		18A	, 2	**	1,1	126A		
	2		**	18а 19в						
	2			22	Out				127	_
	24	**		37 37A			M	$\mathbf{A}$		
	1			37A			O.			. 5
	1	**	17	44		1			A = 0	
		"	**	11	1	40				
				- 4	44					
				<i>P</i>	,	•				
			1		W.		W			
		1	19/	MM		2	* 4	100		
			1	• 2			D	h.//#		
1		ر ک		<i>(</i> )		- 7		7		
	100	Za		"	•	-1		d /		
	-	(1)				И		Jian G		
			4				-		/	
<b>a</b>						3000			7	
	JO									
	-			Jan-				N and		
	36 S	-63300	335 335							

#### Model No. 1.188 Rat Trap

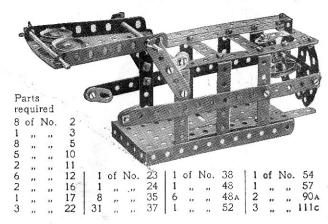

The "bait" consists of a 1" fast Pulley and a  $\frac{1}{2}$ " loose Pulley suspended by means of a hook from a Double Bracket. The latter is bolted to a  $1\frac{1}{2}$ "  $\times \frac{1}{2}$ " Double Angle Strip that is free to turn on a 2" Rod journalled in a pair of Angle Brackets. A Flat Bracket bolted to the Double Bracket engages a second Double Bracket on the end of a  $5\frac{1}{2}$ " Strip that is bolted to the door of the cage. If the "bait" is touched, the heavily-weighted door falls into place, and is prevented from re-opening by catches formed from Flat Brackets secured to  $5\frac{1}{2}$ " Strips that are bolted to the trap by their extreme ends and act as springs.

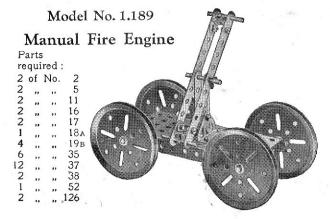


#### Model No. 1.190 Field Roller



				Pa	arts	requ	uired:				
2	of	No.	1	1	of	No.	16	6	of	No.	48A
3	1)		5	2		100	19B	2			00.
6	,,	,,,	12	30	,,,	**	37	2	,,	,,	126

#### Model No. 1.191

#### Dignity and Impudence

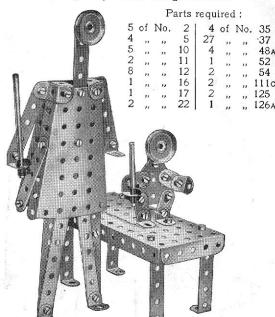


#### Model No. 1.192

#### Disappearing Meccanitian


#### Parts required:


6	of	No.	2	23	of	No.	37	
6	,,	,,	5	1		,,	44	
1	١,	,,	10	6	,,	,,,	48A	
4	,,	"	12	1	,,	,,	52	
2	1,	**	16	2	,,		54	
1	,,	23	22	1	,,	23	111c	
6	,,	,,	35	1	.,,	,,,	126A	

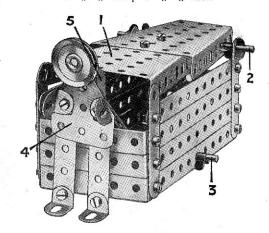

The bottom of the box-like portion of the model consists of a  $5\frac{1}{2}'' \times 2\frac{1}{2}'''$  Flanged Plate; three  $5\frac{1}{2}'''$  Strips bolted to upright  $2\frac{1}{2}'''$  Strips form each side and each end consists of three  $2\frac{1}{2}''' \times \frac{1}{2}'''$  Double Angle Strips. The lid 1, which is mounted pivotally on an Axle Rod 2, consists of two Sector Plates bolted together. Elastic bands are tied to the sides of these Plates and connected to Rod 3 passed through the bottom of the box. The 'Meccanitian' 4 also is connected to this Rod by pieces of elastic. On pressing the end of the rear Sector Plate the lid opens sufficiently to allow the figure to be drawn inside and then snaps back into place. A Cranked Bent Strip 5 is bolted at the back of the figure and rests against the edge of the Sector Plate.

#### Model No. 1.193 Elevator

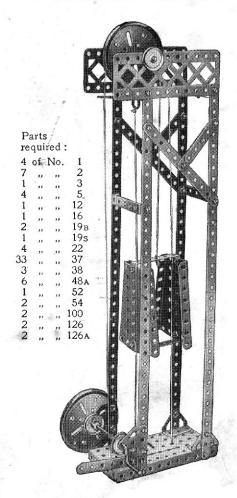


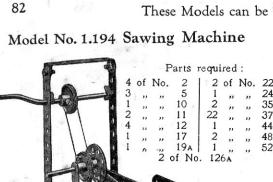

#### Model No. 1.196 Rotating Crane


				N 900		_					
					Pa	arts	requ	iire	d:		
			. 4	of	No.	2	1		No.	24	
			9	,,	,,	5	5	"	,,	35	
			2	,,	,,	10	25	,,,	,,	37	
		l to	1	,,	,,	11	4	,,,	,,	48A	5
			2	,,	1)	16	1	,,	,,	52	
<b>,</b> 6			. 1	23	.,	17	1	,,,	,,	54	
2	4		; 1	,,	**	19s	1	n	,,	57	
			4	,,	,,	22	1	,,		125	
		4									

#### Model No. 1.197 Motor Lorry

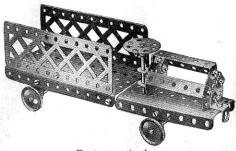

				Par	ts 1	requi	red:				
2	of	No.	5	1 1	of	No.	17	1	of.	No.	52
4	,,	12	10	4	17	,,	22	1	i	,,	54
1	,,	21	11	1	,,	,,	24	2	5,	12	100
2	,,	- 22	12	1	17	,,	35	1	,,	,,	125
2	,,,	,,	16	23	,,	1,	37	2	,,	12	126A
1				4		1 1261	48A				

#### Model No. 1.198 Pen Rack

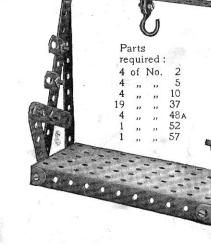

Model No. 1.195	6	,,	- 27	5
	1	,,	,,,	10
Sailing Boat	6	,,	"	12
	4	"	,,	22
000	i	,,,	"	23
0/0/00	:20	,,	,,	37
	2			484

Parts required. 4 of No.

> The running wheels of this crane are journalled in Double Angle Strips bolted to the Base Plate and secured at an angle by means of Flat Brackets. The rear of the Base Plate is supported on a Double Bracket. The jib is bolted loosely to the supporting  $5\frac{1}{2}$ " Strips and is connected by 21" Strips to the Sector Plate which pivots about its supporting bolts. By moving this Sector Plate the elevation of the jib may be altered as desired. The movement is controlled by a Double Angle Strip mounted on the Crank Handle and connected pivotally to the Plate by means of a 21" Strip. A Reversed Angle Bracket bolted to an upright Double Angle Strip in the rear of the model serves to

restrict the movement of the Sector Plate.

#### Model No. 1.199 Travelling Crane


The jib 1 is pivoted to the Flat Trunnions 2, which are bolted at 3 to Angle Brackets secured to a Bush Wheel. The latter is nipped to a 2" Rod 4 passing through the Plate 5 and further supported in a Double Angle Strip 6. A Washer and Spring Clip mounted on the Rod 4 below the Strip 6 secure the crane to the carriage. The jib is supported by means of cords 7 tied to 21" Strips 8, the holes of which engage the shank of a bolt passed through the Sector Plate 9, and its elevation may be altered by inserting this bolt in different holes in the Strips 8. The cord 10 of the brake lever is wound once round the Crank Handle, between two

Washers.

#### Model No. 1.200 Bicycle

Model No. 1.202 Gymnast

OHERODOODDOO

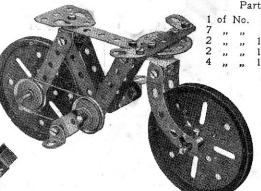


arts r	equi	red	:		1
3 5	2	of	No.	17	4
	1	"	,,	18A	
10	2 2	,,	,,	19в	•
11		,,	,,	22	
12	1	,,	,,	24	
	4	,,,	2)	35	
	13	23	23	37	
	4	,,	11	37A	
. 15	3 2 4	,,	,,	38	
	- 2	,,	,,	90a	
		,,	,,	111c	
	2	,,	"	125	
	1	,,	"	126A	

#### Model No. 1.201 Luggage Truck

		P	arts r	equi	red	:	
2	of	No.	2	18	of	No.	37
8	,,	,,	5		,,		48A
1	,,,	,,	16	1	,,	,,	52
2	,,	,,	19в	4	,,	,,	90A

8	,,	,,	5	2	,,	,,	48A		
1	"	,,	16	1	,,	,,	52 90a	IT	0
2	,,	,,	19в	4	,,	,,	90A		
							metal.		
					- 55	-	6		S ?
						Ø.			
			_	ď	"			63	
	di					,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,			7.0
	•		_			• •			9
				-			9.7		
	,					9	. A.	5	4-
	W. 30		200	MA 4. 1		400000			

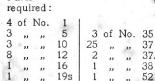


One of the 2½" Strips representing the arms of
the gymnast is bolted to a Bush Wheel secured on
a 3½" Rod. When the Crank Handle is rotated
the gymnast turns complete somersaults in a very
amusing manner. The gymnast's "arms" must
be pivoted to the Angle Brackets forming his
shoulders by means of Bolts and Lock-Nuts.

#### Parts required:

2   1	of	No.	19s	1 0	No.	44
5 4	,,	,,	22	3 ,	, ,,	48A
0 1	,,	"	23	1 ,	, ,,	52
2 5	"	"	35	100,	, ,,	54
121			3/	1 (8)	2 22	57
7 6	,,	,,,	38	2	, ,,	126A
	5 4 0 1 2 1 6 27	5 4 " 0 1 " 2 1 " 6 27 "	5 4 " " 0 1 " " 2 1 " " 5 " " 6 27 " "	5 4 " " 22 0 1 " " 23 1 " " 24 5 " " 35 6 27 " " 37	5   4	2   1 of No. 19s   1 of No. 5   4 " " 22   3 " " " 20   1 " " 23   1 " " 24   1 " " 25   27 " " 35   1 " " " 7   6 " " 38   2 " " "


# Model No. 1.203 Giant Foundry Ladle

#### Model No. 1.204 Double-Action Pump

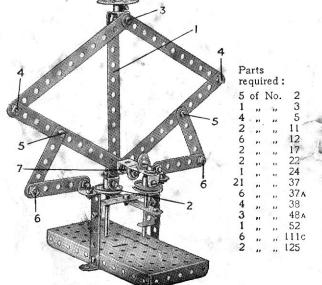

#### Parts required:

2	of	No.	1	1	of	No.	23
6	,,	,,	2 .	1	,,	.,,	24
7	,,	,,	5	36	21	. ,,	37
2	,,	"	10	6	21	,,	37A
1	,,	"	16	7	,,	,,	48A
1	,,	,,	17	1	,,	,,	52
3	,,	,,,	19в	2	- 12	,,	54
1	,,	,,	19s	6	,,	,,	111c
3	,,	1)	22	2	,,	,,,	126A

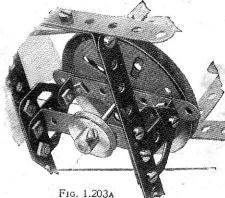

#### Double-Action Pump


The 51 Strip 1 is attached to the 1" Pulley Wheel 2 by meanoust two Angle Brackets, through the lower on thich a securithe Set-Screw that secures the Pulley to its 2" Kod. Two Washers are placed beneath the head of the Bolt joining the Angle Brackets in order to prevent its shank from binding on the boss of the Pulley 2. The joints 3, 4, 5, 6, 7, are all lock-nutted, the remainder of the joints being quite rigid. When the Strip 1 descends, together with the first pump, the incidental distortion of the parallelogram 3, 4, 7, 4 causes the second pump to rise. Similarly, when the first pump rises, the second descends.

#### Model No. 1.205

#### Elevated Jib Crane

A 1" fast Pulley Wheel secured to the armature spindle of the Electric Motor is connected by an endless cord to the 3" Pulley Wheel 1. A 1" fast Pulley 2 on the same Rod as the latter is similarly connected with a second 3" Pulley Wheel 3. A cord wound on the Rod to which the latter is secured carries the load hook. The jib is supported by two cords 4, and the whole superstructure, which is h, and the whole superstructure, which is secured to the 3. Pulley Wheel 6, is capable of revolving with the Rod 5. The latter is journalled in two 2\frac{1}{2}" \times \frac{1}{2}" Double Angle Strips secured between the Sector Plates in the base of the model. Parts required: 2 of No. Electric Motor (not included in Outfit)



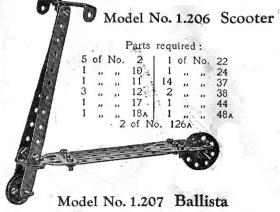

This is a model of an ancient engine of war, resembling the crossbow. The 3½" Strip 1 is bolted firmly to the Double Angle Strip 2, which is prevented from turning by the addition of Angle Brackets as shown. A Double Bracket 3 slides on the Strip 1 and is secured to

slides on the Strip 1 and is secured to a piece of cord. On rotation of the Crank Handle 4, the Strip 1 is pulled backward until the Double Bracket 3 slips off its end. The Strip then flies forward and strikes the missile, which consists of a 2" Rod placed ready in the Double Bracket 5.


4	of	No.	1	2	of	No.	16	1	of	No.	44
4	,,	13	2	1	,,	.,	18A	4	,,	,,	48A
1	.,,	,,	3	3	,,,	,,,	19в	1	,,	,,	52
2	,,	,,	11	1	11		195	1	,,	,,	90A
2	,,	-	12	4			22	2		,,,	126A
			9.	21	.,		37				1


The cord on which the "Meccanitian" runs is endless and passes over the 1" fast Pulleys at each end of the model. One of the Pulleys is secured to a Crank Handle, by means of which the model may be operated. The Meccanitian runs on the upper half of the endless cord, the lower half being attached to one of his feet.


P	arte	5	
re	qui	red:	,
4	of	No.	- 1
4	,,	,,	2
1			. 3

4	of	No.	- 1	2	of	No.	17	*		٠,	det	
4	,,	,,	2	1	,,	,,,	19s			-		
1	,,,	,,	3	4	,,	,,	22					
5	,,	,,	5	1	,,	,,	23	2	of	No.	48A	
3	,,	,,	10	6	,,	,,	35	1	,,	,,	52	
4	,,	,,	12	34	,,	,,,	37	2	,,	,,	54	
2	,,	,,	16	2	,,	.,,	38	1	,,		126A	
			10000				n pater	5	,,,	100		

#### Model No. 1.209 Double-Action Piston Connection

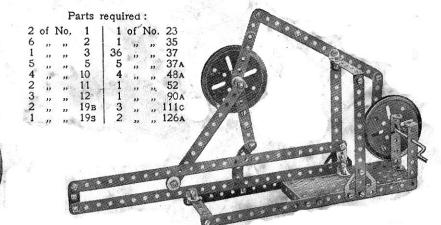


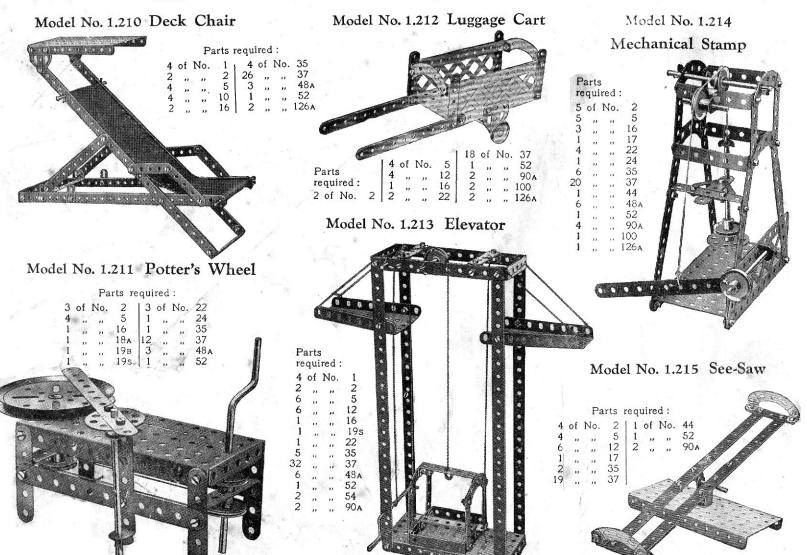

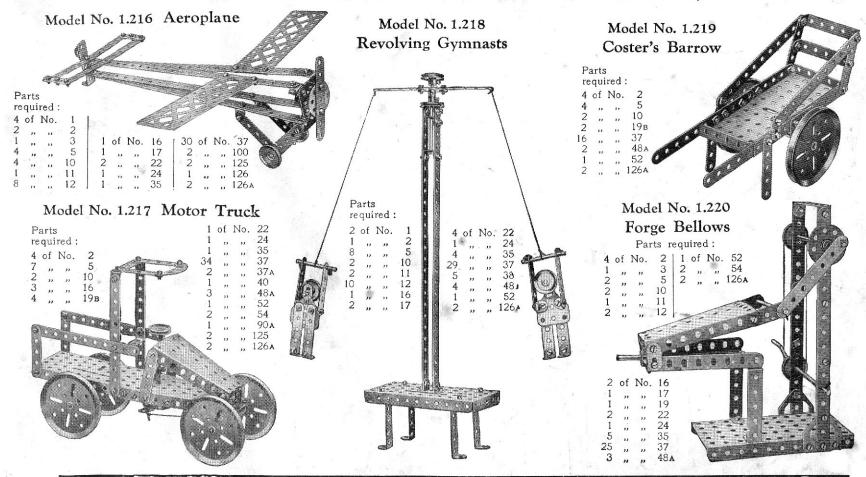

#### HOW TO CONTINUE

This completes our examples of models that may be made with MECCANO Outfit No. 1. The next models are a little more advanced, requiring a number of extra parts to construct them. The necessary parts are all contained in a No. 1A Accessory Outfit, the price of which will be found in the List at the end of this Manual.

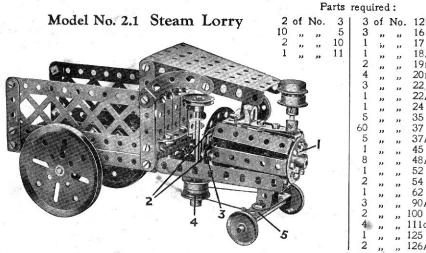

The boiler of the engine is built up of  $2\frac{1}{2}$  " $\times \frac{1}{2}$ " Double Angle Strips bolted to the Bush Wheel 1, and to two  $2\frac{1}{2}$ " Strips 2, which are joined together by Flat Brackets 3. A  $2\frac{1}{2}$ " Curved Strip (small radius) is bolted to the upper Strip 2. A cord is passed completely round two  $\frac{3}{4}$ " Flanged Wheels 4 secured to the steering column, and its ends are tied to the  $2\frac{1}{4}$ "  $\times \frac{1}{4}$ " Double Angle Strip 5. The Double Bent Strip bolted to the Strip 5 is pivoted by a bolt and two nuts to the Sector Plate.

# Model No. 2.2 Turnstile

# 125 " 126A Parts required: 12 of No.

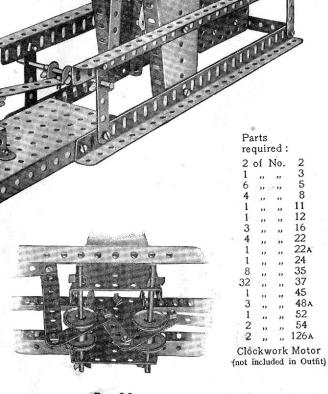



FIG. 2.3A

Model No. 2.3

Mechanical Hammer


#### Model No. 2.4 Electric Truck

An underneath view of the truck is shown in Fig. 2.4a. The front axle is journalled in a  $1\frac{1}{2}''\times\frac{1}{2}''$  Double Angle Strip 1 that is free to turn on a Double Bent Strip 2, from which it is spaced by a  $\frac{1}{2}''$  loose Pulley. A length of cord is wrapped round the 1" Pulley 3, which is secured to the end of the steering column, and then passed through a Cranked Bent Strip 4 and secured to the Double Angle Strip 1 as shown. The brake cord 5 is attached to the Double Bent Strip 2, wrapped several times round the  $\frac{3}{4}''$  Flanged Wheels 6, passed through the Angle Bracket 7, and is finally attached to the Crank 8. The operating pedal consists of Double Brackets bolted to another Crank that is secured to the same Rod as the Crank 8.

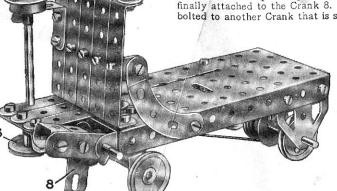



#### Parts required:

3	of	No.	5	1	of	No.	22 <sub>A</sub>	7	of	No.	48 A	
1	,,	"	6A	1	,,	23	23	1	,,	,,	52	
2	,,	,,	11	4	,,	"	35	2	,,	,,	62	
1	,,	"	12	35	"	"	37	3	,,	,,	90 A	
1	,,	,,	12A	2	,,	**	37a	1	,,	,,	111c	
3	,,	13	16	5	,,	,,	38	1	,,	,,	115	
1	,,	"	17	1	,,	,,	44	1	,,	,,	126	
3	,,	,,,	20в	1	"	,,	45	2	,,	,,	126a	
4	"	"	22	1	,,	"	48					

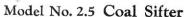

The  $5\frac{1}{2}$ " Strip 1 is pivoted to the Angle Bracket 2 by a bolt and two nuts. The Angle Bracket in turn is bolted to the Flanged Plate, which is suspended in such a way that it is free to swing to and fro. The other end of the  $5\frac{1}{2}$ " Strip is pivoted to the Bush Wheel 3.

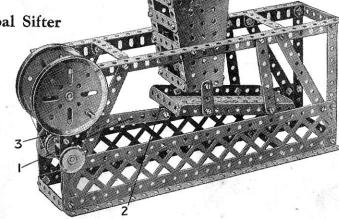


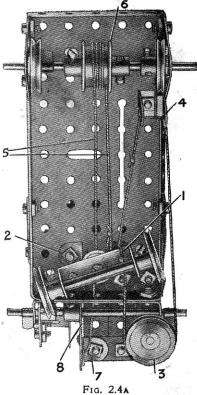

#### Parts required:


9	of	No.	2	12	of	No.	35	
2	,,	,,	3	54	,,,	"	37	
28241	,,	"	5	6	,,	,,	37A	
2	,,	,,	6A	8	13	,,	38	
4	**	,,	8	1	1,	,,	45	
	,,,	"	12	6		,,,	48A	
1	,,	,,	16	2 2	,,	"	52	
1	. ,,	,,	17	2	,,	11	54	,
1 2 2	,,,	,,,	19в		. ,,	. 15	99	
2	,,,	,,	22	6	,,	20	111c	
1	**	,,	24	1	,,	**	115	

#### Model No. 2.6 Treadle Lathe

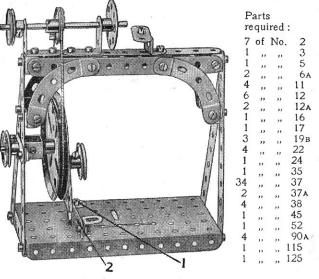

The  $2\frac{1}{2}$ " Strip 2, forming the treadle, is attached pivotally by means of a bolt and two nuts to the Angle Bracket 1. One end of a further  $2\frac{1}{2}$ " Strip is connected by the same means to the  $2\frac{1}{2}$ " Strip 2, and the other end is mounted on a threaded pin secured to the 3" Pulley Wheel.

#### Model No. 2.7 Smoothing Iron

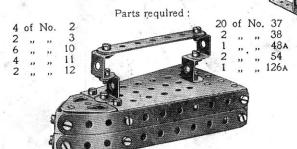

#### Parts required:

Model No. 2.9 Mat Frame

and the second s	Parts required:
Model No. 2.8 Gong	10 of No. 1   3 of No. 11   1 of No 18A 4 ", ", 8   6 ", ", 12   54 ", ", 37 4 ", ", 10   2 ", ", 12A   2 ", ", 37A 2 ", ", 38
<b>6 6</b>	1 ,, 45 2 ,, 62 4 ,, 90A
	1 ,, 115 4 ,, 125 2 ,, 126
	2 ,, ,, 126A
	3
THE STATE OF THE S	
	The Strips 1 are hinged to the frame in the
	following manner. Two Cranks 2 with their bosses

Parts required:

6	of	No.	1	2	of	No.	11
							15
2	,,	,,	5	1	,,	,,	22
2	,,	,,,	8	27	.,	,,	37
				No.			

The Strips 1 are hinged to the frame in the following manner. Two Cranks 2 with their bosses facing inward are bolted to the Strips 1 and two Angle Brackets are secured to the frame. A Rod is then pushed through the holes in the Angle Brackets and secured in the bosses of the Cranks. A Double Bracket fastened to the ends of the Strips 1 carries a Threaded Pin, which fits in the holes in the Trunnions 3. By removing this Pin, the frame may be folded flat.


#### Model No. 2.10 Spinning Top

# Parts required:


1 ... ... 16 2 ... ... 19 2 ... ... 20 2 ... ... 37 1 ... ... 40

The drum on which the cord is wound consists of two \( \frac{3}{4}\)" Flanged Wheels butted together. While the cord is being pulled, the top is held steadily on some smooth surface by means of the handle shown above. The handle is then lifted off, allowing the top to spin freely.


#### Model No. 2.11 High Level Bridge

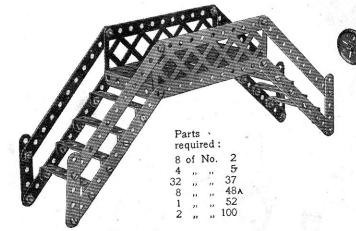

#### Model No. 2.12 Sand Yacht

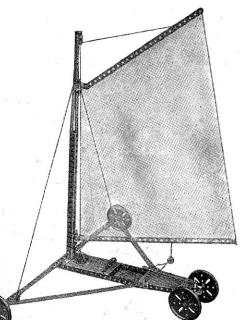


		Pa	erts re	equir	ed:		
8	of	No.	1	1	of	No.	24
. 2	,,	,,	2	12	,,	,,	35
1	,,	,,	5	60	12	"	37
4	,,	,,	8	9	,,	,,	38
4	,,	**	10	8	,,	9,	48A
4	,,	"	11	1	,,	23	52
12	,,	,,	12	1	,,	,,	54
12 2 3	,,	"	12a	1	,,	,,	62
3	,,	17	16	1	,,	1)	90A
1	,,	1)	17	1	,,	6 11	115
1 2 4	,,	,,,	18A	4	,,	,,	125
	,,	,,	19в	1	,,	,,	126
- 1			23	2			126A

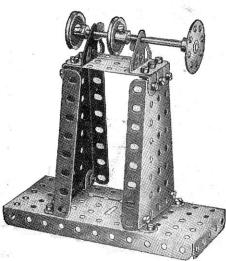

#### Model No. 2.13 Polishing Spindle

Parts required:


4	of	No.	12	20	of	No.	37
1	,,	1)	16 22	3	,,	,,	48A
2	,,	13		1	,,		52
1	,,	,,	24	2	,,	,,	54
2	,,	1)	35	2	. ,,	,,	126

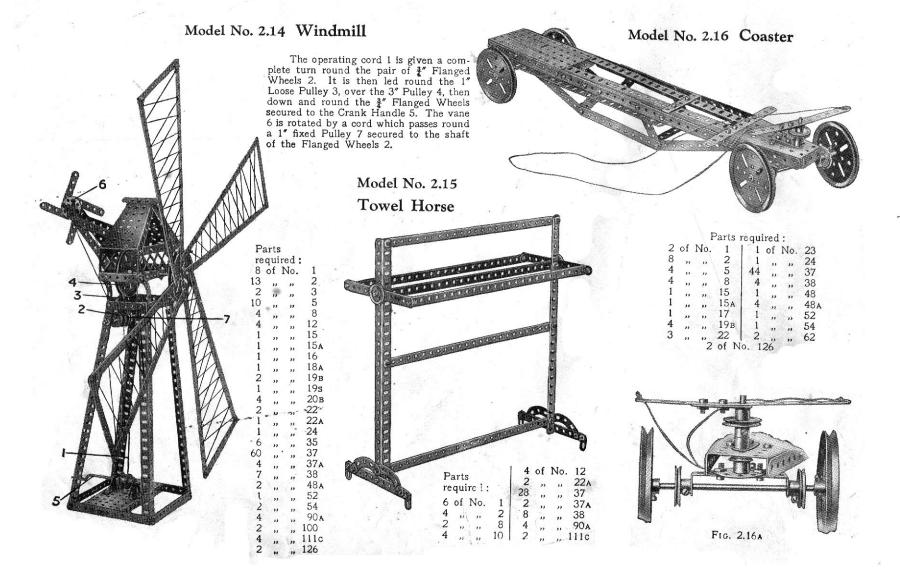

#### Model No. 2.17 Motor Van

#### Parts required:

6	of	No.	2	1 1	cf	No.	24	6	of	No.	48A
10	1)	,,	5	5	1,	,,	35	1	,,		52
1	,,	10	10	35	,,	,,	37	2	,,	,,	54
2	,,		12	2	,,	,,	37A	3	. ,,	11	111c
1	,,	"	15	1	12	,,,	38	2	,,		125.
1	,,	,,	15A	1	15	,,	45	2	,,		126A
1	,,	,,	16	1	.,	,,	48				
4	,,	11	19в								

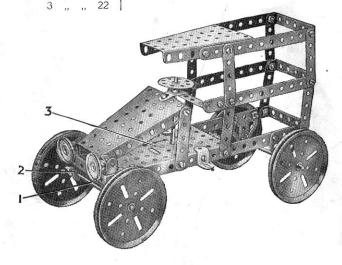

The Axle Rod 1 is journalled in a  $2\frac{1}{2}$ "  $\times \frac{1}{2}$ " Double Angle Strip 2. The latter is bolted to a Double Bent Strip that is pivoted to the Flanged Plate 3 by a bolt and two nuts. Steering is effected by a cord attached to the ends of the Double Angle Strip 2 and passed round a 1" Pulley Wheel fastened to the lower end of the steering Rod.


#### Model No. 2.18

#### Easel

# Parts required: 5 of No. 1 3 , , , 2 2 , , , 3 3 , , , 5 4 , , , 12 2 , , , 12A 1 , , , 15A 2 , , , 22 1 , , 22 1 , , 22 1 , , 22 1 , , 22




#### Model No. 2.19 Stamping Mill

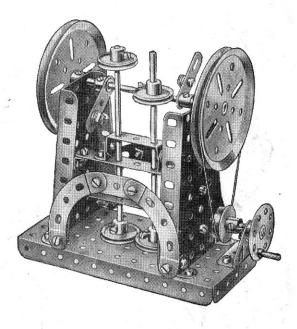

#### Parts required

		I a	115 16	quir	eu .		
	of	No.	3	30	of	No.	37
2	,,	,,,	6A	2	,,	,,	37A
10	,,	,,	12	11	,,	,,	38
2	,,	,,,	15	1	,,	,,	48
1	,,	,,	15A	1	,,	,,	52
1	,,	,,	17	. 2	,,	,,	54
2	,,	,,	19в	2	,,	,,	62
1	,,	,,,	20в	4	,,	,,	90A
4	,,	. 11	22	2	,,	,,	111c
1	,,	,,	24	1	,,	,,	115
1	"	"	35	1	**	,,	126


#### Model No. 2.20 Candy Puller

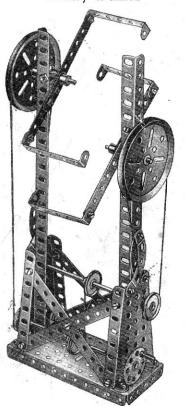

Parts required:

			-11.12	roqu	110	u .	
6	of	No.	2	3	of	No.	35
2	. ,,		8 -	36	,,	,,	37
6	->>	.,,	12	4	,,		38
2	,,	1)	15	4	,,	11	48A
2	,,	21	17	1	,,		52
2	11		19в	2	,,	1,	54
4	,,		22	2		,1	62
		.,,	24	4	,,,		90A
		1	of I	10.	115	7 - 172	

#### Model No. 2.21 Revolving Truck

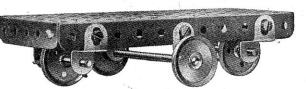

	art	s ired	
10	qui	rea	•
1	of	No.	16
2	,,	11	17
2	" >>>	1,	22
2	,,	11	22A
4	,,	,,	35
6	23	,,	. 37
1	"	,,	52
4	.,	***	125


#### Model No. 2.22 Sifter

The  $5\frac{1}{2}$ " Strip 1 is pivoted by a bolt and two nuts (S.M. 262) to the Bush Wheel and also to a Trunnion bolted to the under-surface of the Flanged Plate 2. The Rod carrying the Bush Wheel is journalled in one of the side girders and through a Double Bent Strip.

#### Parts required:

4 of No. 1 5 " " 2 4 " " 5 2 " " 6A 4 " " 10 2 " " 15 1 " 15A 1 " " 17	2 of No. 54 2 " " 99 2 " " 111c 1 " " 126	THE PARTY OF	,2
2 " " 19B 4 " " 20B 3 " 22 1 " 24 4 " " 35 36 " " 37			A
1 , 38 1 , 44 4 , 48 1 , 52			


#### Model No. 2.23 Ladder on Wheels

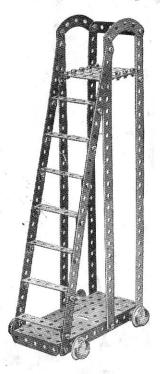


		red:	
	of	No.	1
7	"	,,	5
4	,,	,,	12
2	,,	,,	16
4	,,,	.4976, -	20в
0	,,	,,	37
4	,,	,,	38
8	,,	,,,	48A
1	2.11		52
2		.,,	90

#### Model No. 2.24 Tricycle

#### Parts required:

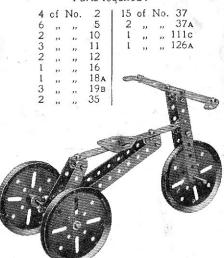

#### Model No. 2.25 Turntable

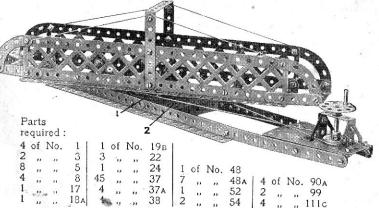


The two sides of the revolving portion are joined in the middle by two pairs of  $2\frac{1}{2}$ " Strips, each pair being overlapped three holes and bolted to the 3" Pulley, Wheel 1. An Axle Rod secured in the latter is journalled in the bottom plate 2 and retained in position by a 1" Fast Pulley Wheel beneath the plate.

#### Model No. 2.26 Motor Truck

#### 


A cord passed twice round a 1" fast Pulley Wheel on the lower end of the steering column is tied to the ends of a  $2\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strip, which is pivoted by means of a Bolt and Lock-Nuts to a Double Bracket bolted to the lower Sector Plate. The front axle is journalled in the and boles of the Double Angle Strip.

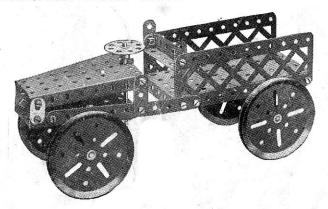

#### Model No. 2.27 Baby Chair

#### Parts required:


8	of	No.	2	4 0	f No.	35
2	,,	10	3	35	,, ,,	37
12	,,	,,	5	2	,, ,,	37A
6	,,	1)	12	4	,, ,,	38
2	,,	1)	16	8.	,, ,,	48A
2	,,	2.7	17	4.	,,	90A
4	,,		22	1		115.

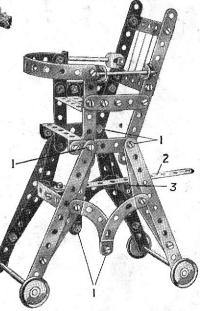

The Bolts 1 are all secured pivotally (see S.M. Nos. 262 and 263), and the height of the chair may be adjusted by fitting any hole in the Strip 2 over the shank of a Bolt that is secured in an Angle Bracket bolted to the Double Angle Strip 3.


Parts required:

#### Model No. 2.28 Roundabout

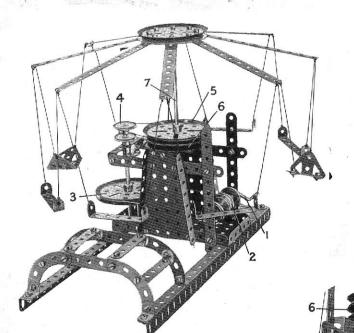

When the crank handle is turned, the drum 2 (formed by butting together two \(^34''\) Flanged Wheels) turns the 3" Pulley Wheel 3 by means of an endless cord. The 1" fast Pulley Wheel 4 similarly turns a second 3" Pulley Wheel 5 resting on another 3" Pulley Wheel 6 (see Fig. 2.28A). The end of the Axle Rod 7 is quite free to revolve in the boss of the lower 3" Pulley Wheel 6.

#### Model No. 2.29 Scales

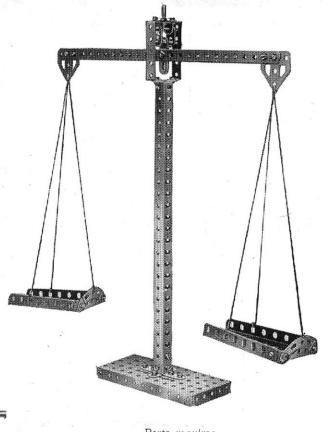


#### Parts required

2	of	No.	1	2	of	No.	18a	1	of	No.	52
1	,,	"	6A	2	,,	1)	35	2	,,	,,	54
2	,,	"	8	31	23	"	37	2	,,	23	62
2	,,	"	10	4	,,	"	38	2	,,	23	90 A
1	,,	11	11	1	,,	,,	40	1	,,	,,	115
2	,,	,,	12	1	,,	,,	45	2	,,	,,	126A
2			12A	4			48A				


FIG. 2.28A

# Model No. 2.30 Pit Head Gear (Electrically Operated)

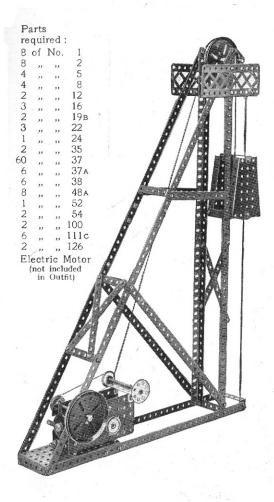

# Model No. 2.31 Pit Head Gear (Hand Operated)

This is an alternative construction of the base of Model No. 2.32, and shows how the electric motor may be dispensed with if necessary. Two 3" pulley wheels 1 are bolted together by four double brackets to form a drum on which the hoisting cord is wound. The cage is raised or lowered on operation of the handle 2, which is connected to the winding drum by an ordinary belt drive. The cage is prevented from overhauling by a band brake that acts on the groove of a third 3" pulley wheel 3. The brake normally is applied by the weight of the  $\frac{1}{2}$ " loose pulley wheel 4, which is secured to the end of a  $5\frac{1}{2}$ " strip that is bolted to the crank 5.

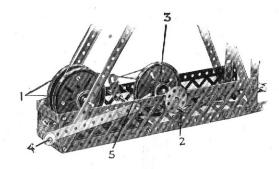


#### Parts required:

				Pa	rts	requ	ired:					
6	of	No.	1	4	of	No.	22	2	of	No.	54	
7	,,	,,	2	1	,,	,,	23	2	,,	,,,	62	
3	,,	,,	. 5	1	,,	,,	24	2	,,	,,	99	
4	,,	,,	8	3	,,	,,	35	2	,,	,,	100	
4	,,	,,	11	60	,,	,,	37	6	,,	,,,	111c	
6	,,	"	12	6.	,,,	,,	37A	1	,,	,,	115	
4	,,	,,	16	8	,,	,,	48A	2	,,	,,	126a	
4			10p	1			52					


#### Model No. 2.32 Acrobat

#### Parts required:


				- 1			
4	of	No.	1	28	of	No.	37
. 2	,,	,,	3	6	,,	,,	374
5	,,	,,	5	5	,,	,,	38
2	,,	,,	8	1	,,	,,	45
2	,,	19	10	1	,,	23	52
1	,,	1)	15	1	,,	21	54
2	,,	,	19в	2	,,	,,	62
2	,,	"	20в	1	,,	,,	115
3	,,	,,	22	2	,,	,,	126

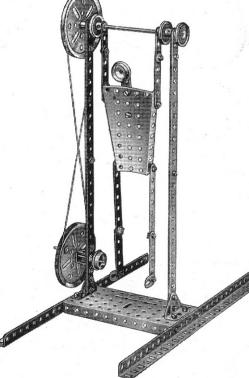


#### Model No. 2.33 Carrier Tricycle

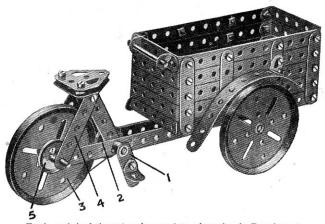



Each pedal of the tricycle consists of an Angle Bracket pivotally attached to a crank 1 by means of a Bolt and two Nuts (see S.M. No. 262). The cranks are secured to a  $1\frac{1}{2}$ " Axle Rod carrying a 1" fast Pulley Wheel 2. A cord passes round this Pulley and around the 3" Pulley Wheel 3, which is spaced away from the  $2\frac{1}{2}$ " Strips 4 by a 1" fast Pulley Wheel 5. The Double Bracket 6 (Fig. 2.33a) is attached pivotally to the lower framework by a Bolt and Lock-Nuts (S.M. 263).

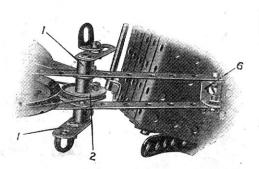


	٠.	-	2	3.3	3
г	1	G.	4	.33.	f

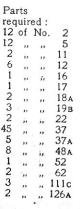

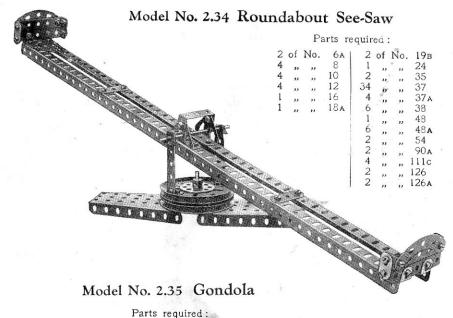

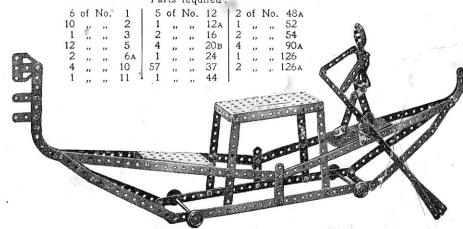

#### Model No. 2.36 Double Drop Hammer

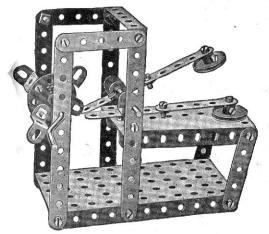


	arts	ired	:	
4	of	No.		
8	,,	12	5	
2	"	13	11	
1	,,	",	16	
1	.,		19s	
2	,,	.,	22	
1	,,	,,	24	1
. 6	,,	,,	35	
23	,,,	1,	37	
2	)1	"	48A	
1	. ,,	,,	52	
1	,,	,,,	54	
4	,,	"	125	

#### Model No. 2.38 Derrick

<sup>D</sup> arts	4 0	of No.	19в	1 of	No. 52
equired:	4	,, ,,	20в	2 "	,, 54
of No. 1	4	" "	22	1 ,,	" 57
	1	22 12	23	1 ,,	" 111c
1 , , 2 2 , , 3 3 , , 5	1	22 12	24	1 ,,	,, 115
3 ,, ,, 5	11	22 12	35	2 "	,, 126
.,, ,, 6A	58	,, ,,	37		
3 ,, ,, 8	3 5	,, ,,	37A		
2 ,, ,, 10	5	,, ,,	38	4.	
· ,, ,, 11					
, , 12					All
, , 12A				3-	
,, ,, 16	1			. /	
2 ,, ,, 17			12	\ //	
18A				X	N II

Fig. 2.38A

#### Model No. 2.37 Hay Tedder

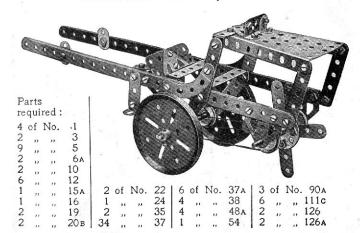


boss of the lower 3" Pulley Wheel 2a. The vertical 121" Strips 13 are bolted at their tops to a Double Bracket, to the centre hole of which is secured a Bolt 14 that is free to turn in the Flat Trunnion 15. The swivelling movement of the crane is carried out by turning the handle 1, which simultaneously winds and unwinds the ends of a cord passing round the 3" Pulley Wheel 2 (see Fig. 2.38A). The cord 12, which is tied to the Flat Bracket 3 at the head of the jib passes over the 2" Rod 4, under a similar Rod 5. and between two vertical 2" Rods 6, which act as guides, and is finally wound on to the crank handle 7. Hence on operation of the latter the jib is raised or lowered. The cord 8 also passes round the Rods 4, 5 and 6, and is wound on to the Rod 9. Operation of the handle 10 raises and lowers the hook 11. The cords 8 and 12 are prevented from unwinding by band-and-pulley brakes 16.

The 3" Pulley Wheel 2, which supports the jib, is free to turn on a short Axle Rod secured in the

#### Model No. 2.39 Elevator


#### Model No. 2.40 Fire Escape

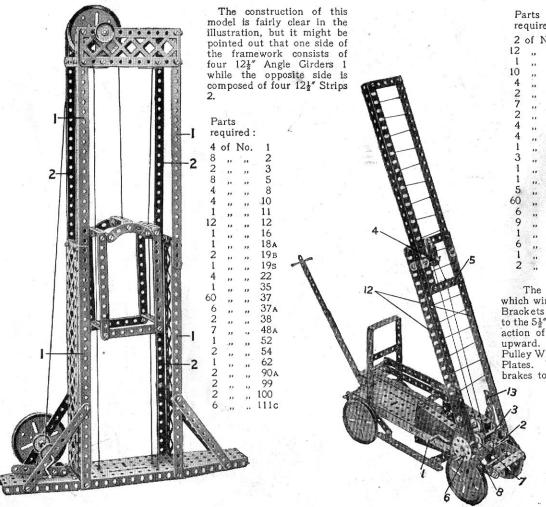

The ladder is elevated on operation of the crank handle 1, which winds in a cord tied to the Double Angle Strip 2. Angle Brackets bolted to the  $12\frac{1}{2}$  Angle Girders 12 are attached pivotally to the  $5\frac{1}{2}$  Strips 13 by means of Bolts and Nuts (S.M. 262), and the action of winding in the cord thus causes the ladder to swing upward. It is prevented from falling by the friction of the 1 Pulley Wheels 10 (Fig. 2.40A), which press against the two Sector Plates. When the ladder is fully elevated, its lower ends act as brakes to prevent the road wheels from revolving.

A second cord is wound upon the Rod 3. One end is then carried over the ½" loose Pulley Wheel 4 and tied to the 2½" Strip 5, the opposite end being carried directly to the same Strip and secured to it. When the handle 6 is turned, the two ends of the cord are wound and unwound simultaneously, and the ladder is extended or shortened as required. A permanent brake is provided by a cord passing over the 1" Pulley Wheel 7 and having both its ends secured to the 2½" Strip 8. The Strip 8 is bolted firmly to the Angle Bracket 9 (Fig. 2.40a) and keeps the brake continuously in action.

#### Model No. 2.41 Aeroplane

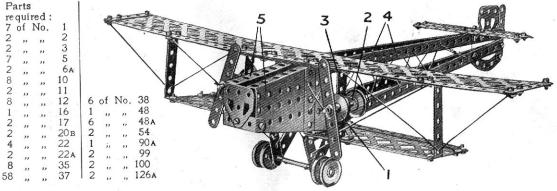

Each engine is represented by a  $\frac{3}{4}$ " Flanged Wheel 1 and a 1" fast Pulley Wheel secured to a 2" Rod journalled in a Double Bracket 2, which is bolted to the  $2\frac{1}{2}$ "  $\times$   $\frac{1}{2}$ " vertical Double Angle Strip 3. The  $12\frac{1}{2}$ " Strips 4 of the fuse-lage proper are bolted to the two Sector Plates 5, and also by means of Angle Brackets to the wings. The tail plane consists of two  $5\frac{1}{2}$ " Strips to which a similar Strip, representing the movable portion of the plane, is attached by means of Flat Brackets.

#### Model No. 2.42 Anti-Aircraft Gun

The general construction of the model will be made clear by reference to Figures 2.42a and 2.42b. Rotation of the handle 1 causes the gun to revolve on the 3" Pulley Wheel 2. The barrel of the Gun is so balanced on the Axle Rod 3 that it tends to fall by its own weight, but is prevented from doing so by a cord 4 tied to the gun close to the breech and wound on the  $3\frac{1}{2}$ " Rod 5. By turning the Pulley Wheels 6 the muzzle is raised or allowed to fall.



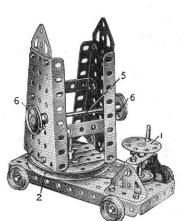



FIG. 2.42A

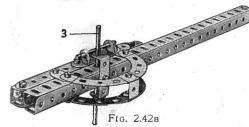

Parts	required

9	of	No.	2	1	of	No.	.19в	4	of	No.	48 A	
1	.,		6A	4	.,		20B	1		.,	52	
4		- 24	8	4	.,	,,	22	2		.,,	54	
4		**	10	1			24	4	.,	**	90 A	
3			1.1	8			35	1			115	
5			12	57			37	2			126	
4			16	6		1	38	2		. 7	126A	
2			17	1		.,,	44					

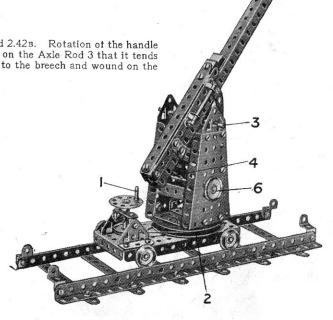


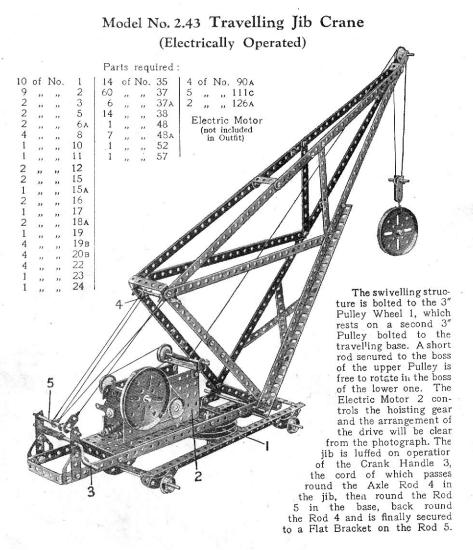


### Model No. 2.44 Travelling Jib Crane (Hand Operated)

This shows a section of Model No. 2.43 fitted for hand operation, thus dispensing with the necessity of the Electric Motor. In this case the hoisting cord is operated by the hand wheel 6, the Rod of which is controlled by a band brake 7. The end hole of the lever of the latter is pivotally mounted on the Rod 8. The luffing movement of the jib is effected by the Crank Handle 9. The operating cord passes round the Rod 10 attached to the jib, then round Rod 11 in the base of the model, again round Rod 10, back round Rod 11, and once more round Rod 10. The end of the cord is then tied to a Flat Bracket on the Rod 11.

						F	arts	requ	ire	1:					
10	of	No.	1	1 1	of	No.	11				20в	7	of	No.	48A
11	,,		2	1	,,	,,	15	4	,,	,,	22	1	"	,,	52
2			3	1	11	,,	15A	1	,,	,,	23	2	,,,	,,	54
	,,		5	5	12	"	16	1	,,	,,	24	1	,,	,,	57
6	,,	,,	6A	2	,,	,,	18A	12	50	2.1	35	1	,,	1)	62
4	,,	,,	3	1	,,	,,	19	57	1,	2.3	37	4	,,	13	90 A
3	,,	,,	10	4	,,	,,	19в	1	,,,	23	48 1	1	"	**	111c
						1	of N	10.	115						

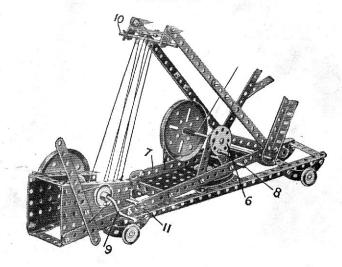


#### Model No. 2.45 Try-Your-Strength Machine

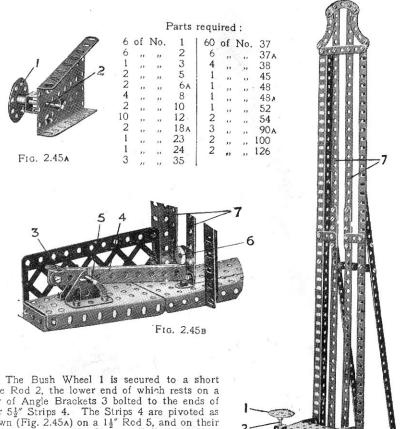


The Bush Wheel 1 is secured to a short Axle Rod 2, the lower end of which rests on a pair of Angle Brackets 3 bolted to the ends of four  $5\frac{1}{2}$ " Strips 4. The Strips 4 are pivoted as shown (Fig. 2.45a) on a  $1\frac{1}{2}$ " Rod 5, and on their opposite ends rests a  $\frac{1}{2}$ " loose Pulley Wheel 6. When the Bush Wheel 1 is struck, the  $5\frac{1}{2}$ " Strips fling the Pulley Wheel 6 upward, but the wheel is guided by the vertical  $12\frac{1}{2}$ " Strips 7. The weight of the Strips 4 then causes the Bush Wheel to resume its original position.



				Par	ts i	requi	red:				
2	of	No.	1	4	of	No.	19в	1	of	No.	52
4	,,	,,	2	4	10	,,	22	2	,,	,,	54
11	11	,,	5	1	10	,,	24	4	,,	,,	90 A
2	,,	,,	6A	6	10	,,,	35	2	**	,,	100
6	,,	17	12	59	12	,,	37	3	2.1	,,,	111c
4	21	12	16	4	19	,,	37A	1	21	,,	115
1			17	1	17	,,	45	2	11	11	126
1	,,	17	18A	1	10	,,	48	1	,,,	"	126a
				7	,,	- 71	48a				

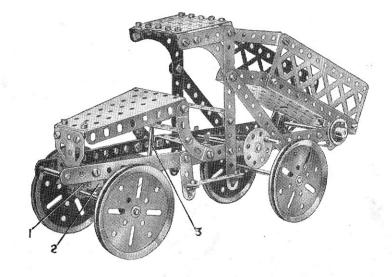


The front Axle Rod is journalled in a  $2\frac{1}{2}$ "  $\times \frac{1}{2}$ " Double Angle Strip 1 which in turn is bolted to a Double Bent Strip 2. The Double Bent Strip is pivoted to the Sector Plate by a bolt and two nuts. Cord passing over a 1" Pulley Wheel attached to the Rod 3 is fastened to the ends of the Double Angle Strip 1, and by rotating another pulley, which represents the steering wheel, the road wheels are deflected.

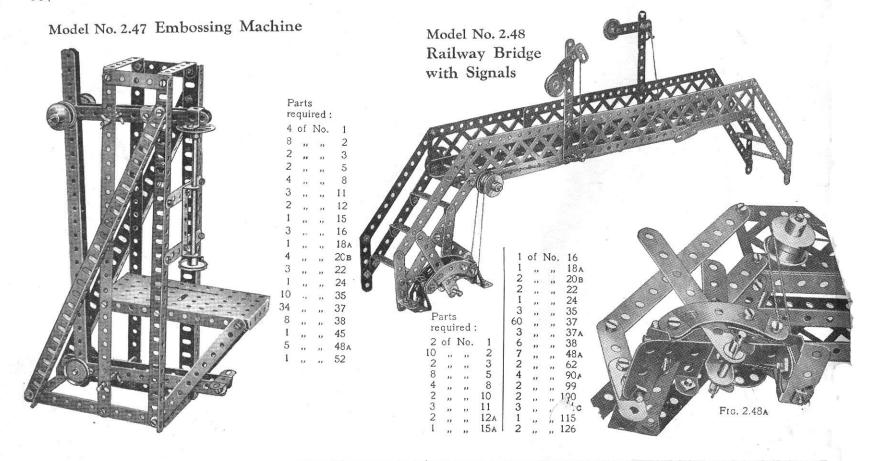

#### HOW TO CONTINUE

This completes our examples of models that may be made with MECCANO Outfits No. 2 The next models are a little more advanced, requiring a number of extra parts to construct them. The necessary parts are all contained in a No. 2A Accessory Outfit, the price of which will be found in the List at the end of this Manual.

#### Model No. 3.1 Drilling Machine

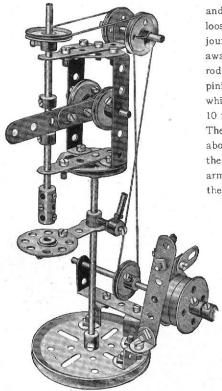


#### Parts required:


				-							
2	of	No.	4	1	of	No.	19 <sub>B</sub>	2	of	No.	48.
2	,,	,,	5	2	,,	22	20в	5	,,	,,,	59
2	,,	32	10	1	,,,	,,	21	2	,,	. ,,	62
2	,,	"	11	4	,,	. 12	22	1	"	23	63
1	,,	. ,,	12	2	,,	,,	22A	1	,,	,,	111
1	,,	,,,	15	1	,,		24	1	,,	,,	115
2	,,		15A	2	,,		35	3	,,	,,	125
2	,,	2)	17	21	,,	,,,	37	2	,,	,,	126
				1	100	1200	46				

#### Model No. 3.2 Strip-Bending Machine

This model represents a device for bending bars or rods of metal to circular form, and may be put to practical purpose in shaping strips of tin or similar material. A loose pulley 1 is spaced by a collar and washers in the centre of the short rod 2 journalled in a  $1\frac{1}{2}$ " strip 3. The latter is secured to the end of a  $\frac{3}{4}$ " bolt 4 and spaced away from the 3" pulley 5 by means of a number of washers. The opposite end of the rod is supported by a  $5\frac{1}{2}$ " strip 6. The handle 7 is secured to a  $3\frac{1}{2}$ " rod carrying a  $\frac{1}{2}$ " pinion 8. This engages with a 57-teeth gear wheel 9 mounted on another  $3\frac{1}{2}$ " rod which is free to revolve in the boss of the wheel 5. The gear wheel 9 carries a 3" strip 10 forming one of the bearings for a short rod carrying a second 1" loose pulley 11. The latter is also spaced by means of a collar and washers so that it lies immediately above the groove of the pulley wheel 5. The material to be shaped is passed between the two loose pulleys at the top of the wheel 5, and on rotation of the handle 7 the arm 10 is caused to move downward, so forcing the object to the same curvature as the circumference of the wheel.

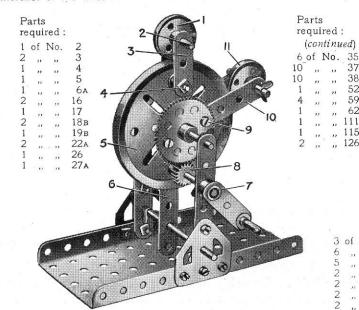

#### Model No. 3.3 Boring Machine

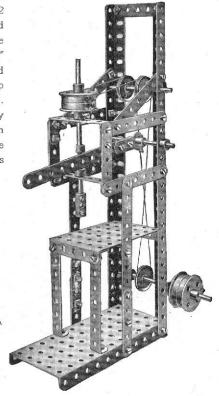

#### Parts required:


					CD	-04"	mou.				
3	of	No.	2	4	of	No.	20в	2	of	No.	481
6	33	,,,	3	1	**	1)	22	1	1)	,,	52
5	2.5	1.5	. 5	2			22A	1	,,	,,	53
2	22	,,	8	3	,,	,,	35	4	,,	,,	59
2	,,,	"	11	38	12	,,	37	1	,,*		62
2	,,		15	1	,,	,,	46	1	,,	,,	63
2	32	22	16	2	,,,		48A				


#### Model No. 3.4 Roundabout

# Parts required:

#### Model No. 3.5 Drop the Nigger


The Sector Plate 1 is a target, which, when hit, allows the nigger to be dropped. The Plate 1 is carried on the Strip 2 pivoted at 3, weight of the nigger supported on another Sector Plate 4 pittered by means of the cord 6 keeps the lower end of the Strip 2 hard against the Rod 7 pivoted at 8. When the target is hit and knocked back the Rod 7 is released and falls about its pivot, allowing the Sector Plate 4 with the nigger to drop.

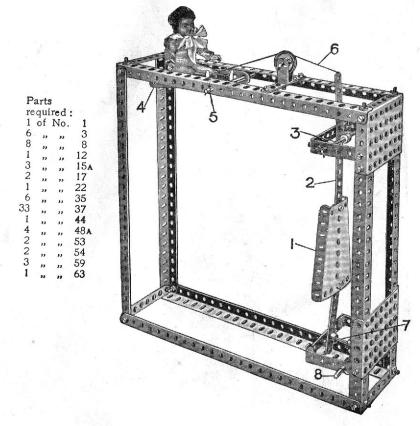

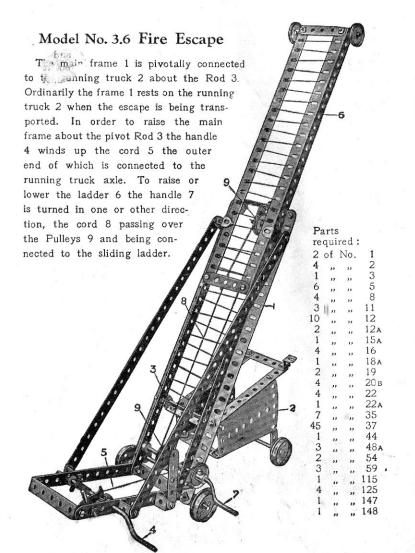


# Model No. 3.7 Crossbow Parts required: 1 of No. 17 Model No. 3.8 Coffee Grinder Parts required: 2 of No.

#### Model No. 3.9 Swing

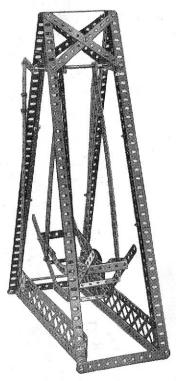


Parts required:

		1	arts	equi	rea		
7	of	No.	1	56	of	No.	37
0	,,	,,	2	4	"	1)	37A
8	,,,	23	5	6	,,,		48A
8	,,	,,	8	1	,,		48B
1 2	,,	,,	10	2	,,		59
	,,	**	15	2	,,	- 10	62
1	,,	2.1	19в	4	,,	17	90a
1	,,	23	24	2	,,,	100	99
2	11	**	35	2	,,		111c
		1	of N	10	115		

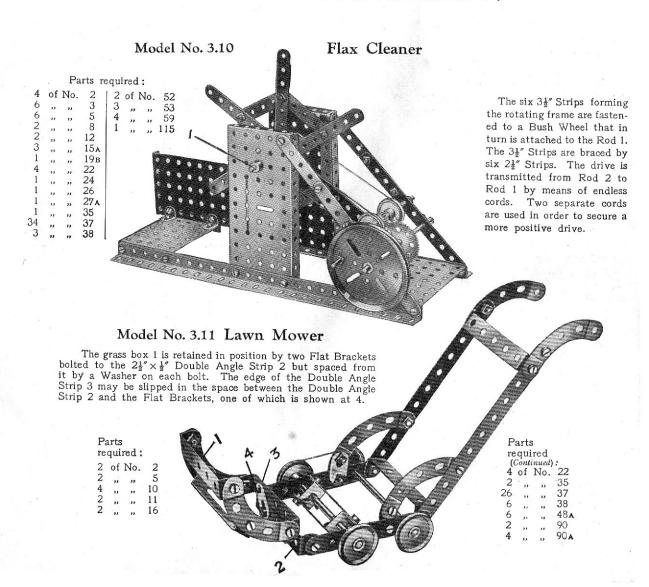

#### Model No. 3.12 Horse Sleigh


#### Model No. 3.14 Demonstration Scales

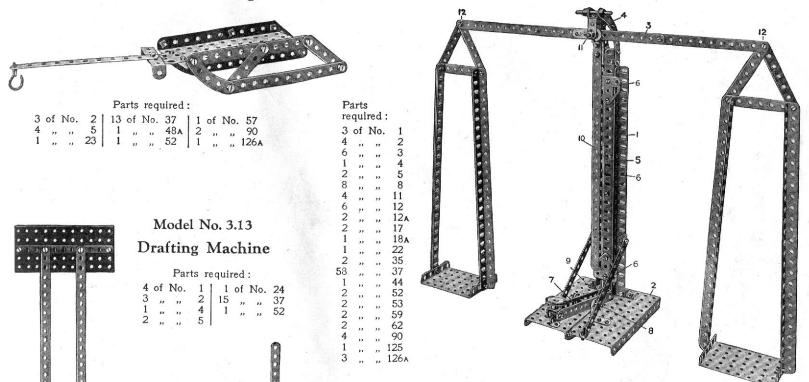

The only feature of this model which needs description is the standard, which is built up of two Angle Girders 1 bolted to the base 2 by Angle Brackets and spaced apart at the top by a  $2\frac{1}{3}$ " Strip obliquely disposed. The balance lever 3 is pivotally carried in Curved Strips 4 bolted to the top of two Angle Girders 5 sliding between the Girders 1. The Girders 5 are themselves bolted together and in order to guide them as they slide vertically Flat Trunnions 6 are bolted at the front and rear. The balance is raised by depressing the lever 8 pivoted at 9 and pivotally connected at 11 to the vertically sliding Girders 5. The indicator 10 is bolted to a Crank at the rear, the boss of which is fitted on the pivot Rod 11. The connections at 12 are lock-nutted to allow free action.

#### Model No. 3.15 Pile Driver

#### Model No. 3.16 Hand Trolley

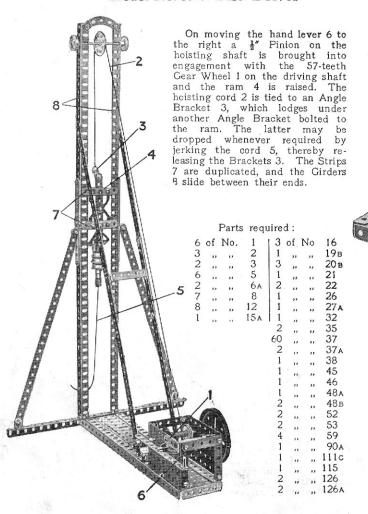


		P	arts re	equir	ed:			
4	of	No.	2	1	of	No.	24	
3	,,	,,	3	1	,,	,,	26	
2	,,	**	5	1	**	**	27A	
4	**	**	8	6	**	**	35	
8	,,	**	10	40	**	"	37	
4	,,	**	11	1	**	**	45 48в	
2	,,	**	15A	1	,,	**	48B	
4	23	,,	16	3	,,,	"	52	
1	,,	"	18A	1	"	,,	59 90a	
4	21	"	19в 22	4	"	,,	125	
2	,,	" 2	of N	[ 4	264	,,	125	
		-	01 14	10. 1	20A			
-	ГЬ			:			in.	
	The		nnect				is	
			its lo					
Du	211	AA TIGG	el and	alli	s ut	her	end	


two nuts being used to pivot the arm in each case. The drive is transmitted from the 1" Pulley Wheel on the shaft of the Bush Wheel to a similar Pulley on the axle of the road wheels by means of a crossed belt. The 1½" Rod carrying the Bush Wheel is journalled in a 3½" Strip fastened to the side Angle Girder, and also in a Double Bent Strip secured to the inside of the Girder.

to the hand lever a bolt and

#### Model No. 3.17 Tank Wagon

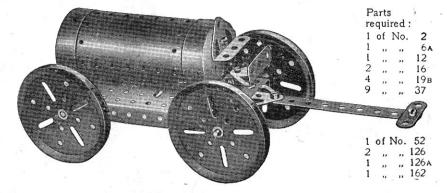


#### Model No. 3.18 Actuated See-Saw

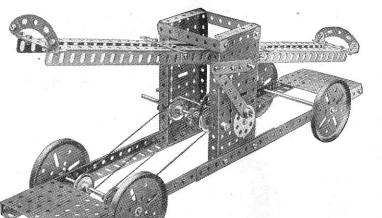

2 of No. 52

#### Model No. 3.19 Toboggan

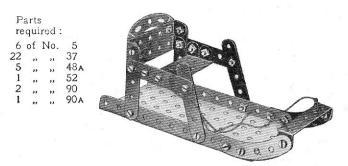

#### Model No. 3.20 The Meccangaroo


When placed upon an incline the "Meccangaroo" will "walk" with a quaint action. The positions of the various Strips in relation to the body should be reproduced as accurately as possible, for the successful working of the model depends upon them.

The animal rocks about a short Rod secured between the rocker-frame which does duty as "legs." This frame consists of two  $3\frac{1}{8}$ " Strips 3 bolted at their upper ends to cranks in which the short Rod is secured, and at their lower ends to two  $2\frac{1}{8}$ " large radius Curved Strips 4, which

# The model is actuated by the motion of one pair of travelling wheels. The axle to which these wheels are secured carries two 1" fast Pulley Wheels, which are connected by endless cords to similar Pulleys on the same Rod as a $\frac{1}{2}$ " Pinion Wheel. This $\frac{1}{2}$ " Pinion meshes with a 57-teeth Gear Wheel secured to the Rod of a Bush Wheel, and the latter is connected by means of a $5\frac{1}{2}$ " Strip to an extended crank (a $2\frac{1}{2}$ " Strip and a Crank bolted together) secured to the pivotal Rod of the see-saw.


Parts required:

4 of No. 22

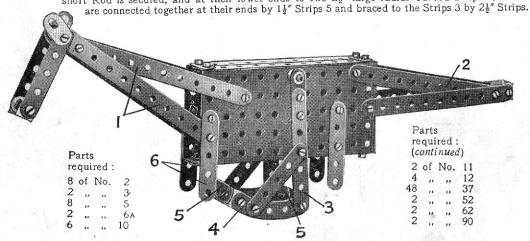


#### Model No. 3.21 Ice Boat

#### Model No. 3.22 Pastry Designer

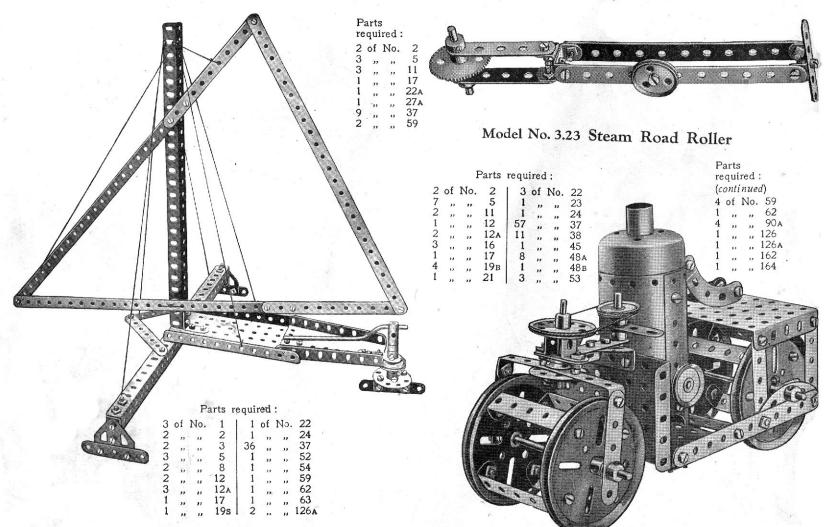

#### Model No. 3.24 Paddle Boat

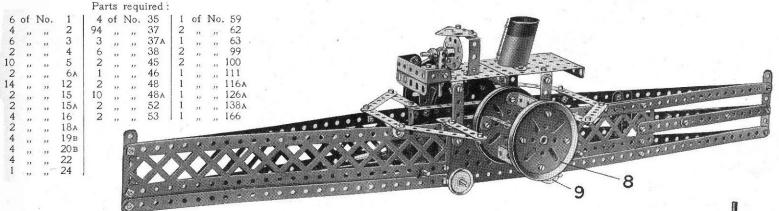

The paddle-wheels are secured to a crankshaft (see Fig. 3.25A) consisting of two  $3\frac{1}{2}$ " axle rods 1, two cranks 2, and a  $\frac{3}{4}$ " bolt 3 secured to the central holes of the cranks. The two oscillating cylinders 4 are built up from two 3" flanged wheels and a pair of sleeve pieces, the latter being bolted to the  $2\frac{1}{2}'' \times \frac{1}{2}''$  double angle strips 5, which are free to turn on rods 6. The ends of the 5" piston rods are secured in the bosses of two small fork pieces 7, which pivot about the  $\frac{3}{4}$  bolt 3 of the crankshaft. As the model runs along the ground, the 3" pulley wheels 8 secured to the rods 1 are rotated by endless cords from the 1" fast pulley wheels 9, while the cylinders 4 oscillate and appear to be actually operating the paddle-wheels.





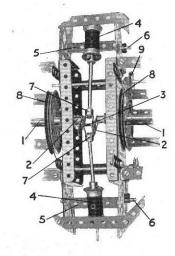


Fig. 3.25A

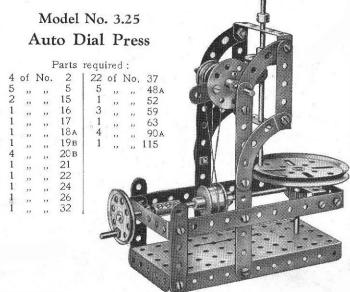


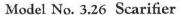

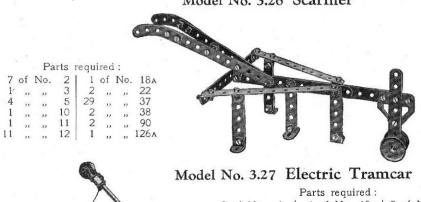

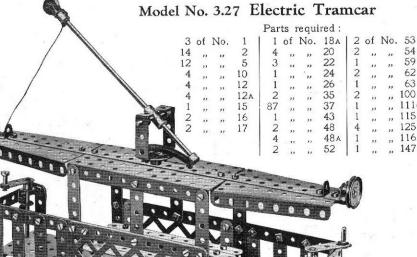


#### Model No. 3.28 Pit Head Gear

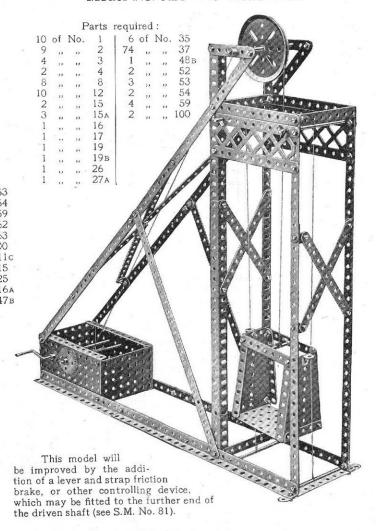


#### Model No. 3.29 Tower Wagon

#### When operated the handle 1 winds in the cord 2, which passes over a 1" fast pulley wheel 3 and is tied to the rod 4. The upper part of the tower is thus raised or lowered as required, being guided by the 3" flanged wheels 5 and two pairs of reversed angle brackets 6. The steering cords 7 are tied to the 57-teeth gear wheel 8 and to the end of a $2\frac{1}{2}'' \times \frac{1}{2}''$ double angle strip bolted to a double bent strip, which is pivoted to the sector plate 9. The front axle is journalled through the ends of the double angle strip. Parts required: 115

#### Model No. 3.30 Two-Cylinder Vertical Steam Engine

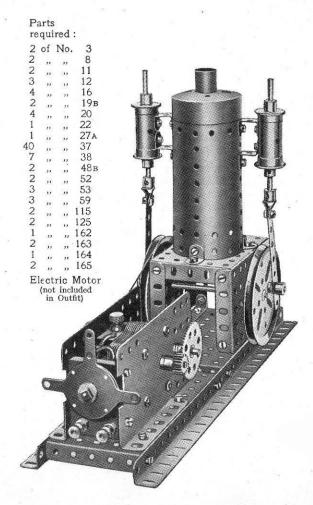

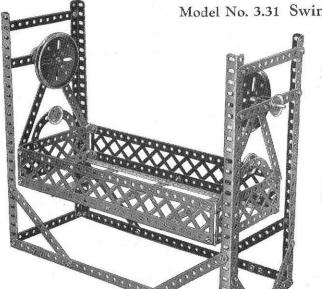


#### Model No. 3.31 Swinging Cot

#### Parts required:

		1 6	TI CO IC	, qu	iicu			
2	of	No.	1	6	of	No.	37A	
-18	,,	,,	2	8	,,,	23	38	
6	,,,	,,,	3	1	21	12	45	
2	,,	,,	5	3	,,	5.0	48A	
8	**	23	8	1	,,	,,	52	
3	,,	,,	12	4	3.5	,,	59	
1	,,,	23	15	2	33	,,,	62	
1	,,	,,	15A	-1	11	,,	63	
3	,,	12	16	1	11	,,	98	
1	1,1	,,,	22	2	21	23	99c	
10	,,	33	35	2	,,	"	100	
68	11	33	37	4	,,	3.7	111	

#### Model No. 3.33 Swing Boat

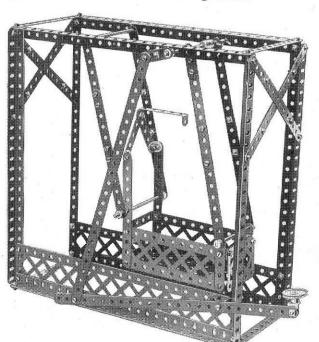

#### Model No. 3.32 Lace Jennier

#### Parts required:

				-oqu	1100		
6	of	No.	2	28	of	No.	. 37
2	13	,,,	8	1	,,,	,,	37A
4	23	,,,	11	4	"	,,	38
2	23	,,	15	2	,,	,,	48в
1	10	,,	19в	2	,,	,,	52
1	22	,,	24	2	,,	,,	53
1	17	,,	26	2	,,	,,	59
1	12	,,	27A	1	23	11	115

r arts required.												
2	of	No.	1	2	of	No.	22A					
17	,,	,,,	2	64	,,	,,	37					
4	2.5	,,	5	2	,,,	,,	37A					
6	, ,,	,,	8	2	,,	23	45					
8	>1	,,,	12	4	,,	,,	90 A					
2	22	1.1	17	2	11	2.5	99					
2	,,	,,	19E	2	,,	**	100					
2	,,	,,	22	2	23	**	111c					

#### Model No. 3.32 Railway Gauge



### Parts required: 2 of No.


#### Model No. 3.33 Auto Swing Boat

The connecting strip 1 is attached pivotally at one end to a threaded pin secured to the bush wheel 2 on the driving spindle of the motor, and at the other end by means of bolt and lock-nuts to a crank 3 mounted on the shaft 4, which operates the swing boat.


#### Parts required:

3	of	No.	1	1	of	No.	10	86	of	No.	37	2	of	No.	90A
16	,,	13	2	12	,,	32	12	2		110	37A	2			99
6	,,	"	3	2	,,	,,	15	1	,,		59	2		- 11	100
8	,,	,,	5	1	ñ		24	2		993	62	1			111c
8	,,		8	2	55	99	35	1	22		63	1		11	115
							of N						- 17		


Clcckwork Motor (not included in Outfit)

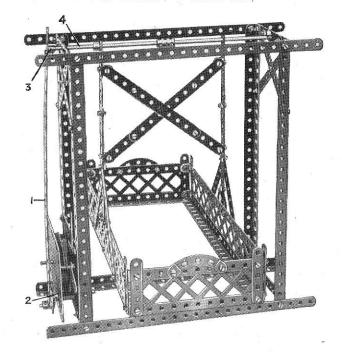

#### Model No. 3.34 Scales

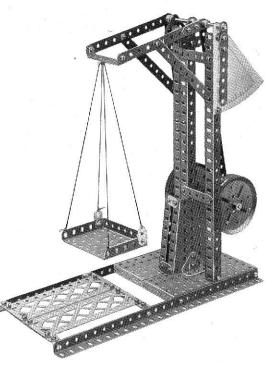


Parts required:												
10	of	No.	2	2	of	No.	48A					
1	1,	,,	3	1	,,	22	48B					
2	12	,,	5	2	,,	"	52					
2 5 7 5 2 4	,,	,,	8	1	,,	23	53					
7	23	32	10	2	12	22	54					
5	2.2	1)	12	4	,,	2.9	59					
2	23	,,	15A	2	,,	23	62					
10-20-20-2	,,	12	19в	2	, ,,	,,	100					
67	,,	33	37	2	,,	13	126					
2	23	92	38	2	21	- 10	126a					

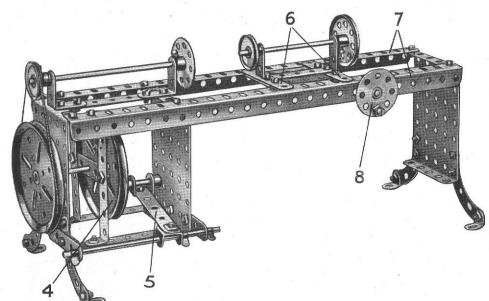

#### Model No. 3.36 Vertical Steam Engine

#### Parts required':

						+	
2	of	No.	12	1	of	No.	45
1	17	21	16	1	22	2.3	52
1	12	,,,	17	1	22	13	59
1	,,		19в	1	,,	,,	115
2	,,		20в	1	,,	,,	162
2	,,	21	22	1	22	,,	163
1	,,	,,	24	1	,,	,,	164
9	,,	"	37	1	,,	2.7	166
2			38				

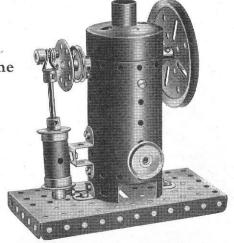

#### Model No. 3.35 Lathe

The arrangement of the treadle is shown in detail in Fig. 3.35A. The crank 1 is provided with a flat bracket, the round hole of which coincides with the elongated hole of the crank, and receives the short rod 2. The crank 1 is free to turn about a threaded pin 3, secured to the 3" pulley wheel 4, and once the latter is set in motion it can be kept in rotation by working the treadle 5. The strips 6 of the saddle (Fig. 3.35) are duplicated and their ends form slots to receive the flanges of the angle girders 7. The hand wheel 8 is a dummy one, but if desired it may be arranged to operate the saddle by an endless rope device.

#### Parts required:

3	of	No.	. 3	2	of	No.	16	3	of	No.	35	4	of	No.	59
10	,,	,,	5	1	2)	,,	17	44	13	,,	37	1	1)	,,	62
2	.,	,,	8	1	23	12	18A	2	1)		37A	4	23	12	90A
2	11	,,,	11	2	,,	13	19B	4	2.5	1)	38	1	2.2	3.7	111c
4	17	1)	12	1		23	21	1	23	12	46	1	21	2.3	115
2	,,	1)	12A	2	12	11	22	2	22	23	48B				
2	,,	2.3	15A	1	11	,,	24	3	,,,	23	53				


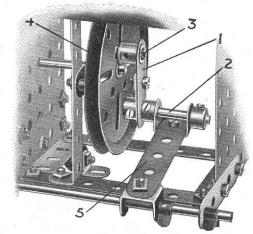


Fig. 3.35A


#### Model No. 3.39 Horizontal Engine

This model forms an interesting example of the use of the Meccano boiler, sleeve piece and other new parts. The  $2\frac{1}{2}''$  strip 1, forming the connecting rod, is attached to the  $1\frac{1}{2}''$  pulley wheel by means of a threaded pin. The latter is fastened in one hole of the  $1\frac{1}{2}''$  pulley wheel, and two washers are placed upon it between the strip 1 and the wheel. The connecting rod is held in place by a collar locked to the end of the threaded pin. The boiler is attached to the framework by means of two  $2\frac{1}{2}'' \times \frac{1}{2}''$  double angle strips attached by their centre holes to the side of the boiler opposite the chimney. When the boiler is placed in the position shown, the whole is secured by bolting the double angle strips to the side flanged plates.

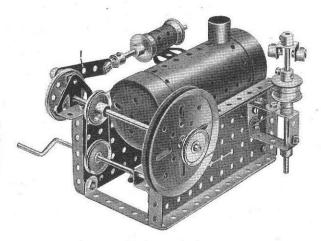

#### Parts required:

				- 4		1094	LICU.				
1	of	No.	5	3	of	No.	22	1	of	No.	115
2	17	,,	12A	1	,,	12	35	1	>>	,,	116
2	11	22	15A	25	21	13	37	2	21		126
1		21	16	7	22		38	1	,,	.,	126A
1	,,,	21	19в	1	23	**	45	1	> >	12	162
1	,,	,,,	19s	1	,,,	2.1	48	1	32	21	163
4	,,	,,	20в	4	,,,	11	48A	1	12	,,	164
1	,,	23	21	2	>2		52	1	,,	**	166
				4			59				

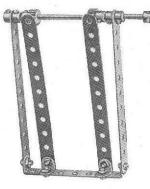

#### Model No. 3.40 Rattle

Parts required:


4	of	No.	2	16	of	No.	37
2	12	22	12	1	1)	21	48в
2	,,	21	15	4	,,	21	59
2			26	1.			63


#### Model No. 3.41 Oil Cake Chopper

Parts required:

		1.	AL CD I	cqu	1100		
4	of	No.	3	1	of	No.	52
6	,,	,,,	10	2	,,	12	53
1	22	2.5	15	2	22	11	54
1	**	2.2	19в	1	11	.,	59
4	2)	2.5	22	2	33	12	90 A
24	22	2.3	37	1	,,	.,,	115
2	22	23	48в	2	,,	,,,	125

Fig. 3.41A, shows the hand wheel and shaft removed from the model. It will be seen that the chopping mechanism is represented by flat brackets clamped between two pairs of 1" fixed pulley wheels.

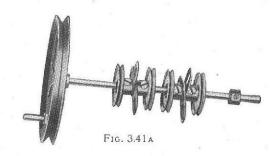

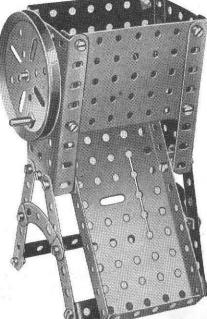

#### Model No. 3.42 Railway Wagon Swivel Crane

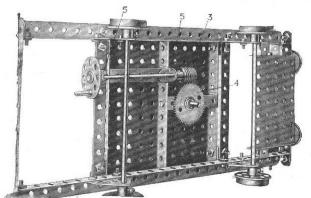



Fig. 3.42A


The flanges of the sector plates 1 are bolted to the 3" pulley wheel upon which the crane swivels, and the spindle of the pulley wheel is rotated by the worm 3 engaging the gear wheel 4 (Fig. 3.42a). In order to bring the worm centrally over the teeth of the gear wheel 4, washers are placed beneath the angle brackets 5 in which the spindle of the worm is journalled.

				1 0	1 12	1094	nica.	
4	of	No.	1	4	of	No.	20в	-
6	,,	22	2	4	,,	,,	22	
1	13	33	3	1	,,	,,,	22A	
1 2 4	2)	1.2	5	1	,,,	12	24	
	23	3.2	8	1	,,	,,	27A	
1	22	,,	11	1	2.0	,,	32	
14	,,	23	12	3	23	,,	35	l
2	,,	21	15	70	,,	"	37	ı
1 2	19	12	15A	2 2 2	,,,	25	38	l
2	2.7	33	17	2	12	21	48A	ı
1	22	13	19		,,	,,	52	ı
1	23	,,	19B	2	,,	,,	53	


#### Model No. 3.43 Wire Rope Maker

The strands are twisted from both ends by the handles 1 and 2 of the fixed parts. The handle 1 rotates through a large gear wheel 3 two pinions 4 on the rods 5 carrying cranks to which the strands are attached. The other ends of the strands are connected to a double bracket 6 on a bush wheel which is rotated in the opposite direction by a crank handle 2. The carriage 7 runs on rails and the vertical rod 8 is kept just at the formation of the twisted rope and so controls the tightness of the twist.

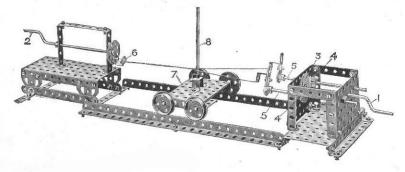

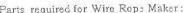


				Parts	re	quire	ed for	Wire	R	ope.	Maker	:			
6	of	No.	2	1 2	of	No.	15	1	of	No.	27A	2	of	No.	52
1	23	,,	3	3	,,	,,	15A	3	1)		35	3	12	,,	53
2	,,	,,	5	2	,,	,,	19s	50	,,	22	37	4	11	,,	59
2	,,	23	8	4	,,,	,,	20B	1	22		45	2	,,	23	62A
3	,,	23	11	1	22	,,	24	2	,,	,,	48A	4	,,	,,	126
12	,,	,,,	12	2	,,	7.1	26				İ				

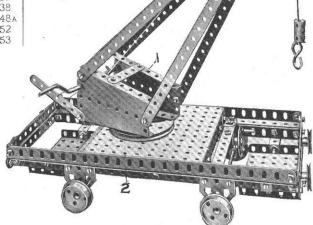


#### Model No. 3.44 Letter Balance

				Par	ts	requi	red:					
4	of	No.	2	2	of	No.	18A	1	of	No.	53	
2	,,	22	3	2	,,	22	20в	4	32	22	59	
5	,,	,,,	5	2	23		22A	1	,,	23	62	
2	,,	,,,	10	4	11	,,	35	1	23	11	63	
1	. ,,	,,,	11	37	>>	"	37	2	23	,,	90A	
4	,,	. ,,	12	6	2.5	32	37A	2	23	33	111	
2	,,	31	12A	2	23	,,	48A	. 4	21	11	111c	
1	- ,,	,,,	15	1	,,	,,	48в	2	,,	,,	125	
2	,,		17	1	,,		52	2	,,		126A	

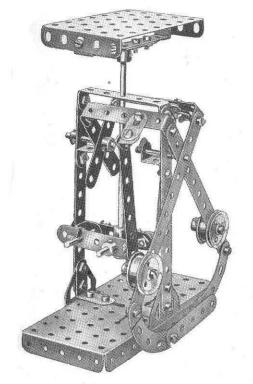

#### Model No. 3.45 Tank Lorry

P	arts	5	
re	qui	red	:
2	of	No.	1
8	,,	,,,	2
1	**	,,	3
6	,,	2.5	5
1	12	2.5	6A
2	,,	1.8	8
2	21	12	11
16	23	12	12
2	,,	2.2	12A
2	**	,,	15
1	,,	1,	15A
4	11	,,	19в
2	,,	"	20в
- 1	*2	,,	22
1	"	2.5	24
4	,,	33	35
60	22	2.5	37
1	15	23	37A
4	**	33	38
1	,,	11	48
1	.,	,,	48A
2	11	,,	48в
1	1,1	12	52
2	11	,,	53
2	12	13	54
4	32	12	59
3.	37	11	90a
1	,,	23	98
2	٠,,	>>	111c
4		,,	125
2	,,	23	126
1	32	27	162

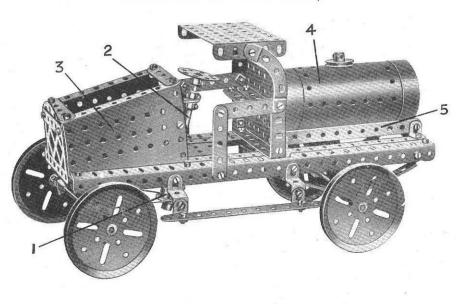

It should be noted that the steering cord is given a complete turn around the two 3" flanged wheels 1 to prevent slipping. The steering column 2 is journalled in the end of a 11 strip, the other end of which is bolted to a  $2\frac{1}{2}" \times \frac{1}{2}"$ double angle strip secured between the two sector plates 3. The front road wheels are secured to a 5" rod that is journalled in the end holes of a  $3\frac{1}{2}'' \times \frac{1}{2}''$  double angle strip. The ends of the steering cord are tied to this strip, which is pivoted by means of a bolt and lock-nuts (S.M. 263) to the central hole of a  $1\frac{1}{2}'' \times \frac{1}{2}''$  double angle strip. The latter is bolted between a pair of Trunnions attached to the underside of the  $5\frac{1}{2}'' \times 2\frac{1}{2}''$  flanged plate. The tank 4 merely rests on the 5\frac{1}{3}" strips 5.

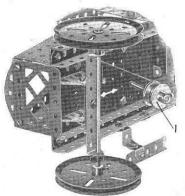


Fig. 3.45A

#### Model No. 3.46 Horizontal Engine

#### Parts required:


5	of	No.	5	30	of	No.	37
2	,,	12	8	3	,,,		48A
2 2 3	,,	"	12	2	,,	,,	48B
	,,	21	15A	2	- 12	,,	52
1	,,	,,	19s	2 3 3	,,	13	53
2	1)	**	19в	3	21	,,	59
	1)	22	20в	1	,,	11	116
1	23	,,	21	2	,,	,,	126
1	22	11	22	1	33	.,,	162
2	33	,,	35	1	,,	,,	163
		1	of N	10.	165		



The small roller, which consists of two  $\frac{2}{4}$ " flanged wheels secured to a short rod, rest on the edges of the two 3" pulley wheels. In actual practice the container is filled with whitewash, in which the inner wheel is partially immersed, and the mixture is transferred via the roller to the outer wheel, which does the actual marking.

Model No. 3.48 Lawn Marker


#### Model No. 3.47 Newton's Disc

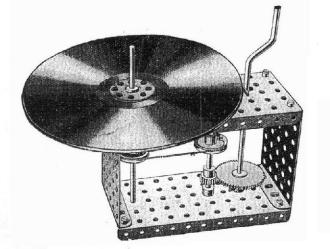


This is a model to show that white light is made up of the three primary colours—red, yellow, blue. Sectors of these three colours are mounted or painted on the disc, which, if then quickly rotated, shows as white.


#### Parts required:

1	C	of	No.	15	1	of	No.	24 26 27 A 35	18	of	No.	37
1	,	,	,,	15A	1	,,	**	26	2	,,	,,	52
1		,	,,	19	1	,,	11	27A	2	,,	11	53
2	2 ,	,		22	2	,,	,,	35	4	,,	"	59

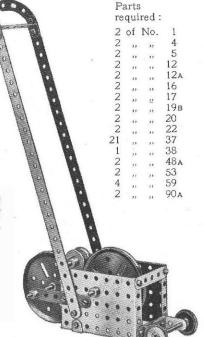

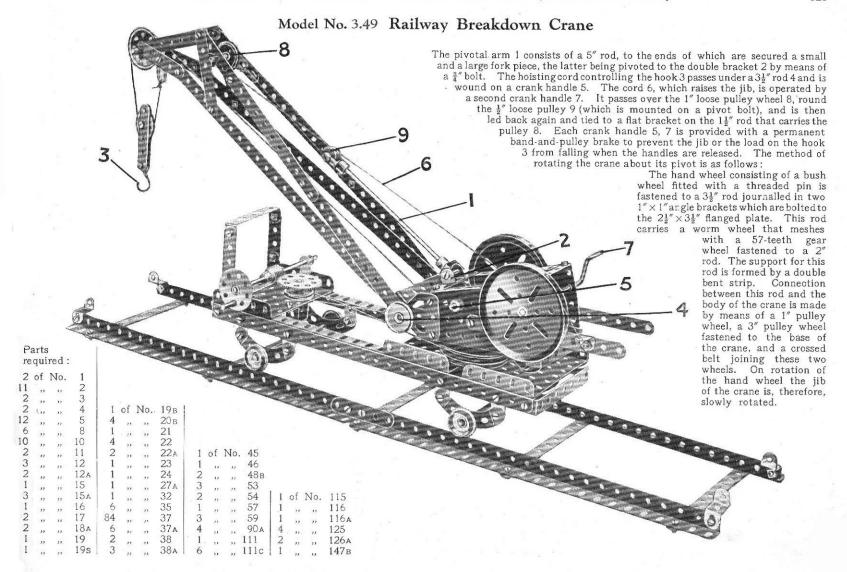

#### Model No. 3.50 Kinetograph

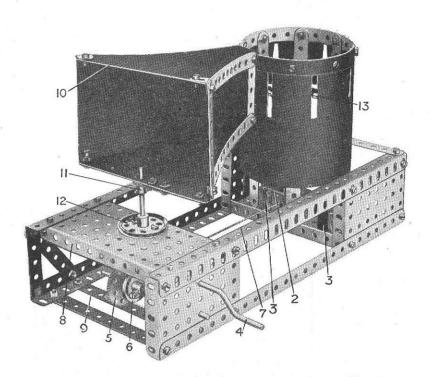


Most Meccano boys probably are aware of the principles of the Kinetograph, but for the benefit of those who have not seen one in action, we may mention that it is a device which imparts an appearance of animation to a series of pictures, each differing slightly from the other and passed in rapid succession before the eyes. In this respect it resembles the remarkable principle upon which the modern cinematograph is based.

In constructing the Meccano model the following details will prove useful:—The drum consists of a  $12\frac{1}{k}$ " strip bent to form a circle, with its ends overlapping one hole, and bolted to eight vertical  $5\frac{1}{k}$ " strips forming the sides. Two pairs of opposite  $5\frac{1}{k}$ " strips are connected by  $3\frac{1}{k}$ " strips and angle brackets bolted in the third holes from their lower ends. The  $3\frac{1}{k}$ " strips cross at right angles to one another and are bolted in the centre to a bush wheel, in the boss of which is secured a short rod forming the pivot of the revolving drum. This rod is journalled in a double bent strip bolted to a  $2\frac{1}{k}$ " 1" double angle strip 2. This, in turn, is secured to the base of the model by two 1" 1" angle brackets 3. A further bearing for the short rod consists of a crank tolted in the base of the model,

The drum is rotated from the crank handle 4, on which is mounted a ½" pinion engaging a 57-teeth gear wheel 5 secured to a 3½" rod carrying a pulley wheel 6. The latter is connected by means of a cord 7 to a similar wheel nipped to the vertical spindle of the drum. Bearings are provided for the inner ends of the crank handle and 3½" rod by a double angle strip bolted between the plate 8 and 5½" strip 9. The sighting box 10 is built up from a framework of strips and is secured by means of a crank 11 to a short vertical rod rigidly mounted in the boss of the ½" pulley 12. The four sides of the framework 10 are covered with some black material; stiff black paper suitable for this purpose may be obtained from any stationers. The drum is enclosed in the same way, but the covering paper should be cut in a strip measuring  $12½" \times 4½"$  and pierced with slots spaced 1½" apart (from centre to centre) so that they fall exactly between the upright 5½" strips. The slots should measure  $1½" \times ½"$ .

The type of drawing suitable for use in this model is shown in Fig. 3.50a, and the dimensions indicated therein should be followed carefully. No doubt Meccano boys will be able to devise numerous amusing pictures of a similar kind for themselves. The strip of stout white paper carrying the sketches is inserted in the bottom of the drum, as indicated at 13. The model is now ready for operation. Placing the frame 10 over the eyes, the line of vision is directed through the narrow end, where the strips are held apart by means of double brackets, and through the slots in the drum. The latter should be rotated rapidly by operating the handle 4, and as it revolves, the little dog shown in Fig. 3.50a will be seen jumping over the fence with a most realistic and amusing action.

Parts required:	<del>7</del> " →	
1 of No. 1   1 of No. 15A   12 of No. 38 17 , , , 2   2 , , , 16   1 , , , 45 6 , , , 3   1 , , , 19s   1 , , , 46 1 , , , 4   1 , , , 21   1 , , , 48 3 , , , 5   2 , , , 22   2 , , 52		
4 " " 8 1 " 24 3 " 53 2 " " 11 1 " " 26 4 " " 59 12 " " 12 1 " " 27A 2 " 62 2 " " 12A 60 " " 37	$\frac{  \frac{1}{2} ^{2}}{\text{Fig. 3.50a}}$	<b>—————————————————————————————————————</b>

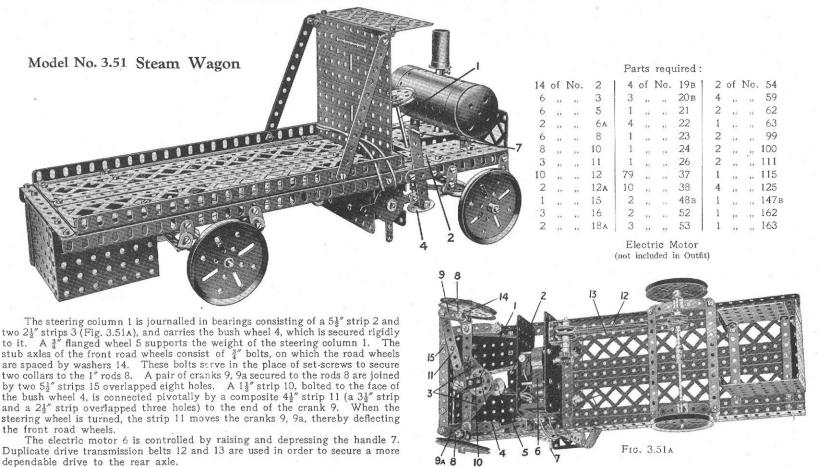


#### HOW TO CONTINUE

This completes our examples of models that may be made with MECCANO Outfit No. 3. The next models are a little more advanced, requiring a number of extra parts to construct them. The necessary parts are all contained in a No. 3A Accessory Outfit, the price of which will be found in the List at the end of this Manual.

#### A Selection of Meccano Standard Mechanisms

Here are a few simple and interesting movements showing how easily real mechanisms can be reproduced with Meccano. They are a selection from the Meccano Standard Mechanisms Manual, which is fully described on page 2 of this Manual.

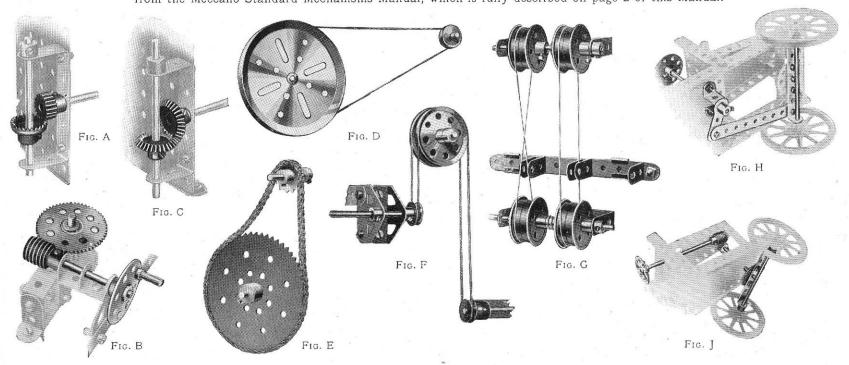

#### Gears

The Meccano system includes a wide range of Gear Wheels, Bevel Gears, Pinion Wheels, Contrate Wheels and Worm Wheels in various sizes. All manner of interesting movements may be obtained by the use of these gears.

Fig. A shows how a drive may be transmitted from a vertical to a horizontal shaft or vice versa. Fig. B shows a Worm engaged with a Gear Wheel, giving a very great reduction in shaft speed. Fig. C illustrates another right angle drive, obtained by using Meccano Beyel Gears.

#### Belt and Chain Drives

In Figs. D, E, F and G we show examples of belt and chain drives. The movements illustrated require no explanation excepting, perhaps, Fig. G, which shows a simple method for slipping the belt from the fast to the loose pulleys or vice versa.

Cords usually take the place of belts in Meccano models but miniature belting may be made from strips of canvas, indiarubber, etc., in which case Flanged Wheels should be used instead of grooved Pulleys.

#### Steering Gears

The various types of steering mechanism commonly in use on vehicles of all descriptions may readily be reproduced with Meccano.

Fig. H. In this case the road wheels are moved about their central pivot by means of a crank, which is secured to the steering shaft, and a connecting strip.

Fig. J. The road wheels in this example are secured to a central rod, which forms a pivot, and is rotated from the hand-wheel by means of a worm gear.

#### A Selection of Meccano Standard Mechanisms (continued)

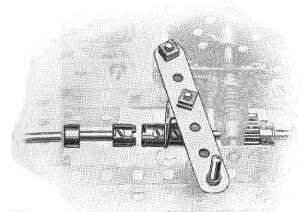


FIG. K




Fig. I.

#### Dog Clutch

The Meccano Dog Clutch (Fig. K) may be used in most models where a simple clutch is required. It is also useful in the construction of drive-changing and reversing mechanisms, etc. Various kinds of clutches, in addition to the Dog Clutch, may be constructed from the standard Meccano parts.

#### Intermittent Rotary Motion

Fig. L shows one device by means of which intermittent rotary motion may be obtained. Such an arrangement is useful in revolution counters. measuring machines, etc. In addition to mechanisms that give true intermittent motion, different types of cams, converting a regular rotary motion into a constant or intermittent reciprocating motion, are described in the S.M. Manual.

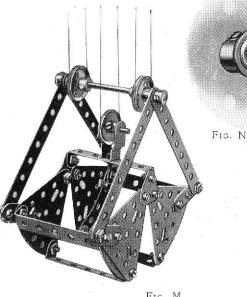



#### Grabs

A typical example of the many kinds of grab that can be constructed from Meccano is shown in Fig. M. If the grab is fitted to a model crane or ship-coaler, all the movements can be controlled from an operating box built into the frame of the model. The outer sides of the jaws may be filled in with cardboard and the grab can then be used to pick up loads of sand, grain, marbles, etc.

#### Pawl and Ratchet Wheel

Fig. N illustrates the standard Meccano Pawl and Ratchet Wheel gear, which allows the shaft carrying the Ratchet Wheel to rotate in one direction only. The advantages of such an arrangement are obvious, especially when attached to model Cranes, hoistingtackle, etc., where the Pawl and Ratchet gear prevents falling-back of the load as it is hoisted.


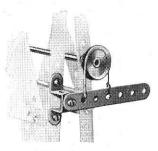


Fig. O

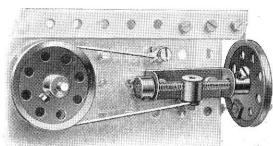

#### Strap and Lever Brake

This device (Fig. O) will be found very useful as a quick emergency hand-brake. Although it is the most simple of such devices, it is also one of the most valuable.

#### Strap and Screw Brake

The type of brake shown in Fig. P is used to apply a constant retarding effect to a rotating shaft. It can thus be utilized in a crane to prevent the load from falling back when the winding spindle is One advantage of the brake is that the speed of the shaft to which it is applied can be infinitely varied, so that in some models it will take the place of a gear-changing mechanism.

# CONTENTS OF OUTFITS

7	857+167288382+23+23-16804+256808+850+050+050+060+060+060+060+060+060+060+0
6A	30   82 8   282 1   50   Barbare   9   8 + 8 0 + - 0 1 9   1   1   2   2   2   2   2   2   2   2
9	\$014844   \$00x 200   \$0   450x \$0 + 60 + 60 + 60 + 60 + 60 + 60 + 60 +
34	8042 34 88   5000 700 10 44 5 4-88   -0404 100       -
10	\$   84 + 51 88 + 80   1 + 4     -     1 5 8 8 0   1 - 1 + 4 1     -     1 5 8 8 0   1 - 1 + 4 1
44	4
4	21   24 0 0 2   24   26   27   27   27   27   27   27   27
34	21   20   40       -     4           20   21 - 20   21 - 20   21 -
83	5
2A	
62	2  1  0  2  0  1  0  1  0  1  0  1  0  1  1  1  1
٧,	Φ   Φ   -   Φ     0   1   1
-	4
N	4   4   -
0	4
00V	[[[]]]]]]]]]]]]]]]]]]]]]]]]]]]]]]]]]]]]
3	4       \oldsymbol{a}               4   \oldsymbol{a}
KT.	M. M. X. X. Z. 23
LAKI	- I I I I I I I I I I I I I I I I I I I
40	
DESCRIPTION	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$
7.50	Three Strips, Greders, 224 Greders, 224 Greders, 224 Greders, 224 Greders, 224 Greders, 224 Greders, 225 Gred
	wated Str.  Girders,  Girders,  Brackets  Brackets  Brackets  Brackets  Brackets  Str.  Wheels,  Wheel
	Angle Griders, 2  Angle Griders, 2  Angle Brackets  Double Brackets  Angle Brackets  Angle Brackets  Pulley Wheels, 1  Pulley Wheels, 1  Pulley Wheels, 1  Pulley Wheels, 1  Bush Wheels, 1  Pulley Wheels, 1  Pulley Wheels, 1  Bush Wheels, 1  Spring Clips.  Ansker Springer  Perforated Flang  Flat Plates, 44  Perforated Spring  Perforated Flang  Flat Plates, 44  Perforated Spring  Perforated Flang  Flat Plates, 44  Perforated Flang  Flat Plates, 44  Perforated Spring  Perfor
	Angle  Axie i  Axie i  Batel  Axie i  Axie i  Axie i  Axie i  Batel  Bat

Outfits-continued
o
Contents

7	-1842020000000000000000000000000000000000
64	
9	- 24 + 40 2 4 2 4 1   40 4 - 1   6 2 4 2 2 - 1 4 2 4 2 2 3 2   41   1   1   1   1   1   1   1   1
54	-5   144 144 144 144 144 144 144 144 144 1
10	1 2 4 2   2   1 -   1 -   1 -   1 -   1 -   2   1   1   1 -   2   2   1   1   1   1   1   1   1   1
4	
4	
34	C +     D   -
3	[+ 0 - - - - - - - - - - - - - - - - - -
2A	[4][[-][[[[[]]]]]]
63	
1,	
-	
0.4	
0	
V00	
00	
	<u> </u>
11	1:4:1::::::::::::::::::::::::::::::::::
1	
T.	
PART.	
40 1	Sacks  Sacks  Tidiam.  Tidiam.  Tidiam.  Tidiam.  Tidiam.  Tidiam.  Tidiam.  Tidiam.  Tidiam.
DESCRIPTION	swith Set Serves  swith Set Serves  swith Set Serves  saded Cranies  Forks  Gupdings  Gupdings  Gupdings  Gupdings  Forks  Surps  Gupdings  Gupdin
SCRII	Triple Strips of
DE	s with Set and
3	Spring Cord, 40° Collars with Set String Cord and Set Strip Couplings Couplings Couplings Couplings Couplings Couplings Couplings Couplings Threaded Bosses Couplings Threaded Bosses Strip Couplings Threaded Bosses Couplings Threaded Bosses Strip Couplings Threaded Bosses Coursed Strips, 51  Sand Bosses Coursed Strips, 51  Read Hooks Wheels, 22  Sand Hooks Wheels, 23  Sand Bosses Course Strips That Griders Sing Bullers Couplings That Threaded Bosses Couplings Threaded Bosses Sand Bosses Couplings Threaded Bosses Couplings Threaded Bosses Sand Bosses Couplings Threaded Bosses Couplings Threaded Bosses Soring Bullers Companies Threaded Bosses Couplings Threaded Bosses Thre
	Spring Cord, 40° Icollars with Sale S, Vindmill Sales Couplings Couplings Couplings Strip Couplings Threaded Bosses Carlet Forks S × 2 Fraction
No.	88 88 88 88 88 88 88 88 88 88 88 88 88

Signere Pheese	7	21211222408	7
Silence Pleese Chinary Adaptors Scried Bearings Scried Bearings Scried Bearings Digger Buckets D	- P9		-
Sierre Pieces   Charles	9	21-21-1	
Sierre Pieces   Chimner Adaptars   Chimner   Chimner Adaptars   Chimner Adaptars   Chimner Adaptars   Chimner	5A		
DESCRIPTION OF PART.   00   00A   1   1A   2   2   2   3   3   4   4	0	a-a [ [ ] [ [ ] [ ] [ ] [ ] [ ] [ ] [ ] [	
Sieve Fleese   Siev	44		!
Sieve Pieces   Description of Part.   000   000   1   10   2   2   3   3   3   3   3   3   3   3	4	0-0	
Descentation of Part.   00 000   0   1   1   2   2   2	3.4		
Secret Pieces	3	2	1
Chimmey Phenes   Chimmey Part.   Chimmey Adaptors	24	a	1
Description of Part.   000 00A   1   1	61		1
Description of Part.   00 000   0 000	1,4		ţ
Description of Part.   00 00A   0	-	muniningmundi itamihisimmu i	
Sievee Pieces   Sievee Bearings   Sievee B	ν0	тинининин ининдининин г	1
Description of Part.   000	0		
Sleeve Pleese Chinney Adaptors Find Discur Buckets Find Bushes, Insulating Bushes, Insulating Bushes, Insulating G. B.A. Nuts G. B.A. Nuts Concludeds Lamp Holders Lamp Holders Lamp Holders Lamp Gone Wire, 4 vds. coil Electric Manual of Instructions Colockwork Motors Colockwork Motors Liettic Manual of Instructions Cockwork Motors Electric Manual of Instructions Cockwork Motors Cockwork Motors Liettic Manual of Instructions Cockwork Motors Liettic Manual Cockwork Motor Cockwork Motor Liettic Manual Cockwork Liett	v00		
Sleeve Pleers Chimney Adaptors Chimney Adaptors End Diger Buckets Bobbins Bushes, Insulating Contact Server Foole Pleers Coll Cheeks Lamp Holders Lamp Lamp Lamp Lamp Lamp Lamp Lamp Lamp	00	пинанининин индининини	1
Sleeve Pleess Chimney Adaptors Servel Bearings Find Bubblins Gara Contact Servey Fool Pleess Coll Cheeks Coll Cheeks Coll Cheeks S.C.C. Wire, reel 30 yels 23 Sare Coper Wire, 4 yels. coll Electric Manual of Instructions Clookwork Addors Bubblins No. 9-Bagarelle Table No. 9-Bagarelle Table Bubblins B			2
Siecre Pieces Chimney Adaptors Chimney Adaptors Find Digor Buckets Find Find Find Find Find Find Find Find		8	ï
Sleeve Pieces  Chiuney Adaptors  Find Diger Buckets  Bushes, Insulating Bushes, Insulating  6 B.A. Nuts  Confact Screw  Formunals  Confact Screw  Coll Cheeks  Coll Cheeks  Lamp Holders		4	
Sievee Pieces Chinney Adaptors Chinney Adaptors Bushes, Insulating Bushes, Insulating Bushes, Insulating Bushes, Insulating Bushes, Insulating Bushers G B.A. Nuts Contact Serew Fool Cheeks Coll Cheeks Coll Cheeks Coll Cheeks Lamp Holders L	ART.		Selection
Steeve J. Shires	0 P	reed of reed o	1130
Steeve J. Shires	NOL	Wire, 3 Wire, 3 Wire, 1 Soa Wire, 1 Soa Wire, 2 Wire, 3 Wire, 3 Wire, 3 Wire, 3 Wire, 3 Wire, 4 Wire, 5 Wire, 6 Wire,	3
Steeve J. Shires	CRIP	mings of the color	200
WOWAHAM POOL OF THE PROPERTY O	DES	Pheese A part of the part of t	ott
WOWAHAM POOL OF THE PROPERTY O		the core of the co	,
55 1 1 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2		NONE DEPRESSE CONTRACTOR	P
■ 2   IIII III III III III II II II II II I	No.	1165 1165 1165 1165 1165 1165 1165 1165	

#### STORAGE BOXES FOR MECCANO PARTS

The boxes illustrated and described below are specially designed for the purpose of storing Meccano parts. Almost every Meccano boy purchases additional parts from time to time, but there is sometimes difficulty in

No. 2 Storage Box

Finished as No. 1 Box and provided with lock and key. The

tray with which it is fitted enables a much larger quantity of parts to be accommodated.

Dimensions: Length 14½ ins. Width 11 ins. Depth 3% ins.

No. 3

finding suitable accommodation for them. The Meccano Storage Boxes enable extra parts to be stored neatly and methodically so that they are always easily accessible.

#### No. 1 Storage Box

Stained and varnished in rich oak finish, and fitted with partitions, as shown in the illustration. The lid is hinged and is secured by means of lock and key.

Dimensions: Length 15½ ins. Width 8¼ ins. Depth 2¾ ins.

The prices of the Meccano Storage Boxes are indicated on the price list page at the end of this Manual.


#### No. 3 Storage Box

No. 2

A perfect receptacle for Meccano parts, finished similarly to the No. 1 and No. 2 boxes and provided with lock and key. In addition to accommodation in the bottom section of the box there are two partitioned trays which fit neatly in position one above the other.

Dimensions: Length 20 ins Width 14 ins. Depth 51 ins.

#### MECCANO MOTORS

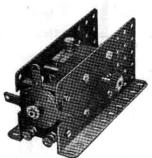

#### Electric Motor No. 1

The 6-volt Motor is specially designed to build into Meccano models. It may be run from a 6-volt Accumulator, or, by employing a suitable transformer, direct from the main. It is fitted with reversing motion, provided with stopping and starting controls, and the gearing is interchangeable.

NOTE.—The Electric Motor No. 1 will not run satisfactorily from dry cells.

#### 6-Volt Accumulator

This new and excellent type of Accumulator has been adapted to drive the Electric Motor No. 1. It has been subjected to the severest tests and has proved itself to be the most suitable accumulator for use with any type of electric motor. It is non-spillable, has remarkable recuperative powers, and will continue to supply current when nominally exhausted.

#### Transformer

By means of this transformer the Meccano Electric Motor No. 1 (6 volt) may be driven direct from the house supply (alternating current only). It is available for all standard supply voltages, from 100 to 250 inclusive, at all standard frequencies. The supply voltage and frequency must be specified when ordering.

#### Resistance Controller

By employing this variable resistance the speed of the Meccano Electric Motor No. 1 (6 volt) may be regulated as desired. The controller is connected in series with the motor and accumulator, or with the motor and transformer if a transformer is used as the source of power.





#### Clockwork Motor

The Meccano Clockwork Motor is specially made for the purpose of driving Meccano models. It is a fine piece of mechanism—simple, powerful, and reliable. The starting, stopping and reversing levers enable the operator to control the various movements of a model in exactly the same manner as an engineer does in actual practice.




#### MECCANO ACCESSORY OUTFITS

#### Meccano Accessory Outfits

Our illustration shows one of the Meccano Accessory Outfits. As has already been explained, these Outfits connect the main Outfits from No. 00 to No. 7, making it possible for a boy who commences with one of the earlier Outfits to build up his equipment by easy stages, until he is the possessor of parts that cover the entire system.

#### Special Inventor's Outfit

This Outfit is intended for boys who already have Meccano, and who wish to satisfy their inventive inclinations by bullding models from their own designs. The parts contained include four large Pulley Wheels with Dunlop Tyres, Ball Race, Ship's Funnel, Pulley Blocks, Channel Bearing, Crane Grab and many others.

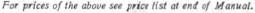



### HORNBY

## TRAINS


Hornby Trains are manufactured by Meccano Limited and they are made from the finest materials obtainable. Each train is a beautiful piece of workmanship with perfect mechanism. All Hornby Locos are carefully tested before leaving the factory and their efficiency is guaranteed.

#### No. M 1 Passenger Set

This set contains Loco, Tender, two Pullman Coaches and set of Rails. One of the latter is a brake rail by means of which the train may be braked from the track. kichly coloured and well finished; fitted with brake mechanism; non-reversing, Gauge 0.

#### No. M 2 Passenger Set

Similar in every way to the above excepting that it has three Pullman Coaches instead of two, and additional rails,

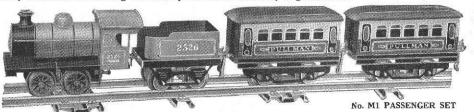

#### No. 1 Tank Goods Set

This set contains a No. 1 Hornby Tank Loco, Hornby Wagon, Petrol Tank Wagon, Brake Van and set of Rails to form either a circle 2 ft. in diameter or an oval 2 ft. in width by 2 ft, 10 in, in length. One of the rails is a brake rail by means of which the train may be braked from the track.

Gauge'0, in colours to represent the L.M.S.R., L.N.E.R., G.W.R. or S.R. Companies' rolling stock. The Loco is fitted with reversing gear and brake mechanism.

#### No. 1 TANK GOODS SET

#### No. 2 Pullman Set

This set includes Loco and Tender of a larger type, measuring 17 in. in length.

The Coaches are beautiful both in colour and finish. Each set includes Loco, Tender, and two Pullman Coaches, with set of Rails making a 4 ft. diameter circle. The rails include one brake rail by means of which the train may be both braked and reversed from the track. In colours to represent the L.M.S.R., L.N.E.R., G.W.R. or S.R. Companies' rolling stock. The Loco is fitted with reversing gear and brake mechanism. Gauge 0.




#### No. 2 PULLMAN SET

#### No. 3 Train Sets

These Train Sets are the latest additions to the range of Hornby Trains. They are distinctive in design, beautifully enamelled in correct colours and are guaranteed to give the utmost satisfaction.

Each locomotive carries the name of a famous British locomotive on the front wheel guard at each side. A special feature of the Pullman Coaches is the corridor connection, which gives the Train a most realistic appearance. All the doors of the coaches open.

The Trains in this series are "Cornish Riviera" (G.W.R.), "Flying Scotsman (L.N.E.R.), "Royal Scot" (L.M.S.R.), and "Dover Pullman" (S.R.). In each case the Train Set is available with either Clockwork or 4-Volt Electric Motor. Gauge 0.

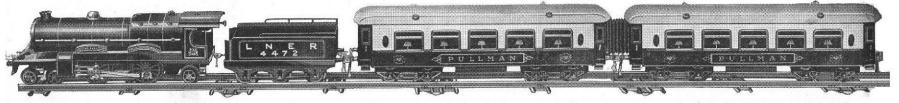

For prices of the above see price list at end of Manual.

#### INDEX TO MODELS

	scription.			Model No.
Acroba	ıt			$2 \cdot 32$
**	on See-s	aw		1.181
Aerial	Flight	****	***	0.47; 1.129
***	Ropeway			0.65
Aerial	Cage Direction	***		00.72
	Direction		***	00.76
"	Frame	9991		$00 \cdot 71 \\ 00 \cdot 78$
	Frame Single W	ire I		00.78
"	Double V	Vire I		00.73
22	Single W	iro T	,	00·73 00·75
22	Single W Double V	Uino T	•••	00.80
A	Double A	Aug 1	2.00	0.110.1.00.
Aeropi	ane	1 10	1.20	8; 0·119; 1·29; 8; 1·225; 2·48 00·100; 2·43
		1.49;	1.17	8; 1.225; 2.48
Airship			***	00.100; 2.43
. 11	Mooring	Mast		00.171
Ancho				00.56; $0.105$
Angler	***	100		00·56; 0·105 0·15
Ape				0.33
Arc La	mp			00·163; 1·105 0·123
Arch				0.123
Axe				00.127
D.	ttle			00.58
		•••	555	00.3
" Fi	re	***	555	00.7
-				0.00
Baboo	n	***	***	0.83
Bacon	Slicing Ma	achine		0·52; 1·6 1·168
Bagato	elle Table			1.168
Ballist	a			1.39
Banjo				0.50
Barge				00.78
Barrie	r, Level-Cı		7.70	00.1
				00.15
Barrov	C	***	***	
n "	Coster's		0.00	0·69; 1·228 3; 0·142; 1·206
Battle	ship	***	0.23	3; 0.142; 1.206
Bed				00 - 40
Bellow	s			1.78; 1.125
	Forge			1·78; 1·125 1·229 ·15; 1·19; 1·20 00·4; 0·144
Belt G	ear 1 ·	5: 1.1	4:1	15: 1.19: 1.20
Bench			6500	00.4:0.144
Bench	Planing			00-140
Bievel	, Planing	***		0.46 - 1.86
Dillian	d Player	• • • •	100	0.46; 1.86 0.150
Billiar	a Player	***	***	0.130
Birdca	ge and Sta	and	•••	00.37
Blacks	mith	• • •	•••	00·182; 1·128 1·131
Boat	•••			1 · 131
2.5	Ice			3.13
	Motor			00·22; 0·36 0·90; 1·70 00·148; 1·76
**	Rowing			0.90:1.70
**	Sailing			00 - 148 - 1 - 76
"	Sailing Torpedo	•••		0.38
Pont	Steering C			1.201
Doat Pack	accerning C	Car	• • •	00.40
DOOK 1	End	***	***	00.49
	nd Arrow		100	1·46 0·73
Boxer		***	****	0.73
Box B	all Alley			1.154
Boy or	Swing Band		***	1-166
Brake.	Band			$1.3; 1.189 \\ 0.154$
Bridge				0.154
	Double I	raw	100	1.109
1722	High-leve			2.10
>>	- 115 TI-10 VI	with S		
>> >>	Railway	mim 9		0.32
"	Railway	•		0.02
" Buckir	ig Bronch	o	• • • •	
" Buckir Buffer:	ng Bronch			00.79
" Buckir Buffer:	ig Bronch	o		00·79 1·139
" Buckir Buffers Butter	g Bronche  Churn		•••	1 - 139
" Buckir Buffer: Butter	ng Bronche Churn		•••	1·139 0·54
" Buckir Buffer: Butter	churn Shade	···		1·139 0·54 0·151
" Buckir Buffer: Butter	churn Shade			1·139 0·54 0·151
"Buckir Buffers Butter Camer Candle	ng Bronche S Churn a Shade Stick			1·139 0·54 0·151 1·142
Buckir Buffers Butter Camer Candle	Churn Shade Stick Puller			1·139 0·54 0·151 1·142 2·40
Buckir Buffers Butter Camer Candle	Churn Shade Stick Puller			1·139 0·54 0·151 1·142

Description	3
Car, Tandean	3
## Baggage	3
## Baggage	3
## Baggage	3
", Bullock 0.69" ", Hand 00.5" ", Push 0.4 ", Tipping 0.3 Catamaran 1.90 Catapult 00.181; 0.52 Cement Marker 00.21 Chaff Cutter 0.8 Chair 1.59 ", Arm 0.37; 0.102 ", Baby 2.30 ", Bath 00.164; 0.148; 1.1 ", Deck 1.219 ", Go 0.136 ", Invalid 1.21 ", Revolving Office 0.153 Chase, A 0.65 Cheese Cutter 00.73	1
", Bullock 0.69" ", Hand 00.5" ", Push 0.4 ", Tipping 0.3 Catamaran 1.90 Catapult 00.181; 0.52 Cement Marker 00.21 Chaff Cutter 0.8 Chair 1.59 ", Arm 0.37; 0.102 ", Baby 2.30 ", Bath 00.164; 0.148; 1.1 ", Deck 1.219 ", Go 0.136 ", Invalid 1.21 ", Revolving Office 0.153 Chase, A 0.65 Cheese Cutter 00.73	1
Hand	1
Tipping 0.3 Catamaran 1.90 Catapult 0.5 Cement Marker 00.21 Chaff Cutter 0.8 Chair 1.59 " Arm 0.37; 0.102 " Baby 2.30 " Bath 00.164; 0.148; 1.1 " Deck 1.219 " Go 0.136 " Invalid 1.21 " Revolving Office 0.153 Chase, A 0.73	1
Tipping 0.3 Catamaran 1.90 Catapult 0.5 Cement Marker 00.21 Chaff Cutter 0.8 Chair 1.59 " Arm 0.37; 0.102 " Baby 2.30 " Bath 00.164; 0.148; 1.1 " Deck 1.219 " Go 0.136 " Invalid 1.21 " Revolving Office 0.153 Chase, A 0.73	1
Catamaran     1-90       Catapult     00-181; 0-53       Cement Marker     00-21       Chalf Cutter     0-8       Chair     1-59       "Arm     0-37; 0-102       "Baby     2-30       "Bath     00-164; 0-148; 1-17       "Deck     1-219       "Go     0-136       "Invalid     1-21       "Revolving Office     0-153       Chase, A     0-65       Cheese Cutter     00-73	1
Cement Marker       00·21         Chaff Cutter       0·8         Chair       1·59         " Arm       0·37; 0·102         " Baby       2·30         " Bath       00·164; 0·148; 1·1         " Deck       1·219         " Go       0·136         " Invalid       1·21         " Revolving Office       0·153         Chase, A       0·65         Cheese Cutter       00·73	1
Chaff Cutter       0.8         Chair       1.59         , Arm       0.37; 0.102         , Baby       2.30         , Bath       00.164; 0.148; 1.1         , Deck       1.219         , Go       0.136         , Invalid       1.21         , Revolving Office       0.153         Chase, A       0.65         Cheese Cutter       00.73	
Chaif Cutter       0.8         Chair       1.59         "Arm       0.37; 0.102         "Baby       2.30         "Bath       00.164; 0.148; 1.12         "Deck       1.219         "Go       0.136         "Invalid       1.21         "Revolving Office       0.153         Chase, A       0.65         Cheese Cutter       00.73	
" Arm 0 · 37 ; 0 · 102 " Baby 2 · 30 " Bath 00 · 164 ; 0 · 148 ; 1 · 1 " Deck 1 · 219 " Go	
" Baby 2-30 " Bath 00-164; 0-148; 1-1 " Deck 1-219 " Go 0-136 " Invalid 1-21 " Revolving Office 0-153 Chase, A 0-65 Cheese Cutter 00-73	
" Baby       2-30         " Bath       0-164; 0-148; 1-1         " Deck       1-219         " Go       0-136         " Invalid       1-21         " Revolving Office       0-153         Chase, A       0-65         Cheese Cutter       00-73	
" Bath 00·164; 0·148; 1·1 " Deck 1·219 " Go 0·136 " Invalid 1·21 " Revolving Office 0·153 Chase, A 0·65 Cheese Cutter 00·73	183
, Deck 1·219 , Go 0·136 , Invalid 1·21 , Revolving Office 0·153 Chase, A 0·65 Cheese Cutter 00·73	
", Invalid 1·21 ", Revolving Office 0·153 Chase, A 0·65 Cheese Cutter 00·73	
,, Revolving Office 0·153 Chase, A 0·65 Cheese Cutter 00·73	
Chase, A 0.65 Cheese Cutter 00.73	
Chase, A 0.65 Cheese Cutter 00.73	
Cheese Cutter 00.73	
Church 0 · 16	
Chute 00 · 24	
Clock 0 · 79	
" Grandfather 00·149	
Clothes Drying Frame 00 · 121	
Langer 00.0	
Homes 00.42	
C-1 C:tt 0.10	
Cutter 1-199	
Constant 1.09 . 1.110 . 9.	.36
	00
Coat Hanger 00 · 135 : 1 · 10	2
Coco-nut Shy 00 · 135 ; 1 · 10	4
Cot 1.179 1.179	
Cot 0·26; 0·129 , Swinging 3·35	
Cot on Wheels 1.58 Couch 0.130	
C - 1 Mill - 11	
Crane 0.58	
" Breakdown 0.77	
" Derricking 0·115	
" Elevated 1.69	
" Jib 1·203	
" Grab 0.86	
" Jib 0.6; 1.66	
" Lorry 1·196	
" Mobile 1.79	
" Mobile 1·79 " Overhead 1·158	
" Mobile 1·79 " Overhead 1·158	
, Mobile 1 · 79 , Overhead 1 · 158 , Patent Luffing 1 · 54 , Radial Travelling 00 · 71	
, Mobile 1-79 , Overhead 1-158 , Patent Luffing 1-54 , Radial Travelling 00-71 , Railway Breakdown 3-55	
, Mobile 1-79 Overhead 1-158 , Patent Luffing 1-54 , Radial Travelling 00-71 , Railway Breakdown 3-55 , Wagon Swivel 3-45	
Mobile 1-79   Overhead 1-158   Patent Luffing 1-54   Radial Travelling 00-71   Railway Breakdown 3-55   Wagon Swivel 3-45   Revolving 00-61	
, Mobile 1-79 Overhead 1-158 , Patent Luffing 1-54 , Radial Travelling 00-71 , Railway Breakdown 3-55 , Wagon Swivel 3-45 , Revolving 00-61 , Hammerhead 1-133	
, Mobile 1-79 , Overhead 1-158 , Patent Luffing 1-54 , Radial Travelling 1-54 , Radiway Breakdown 3-55 , Wagon Swivel 3-45 , Revolving 00-61	
, Mobile 1-79 , Overhead 1-158 , Patent Luffing 1-54 , Radial Travelling 1-54 , Radiway Breakdown 3-55 , Wagon Swivel 3-45 , Revolving 00-61	165
, Mobile 1-79 , Overhead 1-158 , Patent Luffing 1-54 , Radial Travelling 1-54 , Radiway Breakdown 3-55 , Wagon Swivel 3-45 , Revolving 00-61	165 7
, Mobile 1-79 , Overhead 1-158 , Patent Luffing 1-54 , Radial Travelling 1-54 , Radiway Breakdown 3-55 , Wagon Swivel 3-45 , Revolving 00-61	165 7
, Mobile 1-79 , Overhead 1-158 , Patent Luffing 1-54 , Radial Travelling 1-54 , Radiway Breakdown 3-55 , Wagon Swivel 3-45 , Revolving 00-61	165
Mobile 1-79	165

Description.			Model No.
Densens Fesseste			
Dancers, Eccentr			1.124
Derrick	***	***	2.45
Desk	***	***	00 · 13
Devil Wall		***	00 · 187
Dignity and Imp	ndence	3	1.96
Dipagerence	ucciic		0.91
Dinosaurus	***	***	
Disappearing Med	caniti	an	1.95
Dividers		•••	00.3; 00.84
Dog	 		00·3; 00·84 00·122
Dog " Kennel			0.7
Drafting Machine	•••	•••	
Draiting Machine			3.8
Drill	***	***	1.53
Automatic		***	1.103
" Rock Driller Well	***	•••	0·131 00·174
Driller Well			00.174
"Rock Driller, Well Drilling Machine Drinking Trough Drop the Nigger Dump Car	***	****	107 1 104 0 1
Drilling Machine	***	0	125;1.134;3.1
Drinking Trough	100		00 - 124
Drop the Nigger	9535		3.51
Dump Car			0.116
	1000	•••	0 110
Easel	***	***	$2 \cdot 37$
Eiffel Tower		***	1.104
Electric Loco	20040	10000000	0.94
Floreter	***	1.0	9 . 1.202 . 2.11
Easel Eiffel Tower Electric Loco Elevator , Car , Electric Embossing Machi Emery Wheel	***	1 . 9	8; 1·222; 2·11 00·88
" Car	***		00.88
" Electric			1.00
Embossing Machi	ine		2.54
Emery Wheel	STORY.		1·210 1·74
Emily Wheel	***	•••	1 74
Engine, Beam	***		1.74
" Horizoni	tal	0.1	46; 3.17; 3.23
" Two-cyli	nder \	Vertic	al 3.30
Emery Wheel Engine, Beam "Horizont "Two-cyli "Vertical Execution The	Steam		3.47
Execution, The			0.56
Execution, The Extended Ash Ti	•••		1 101
Extended Ash 11	þ	***	1.164
Fan			0.75
Fan			0·75 00·142
Fan , Ceiling			$00 \cdot 142$
Farm Sight			$00 \cdot 142 \\ 00 \cdot 18$
Farm Sight Fencers, The			00·142 00·18 0·107
Farm Sight Fencers, The			00·142 00·18 0·107 1·217
Farm Sight Fencers, The Fire Alarm	   annal	 	00·142 00·18 0·107 1·217 1·107
Farm Sight Fencers, The Fire Alarm , Engine, M	  anual		00·142 00·18 0·107 1·217 1·107
Farm Sight Fencers, The Fire Alarm , Engine, M	  anual		00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25
Farm Sight Fencers, The Fire Alarm , Engine, M	  anual		00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44
Farm Sight Fencers, The Fire Alarm " Engine, M " Escape Flax Cleaner Flex Making Mac	  anual		00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54
Farm Sight Fencers, The Fire Alarm " Engine, M " Escape Flax Cleaner Flex Making Mac	anual	00-1	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77
Farm Sight Fencers, The Fire Alarm " Engine, M " Escape Flax Cleaner Flex Making Mac	anual	00-1	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77
Farm Sight Fencers, The Fire Alarm "Engine, M "Escape Flax Cleaner Flex Making Mac Flip-Flap Flower Pot Stand	anual  ahine	    	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77
Farm Sight Fencers, The Fire Alarm  "Engine, M "Escape Flax Cleaner Flex Making Mac Flip-Flap Flower Pot Stand	anual hine	00-1	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77
Farm Sight Fencers, The Fire Alarm  "Engine, M "Escape Flax Cleaner Flex Making Mac Flip-Flap Flower Pot Stand	anual hine	    	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177
Farm Sight Fencers, The Fire Alarm  "Engine, M "Escape Flax Cleaner Flex Making Mac Flip-Flap Flower Pot Stanc Fly Boats Flying Boats Machine	anual hine	00-1	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150
Farm Sight Fencers, The Fire Alarm  "Engine, M Escape Flax Cleaner Flex Making Mac Flip-Flap Flower Pot Stanc Fly Boats "Machine Footbridge	anual hine l	00-1	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150 0·84
Farm Sight Fencers, The Fire Alarm  "Engine, M Escape Flax Cleaner Flex Making Mac Flip-Flap Flower Pot Stanc Fly Boats "Machine Footbridge	anual hine l	00-1	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150 0·84
Farm Sight Fencers, The Fire Alarm  "Engine, M "Escape Flax Cleaner Flex Making Mac Flip-Flap Flower Pot Stanc Fly Boats Flying Boats "Machine Footbridge Foot Hammer	anual hine l	00-1	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150 0·84 1·115
Farm Sight Fencers, The Fire Alarm  Engine, M Escape Flax Cleaner Flex Making Mac Fip-Flap Flower Pot Stanc Fly Boats  Machine Footbridge Foot Hammer Fork	anual hine l	00-1	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150 0·84 1·115 00·128
Farm Sight Fencers, The Fire Alarm  "Engine, M "Escape Flax Cleaner Flex Making Mac Flip-Flap Flower Pot Stanc Fly Boats Flying Boats "Machine Footbridge Foot Hammer	anual hine l	00-1	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150 0·84 1·118 00·128 00·128
Farm Sight Fencers, The Fire Alarm  Engine, M Escape Flax Cleaner Flex Making Mac Flip-Flap Flower Pot Stane Fly Boats Flying Boats  Machine Footbridge Foot Hammer Fork Friction Grip Too	anual hine l	00-1	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150 0·84 1·115 00·128
Farm Sight Fencers, The Fire Alarm  Engine, M Escape Flax Cleaner Flex Making Mac Fip-Flap Flower Pot Stanc Fly Boats Flying Boats  Machine Footbridge Foot Hammer Fork Friction Grip Too	anual hine l ii	00-1	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150 0·84 1·118 00·128 00·128
Farm Sight Fencers, The Fire Alarm  "Engine, M Escape Flax Cleaner Flex Making Mac Filp-Flap Flower Pot Stan Fly Boats Flying Boats Flying Boats "Machine Footbridge Foot Hammer Fork Friction Grip Tor Frog	anual hine l		00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150 0·84 1·115 00·128 00·44; 1·47 0·81
Farm Sight Fencers, The Fire Alarm  "Engine, M "Escape Flax Cleaner Flex Making Mac Flip-Flap Flower Pot Stane Flying Boats Machine Foot Hammer Fork Friction Grip Tot Frog  Gallows	anual hine l	00-1	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150 0·84 1·115 00·128 00·44; 1·47 0·81 00·168
Farm Sight Fencers, The Fire Alarm Fire Alarm Fire Alarm Fiscape Flax Cleaner Flex Making Mar Flip-Flap Flying Boats Machine Footbridge Foot Hammer Fork Friction Grip Tot Frog Gallows Gallows Gallows Gallowneter	anual hine l		00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150 0·84 1·115 00·128 00·44; 1·47 0·81 00·168 0·68
Farm Sight Fencers, The Fire Alarm  " Engine, M " Escape Flax Cleaner Flex Making Mac Flip-Flap Flower Pot Stane Flying Boats " Machine Footbridge Foot Hammer Fork Friction Grip Tor Frog  Gallows Galvanometer Gangway	anual hine l	00-1	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150 0·84 1·115 00·128 00·44; 1·47 0·81 00·168 0·68
Farm Sight Fencers, The Fire Alarm  " Engine, M " Escape Flax Cleaner Flex Making Mac Flip-Flap Flower Pot Stane Flying Boats " Machine Footbridge Foot Hammer Fork Friction Grip Tor Frog  Gallows Galvanometer Gangway	anual hine l	00-1	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150 0·84 1·115 00·128 00·44; 1·47 0·81 00·168 0·68 0·68 0·44; 1·50 00·170
Farm Sight Fencers, The Fire Alarm  " Engine, M " Escape Flax Cleaner Flex Making Mac Flip-Flap Flower Pot Stane Flying Boats " Machine Footbridge Foot Hammer Fork Friction Grip Tor Frog  Gallows Galvanometer Gangway Garden Roller	anualhine l		00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150 0·84 1·115 00·128 00·44; 1·47 0·81 00·168 0·68 0·34; 1·50 00·170 00·170 00·170 00·170
Farm Sight Fencers, The Fire Alarm  "Engine, M "Escape Flax Cleaner Flex Making Mac Flip-Flap Flower Pot Stane Flying Boats "Machine Footbridge Foot Hammer Fork Friction Grip Tor Frog  Gallows Galvanometer Gangway Garden Roller	anualhine l		00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150 0·84 1·115 00·128 00·44; 1·47 0·81 00·168 0·68 0·34; 1·50 00·170 00·170 00·170 00·170
Farm Sight Fencers, The Fire Alarm  "Engine, M "Escape Flax Cleaner Flex Making Mac Flip-Flap Flower Pot Stane Flying Boats "Machine Footbridge Foot Hammer Fork Friction Grip Tor Frog  Gallows Galvanometer Gangway Garden Roller	anualhine l		00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150 0·84 1·115 00·128 00·44; 1·47 0·81 00·168 0·68 0·34; 1·50 00·170 00·170 00·170 00·170
Farm Sight Fencers, The Fire Alarm  "Engine, M "Escape Flax Cleaner Flex Making Mac Filp-Flap Flower Pot Stanc Fly Boats "Machine Footbridge Foot Hammer Fork Friction Grip Tor Frog Gallows Galvanometer Gangway Garden Roller "Hose Rec Gate Gate Gate Gauge, Railway	anualhine l		00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150 0·84 1·115 00·128 00·44; 1·47 0·81 00·168 0·68 0·34; 1·50 00·170 00·190 00·38; 1·151 3·15
Farm Sight Feneers, The Fire Alarm  " Engine, M " Escape Flax Cleaner Flex Making Mac Fip-Flap Flying Boats Fly Boats Flying Boats Foot Hammer Foot Hammer Fork Friction Grip Tor Frog  Gallows Gallows Garden Roller Garden Roller Garde, Railway Track Track	anual anual in anual		00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150 0·84 1·115 00·128 00·44; 1·47 0·81 00·168 0·68 0·34; 1·50 00·170 00·190 00·190 00·38; 1·151 3·15 00·344
Farm Sight Feneers, The Fire Alarm  " Engine, M " Escape Flax Cleaner Flex Making Mac Fip-Flap Flying Boats Fly Boats Flying Boats Foot Hammer Foot Hammer Fork Friction Grip Tor Frog  Gallows Gallows Garden Roller Garden Roller Garde, Railway Track Track	anual anual in anual	00-1	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150 0·84 1·115 00·128 00·44; 1·47 0·81 00·168 0·68 0·34; 1·50 00·170 00·190 00·38; 1·151 3·15 00·34 1·214
Farm Sight Feneers, The Fire Alarm  " Engine, M " Escape Flax Cleaner Flex Making Mac Fip-Flap Flying Boats Fly Boats Flying Boats Foot Hammer Foot Hammer Fork Friction Grip Tor Frog  Gallows Gallows Garden Roller Garden Roller Garde, Railway Track Track	anual anual in anual	00-1	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·98; 1·182 1·177 1·150 0·84 1·115 00·128 00·14; 1·47 0·81 00·168 0·34; 1·50 00·170 00·190 00·38; 1·151 3·15 00·34 1·151 00·190 00·38; 1·151 3·15 00·34 1·214 00·117
Farm Sight Feneers, The Fire Alarm  " Engine, M " Escape Flax Cleaner Flex Making Mac Fip-Flap Flying Boats Fly Boats Flying Boats Foot Hammer Foot Hammer Fork Friction Grip Tor Frog  Gallows Gallows Garden Roller Garden Roller Garde, Railway Track Track	anual anual in anual	00-1	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·33; 1·182 1·177 1·150 0·84 1·115 00·128 00·44; 1·47 0·81 00·168 0·68 0·34; 1·50 00·170 00·190 00·38; 1·151 3·15 00·34 1·214 00·170
Farm Sight Feneers, The Fire Alarm  " Engine, M " Escape Flax Cleaner Flex Making Mac Fip-Flap Flying Boats Fly Boats Flying Boats Foot Hammer Foot Hammer Fork Friction Grip Tor Frog  Gallows Gallows Garden Roller Garden Roller Garde, Railway Track Track	anual anual in anual	00-1	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·33; 1·182 1·177 1·150 0·84 1·115 00·128 00·44; 1·47 0·81 00·168 0·68 0·34; 1·50 00·170 00·190 00·38; 1·151 3·15 00·34 1·214 00·170
Farm Sight Fencers, The Fire Alarm  "Engine, M "Escape Flax Cleaner Flex Making Mac Filp-Flap Flower Pot Stanc Flying Boats Flying Boats "Machine Footbridge Foot Hammer Fork Friction Grip Tor Frog "Galvanometer Gangway Garden Roller "Hose Rec Gate Gate Gauge, Railway Track Gilder, Bow Gilder, Bow Gondola Gondola Gondola	hine i	00-1	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150 0·84 1·115 00·128 00·44; 1·47 0·81 00·168 0·68 0·34; 1·50 00·170 00·190 00·38; 1·151 3·15 00·34 1·214 00·117 2·22 1·209; 2·8
Farm Sight Fencers, The Fire Alarm  "Engine, M "Escape Flax Cleaner Flex Making Mac Filp-Flap Flower Pot Stanc Flying Boats Flying Boats "Machine Footbridge Foot Hammer Fork Friction Grip Tor Frog "Galvanometer Gangway Garden Roller "Hose Rec Gate Gate Gauge, Railway Track Gilder, Bow Gilder, Bow Gondola Gondola Gondola	hine i	00-1	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150 0·84 1·115 00·128 00·44; 1·47 0·81 00·168 0·68 0·34; 1·50 00·170 00·190 00·38; 1·151 3·15 00·34 1·214 00·117 2·22 1·209; 2·8
Farm Sight Fencers, The Fire Alarm  "Engine, M "Escape Flax Cleaner Flex Making Mac Filp-Flap Flower Pot Stanc Flying Boats Flying Boats "Machine Footbridge Foot Hammer Fork Friction Grip Tor Frog "Galvanometer Gangway Garden Roller "Hose Rec Gate Gate Gauge, Railway Track Gilder, Bow Gilder, Bow Gondola Gondola Gondola	hine i	00-1	00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·93; 1·182 1·177 1·150 0·84 1·115 00·128 00·44; 1·47 0·81 00·168 0·68 0·34; 1·50 00·170 00·190 00·38; 1·151 3·15 00·34 1·214 00·117 2·22 1·209; 2·8
Farm Sight Fencers, The Fire Alarm  "Engine, M "Escape Flax Cleaner Flex Making Mac Flip-Flap Flower Pot Stane Flying Boats "Machine Footbridge Foot Hammer Fork Galvanometer Gangway Galvanometer Gangway Garden Roller Gauge, Railway "Track Gider, Bow Gider Goose Goose Goorenor, Centri Invert	anual  indicate the second sec		00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·99; 1·182 1·177 1·150 0·84 1·115 00·168 0·34; 1·47 0·81 00·168 0·34; 1·50 00·170 00·190 00·38; 1·151 3·15 00·34 1·214 00·117 2·2 1·209; 2·8 0·63; 1·67 gal 1·140
Farm Sight Feneers, The Fire Alarm  " Engine, M " Escape Flax Cleaner Flex Making Mac Fip-Flap Flying Boats Fly Boats Flying Boats Foot Hammer Foot Hammer Fork Friction Grip Tor Frog  Gallows Gallows Garden Roller Garden Roller Garde, Railway Track Track	anual  indicate the second sec		00·142 00·18 0·107 1·217 1·107 15; 2·12; 3·25 3·44 3·54 1·77 00·175 0·99; 1·182 1·177 1·150 0·84 1·115 00·168 0·34; 1·47 0·81 00·168 0·34; 1·50 00·170 00·190 00·38; 1·151 3·15 00·34 1·214 00·117 2·2 1·209; 2·8 0·63; 1·67 gal 1·140

Description.			Model No.
Cross Cuttor			
Grass Cutter		***	0.89
Grass Cutter Gradient Indicate	ors	00	· 107 to 00 · 114
Gravel Sifter		•••	00.57
Gravity Conveyor		***	1.118
Grill			00.137
Crinder Coffee			3.39
Gillider, Collec	***		
" Knife	***		3.33
Grill Grinder, Coffee Knife Guillotine Gun, Anti-Aircrat	CONTRACT		1.99
C		00 1 70	1 115 0 15
Gun, Anti-Aircrai	t	00.198	; 1.145; 2.47
" Big " Field, and C	200		00.180
" Field and C	arrice		0.31
" Field, and C	arriag	e	0.91
" Lewis " Machine		***	00.28
Machine			0·108 0·140 1·161
" Machine " Old Siege " Quick Firing	***	***	0.108
" Old Siege			0 · 140
" Ouigle Fining	•••		1.161
" Quick Firing	5		1.101
Gymnast			0·24; 1·88 1·227
Donaluis			1 007
" Revolvir	1g	***	1.221
Gyroscope	200		1.202
-Jroscof v III			. 202
202 01 8077 1007			
Hack Saw, Power Hammer, Double			0.139
Hammon Double	Dean	5764	2.1
Hammer, Double	DIOD	***	
" Helve		***	1.91
	inal	10000	1 99 . 0 00
" Mechan	icai	***	1·33; 2·22 00·166
7717	market and	***	00:166
", Irip			
Hammock	***		0.134
Hand Punch	MOREU		3.43
Listabat			
riatchet			$1 \cdot 24$
Hammock Hand Punch Hatchet Hat Rack Hay Tedder			0.120
Hay Todder	333		2.9
riay redder			
Hen "H" Girder			0.88
" H " Cirdor			1.4
TI Girder	***	***	1 4
High-level Bridge	3	111	2.10
Hoe			00.139
Hoe Hoisting Block Hooke's Coupling Horse	***	***	
Hoisting Block	***		1.89
Hooke's Coupling			1.188
HOOKE'S COUPLING		***	1.100
Horse and Cart Prancing			$00 \cdot 130$
and Cart			1.52
" and care			1.02
" Prancing			0.133
			00.104
" 10y			00.104
		***	1.75
Horseman's Fall			0.74
Tiorseman's Lan		***	
Howitzer	***	***	1.82
			0.60
Hurdler	***	***	0.00
Inclined Plane			1.120
THEIRICG TIME	***		1 120
Inclined Plane Invalid, The			1.37
			$1 \cdot 152$
mverted fruss	•••		1 102
Tockey Pulley			1.1
Total I		***	00 170
Jockey Pulley Joy Wheel		***	$00 \cdot 178$
	***		00.64
J F G J M	30-775-76	2000	
Key, Double Cab	le	***	1.130
Kingtograph			3.57
Kinetograph			3.37
Kinetograph King Meccano			1.212
			0.0
Lace Jennier		***	3.9
Ladder		10000	00 - 10
on Wheel	. 00	105. 1	40. 1. 140. 0. 00
" on wheel	5 00.	100; 1	.42; 1.148; 2.39
Step			00·10 ·42; 1·148; 2·39 00·47; 3·7 1·200
Ladle Ciant Fan	nder	3.3	1.200
Ladle, Giant Fou Lamp Standard	nury	***	1.200
			1.193
Lancer			1.197
Lancer	•••		1.107
Lathe		(	0·111; 3·48 0·143
			0.143
Bench		***	0 0
" Bench			
" Bench			2.6
" Bench " Treadle	•••	•••	2 00
" Bench " Treadle	•••	•••	2 00
" Bench " Treadle	•••	•••	2 00
" Bench " Treadle	•••	•••	2 00
" Bench " Treadle	•••	•••	2 00
" Bench " Treadle	•••	•••	2 00
" Bench	•••	•••	2 00

#### INDEX TO MODELS (continued)

4						
	Description. Lever of the Fir			Model No	.	Descripti Press, Autor Print Trimn
	Lever of the Fir	st Orde	er -	00.85		Press, Autor
	" " Sec	cond ,	,	1.7	- 1	Print Trimn
	_,", " Th:	ird "	911	1.8	8 F 75	Propeller
	Light Cruiser			0.9		Pulley Block
	Liner			00.55	207	" Sha'ti
	Locomotive			1.170; 1.3	207	, Shari
	Loom, Hand		1 0	1.92	0.04	Pullman Car
	Lorry, Motor	***	1.94	; 1.204;	2.24	Pump , Doub
	" Steam	****	5.5.5	2.20		" Wind
	Toud Crooker	* 6.5	55.5	0.45	- 4	Punching B
	Loud Speaker	***		1.991	1	M:
	Lever of the Fir " See " Th. Light Cruiser Liner Locomotive Loom, Hand Lorry, Motor " Steam " Tank Loud Speaker Luggage Cart		•••	1-221		34
	Machine for trac	ing a l	ocus	1.143		Quick Deliv
	Magic Plate			00.74		Retur
	Mail Bag Hange	r		00.59; 00	.92	54.110
	Man and Boy		***	1-144	0 1	F11. (1)
	, Climbing P	ole		1.64		Railway Lal
	Master and Stud	lent		1.84	X. 8	" Sig " Wa
	Mat Frame			2-28		
	Meccangaroo			$3 \cdot 24$		Rake
	Meccano Boy			0.48		" Horse
	" Man			00.33		, Large
	Meccanograph			1.146	- 1	Rat Trap .
	Mechanical Gon	g		1 · 174		Rattle , Razor .
	Medal			0.13		Razor .
	Milk Maid		***	0.41	- 1	Refreshmen
	Missing Link, T.	he	30.00	0.70	- 1	Rickshaw .
	Monoplane	***		2.25	- 1	Ruje with E
	Meno Rail			00 - 147		Rickshaw . Rifle with I Road Sign . Rocking Ho Roller, Fiel
	Motor Car	***		00.125; 1	137	Rocking Ho
	" " Raci	ng		1.135	- 1	Roller, Fiel
	" Cycle and	Sideca	ar	0.44		" Fur " Stea Roman Bal
	" Cyclist ar	nd Pilli	on Ric	ler 1 · 112	- 1	" Stea
	Mountain Trans	port		1.44		Roman Bal
	Mounted Cowbo	у	***	1.81		Roulette W
	Machine for trace Magic Plate Mail Bag Hange Man and Boy , Climbing F Master and Stuc Mat Frame Meccangaroo Meccano Boy Meccanograph Mechanical Gon Medal Missing Link, T Monoplane Meno Rail Motor Car " Raci " Cycle and " Cyclist at Mountain Trans Mounted Cowb Music Stand	***	•••	0.122		Roundabou
	Newton's Disc Notice Board			3.46	ĺ	Sofety Cate
	Notice Board	•••	•••	0.121		Safety Cate Sand Yacht
	House Board	****		0 121		Saw, Band
	Oil Cake Chopp	er		3.12		Meat
	Ore Crusher			00.176		" Mecha
	Oil Cake Chopp Ore Crusher Organ Ostrich			00 · 123		" Two-h
	Ostrich	***		00.48		Sawing Hor
					1	., Mac
	Pantograph			1 - 192		Saxophone
	Pantograph Parallel Bars Pastry Designer Pecking Hen Pen Rack 00 1	• • • •	***	0.149		Scales 0
	Pastry Designer	r	***	3.50		1
	Pecking Hen			0.59	NOT THE OWNER OF THE OWNER.	Scarifier
	Pen Rack 00·1	52; 0.	11; 0.	72; 0.96;	1.106	Schooner, S
	Performing Med	ccanitia	ın	2.29		Scooter Scrap Reel
	Piano			0.39	200	Scrap Reel
	Pile Driver	***	***	1.114; 3	.19	Seaplane, S
	Pen Rack 00·1 Performing Med Piano Pile Driver Pistol			0.57		Searchlight
	Piston Connecti	ion, Do	uble A	ction 1.41	0.05	Seat, Gard "Ump
	Pithead Gear	00.14	10; 2	13; 2.14	3.37	C-" C
	Planing Bench		***	00.140	,	Sedan Chai
	riasterer's Hav	VK	•••	00.23		See-Saw
	r'llers	•••	•••	0.62	110	" Ac
	Plough	. iii		00.6; 0.	118	" Re
	Pneumatic Gra	in Elev	ator	0.82	0.00	" Re
	Polishing Spine	це	***	2.53		Seismograp
	Portal		***	0.100	,	Semaphore
	Potato Choppe	г	•••	00.32	,	Set-Square,
	Potter's Wheel	:::	• • •	1 · 220	3	C
-	Prenistoric An	imai	•••	0.15	4	Sewing Mac
	Pile Driver Pistol Piston Connect Pithead Gear Planing Bench Plasterer's Hav Pilers Plough Pneumatic Gra Polishing Spinc Portal Potato Choppe Potter's Wheel Prehistoric An " Bin	nadillo	•••	0.14: 63	100	Shade, Can
	" Bii	a	•••	0.14; 00	102	Shearing M

111	W	EX		) IVI
Description.			Model No	1.1
Press, Automatic	Dial	***	3.10	
Print Trimmer			00.75	
Propeller			00.89	1 10
Description. Press, Automatic Print Trimmer Propeller Pulley Block , Sing , Sharting Pullman Car Pump	0:114	; 1.10	100 . 0.1	1.18
" Shaffing	ie one	00	133 : 00:	156
Pullman Car		00	00:179	100
Pump			0.98	- 1
			1.215	T
" Windmill Punching Bag Sta Machin			1.138	
Punching Bag Sta	and		0.137	00
Machin	е		0.137	.62
1000				
Quick Delivery C Return De	bute		1.173	
Return De	vice	0	mi 1·169	
547 (1)		d	ers.	all !
Railway Lable	•••	134 7	1.141	Rout E
Signal F	rench	200	00.72	Marie 1
Rake "Horse Large Rat Trap Rattle Razor Refreshment Wa	Swivel	Crane	3.45	
Rake		00 -52;	00.45; 1	155
" Horse			0.5; 1.11	7
" Large	***	***	1.63	5V 94 15
Rat Irap	•••	•••	1.190	91
Ratue	***	***	00·90 00·51 0·92	01
Refreshment Wa	ron		00.51	772.1
Rickshaw			0.92	ran:
Rifle with Bayon	et		0.92	C 427
Road Sign		(	00.94; 00	99
Rocking Horse			0.25	
Roller, Field	•••		00.70; 1.	97
" Steem B	and -		3.32	1.270
Roman Balance	Jac	355.53	00 · 136	
Roulette Wheel			00.132	กลโ
Roundabout 0	0.153	1 21	1 2.51;	3.52
Rattle Razor Razor Razor Refreshment Wa Rickshaw Rifle with Bayon Road Sign Rocking Horse Roller, Field Furrow Steam Roman Balance Roulette Wheel Roundabout 0			190	
Safety Catch for Sand Yacht Saw, Band "Circular "Meat Mechanical	Wind	ing Co	1.62	per 1
Sand Vacht	TV ALICE	mg dea	1:153 : 2:	34
Saw, Band	***	0	0.184; 1.	160
" Circular	***	0	0.118; 1.	140
" Meat			00.2	
" Mechanical				
" Mechanical " Two-hand Sawing Horse			00·134 00·155	-53.44
Sawing Horse ,, Machine	•••	****	1.185	. ** I
" Machine Saxophone	***	•••	0.29	
Scales 00·41	: 00.	120;	0·29 0·126; 0· 32; 3·6; 3·4	127;
1.116	; 1.1	33; 2.	32; 3.6;	3.27
Scarifier Schooner, Square Scooter		***	$3 \cdot 4$	
Schooner, Square	e Tops	ail	2.31	1 00
C D 1		0.1;	2·31 0·55; 00·39 2·5	1.38
Scrap Reel Seaplane, Schnei	dor T	conhar	2.5	. N .
Searchlight			00.126	
Seat. Garden				
Umpire's	***		1.180	(e) to
Sedan Chair	***			
Scap Reei Seaplane, Schnei Searchlight Seat, Garden "Umpire's Sedan Chair See-Saw "Actuati		(	0·124; 1· 1·100; 3· 1·186	224
Povelvi	ng		1.100; 3	40
" Revolvi	bout	•••	2.3	1.121
			2·3 1·65	1.5
Semaphore		***	00.101	SHOOL T
Set-Square, 45°			1.12	S 18 2
" 60°		LUCERA	1 13	
Semaphore Set-Square, 45° 60° Sewing Machine Shade, Candle Shearing Machine			2.46	
Shade, Candle		• • •	0.151	
onearing Machin	ie	***	0.104	

ODELS (	continued)
Description.	Model No.
Shepherd's Crook	1.121
Ship's Lamp Shipyard Bogie Shovel Mechanical	1 200
Shipyard Bogie	00 · 16
Shovel, Mechanical Steam	1.205
" Steam	1.57
Sifter	1.57 2.38 1.149
Signal	1.149
Signal " Automatic	1 · 51 00 · 72
French Railway	00 · 72
" Junction Sign Post, one-way " two-way " three-way " four-way	0 · 141
Sign Post one-way	00.97
two way	00-81
" two-way	00 -85
" three-way	00 - 91
C' l' C' D' L' L	11-1 0 100 0 100
Single Sheave Fulley I	MOCK 0.109 , 0.170
Ski-Runner	00·186 00·11; 00·188; 0·138 3·36 2·4 0·78
Sled 0	00.11; 00.188; 0.138
Sleigh, Horse	3.36
Smoothing Iron	2 · 4
Snake	0.78
Spade Spindle, Buffing	00.20
Spindle Buffing	00 · 183
Spinning Buttone	1.61
Spinning Buttons Stamp, Drop " Mechanical Stamping Machine " Mill Steam Engine, Vertica " Road Roller Steamer. Paddle	1.61
Stamp, Drop	1·127 1·223 1·198
" Mechanicai	1.223
Stamping Machine	1.198
,, Mill	00·118; 2·49 1 3·47 3·32
Steam Engine, Vertica	1 3.47
" Road Roller	3.32
Steamer, Paddle Steeple Chaser Stone Sawing Machine	1.147; 3.56
Steeple Chaser	0.71
Stone Sawing Machine	1.68
Stool	00:146
Stool	
" Piano Street Lamp	00.103
Street Lamp	00·95 e 3·2
Strip Bending Machine	· 3·2
Strong Man	0.19
Sudden Appearance, A	1.108
Sulkey	0·145 00·69; 0·117; 3·11 3·53 3·26
Swing	00.69; 0.117; 3.11
Boat	3 53
" Boat " Automatic Switch	3.26
Switch "	00 · 29
Switchback	00 · 29
SWITCHDACK	
Sword	00 · 105; 0 · 42
	00 1 00 50 0 55
Table	00·1; 00·53; 0·27 00·169; 1·119
Red	00.169; 1.119
" Collapsible " Drafting Tappet Valve Demons	00 · 25
" Drafting	0 · 101
Tappet Valve Demons	stration
Model	1.111
Model Telegraph Key Pole	00.76
Telegraph Key Pole	00.116
T-lanna	1.175
Telescope	1.175
Telescopic Mast	0.49; 1.93
Telescopic Mast Telpher Span Tennis Player Three Wheel Auto Ticca Gharry Tight Rope Walker	1·111 00·76 00·116 1·175 0·49; 1·93 1·43
Tennis Player	0·12 0·10 1·23
Three Wheel Auto	0.10
Ticca Gharry	1 · 23
Tight Rope Walker	1.40
Timber Drag	1.30; 1.159
Timber Drag Tin Opener	1·30; 1·159 00·82
	2.52
Tinning Motor Wager	2·52 1·191
Tipping Motor Wagon	
Tipping Motor Wagon Toast Rack	1.191
Tipping Motor Wagon Toast Rack	3.14
Tipping Motor Wagon Toast Rack	3.14
Tipping Motor Wagon Toast Rack	3.14
Tipping Motor Wagon Toast Rack Toboggan	3.14

Description.	Model No.
Tractor, Motor	1.136; 1.167
Tramway Car	1.136; 1.167
Tramway Car Tramcar, Electric Treadle Grindstone	3.5
Tranda Crindstone	1.172
Triangle of Forces	1.172
Triangle of Forces	1·172 1·2 0·61; 2·23 2·41 1·55
Tricycle Carrier	0.61; 2.23
" Carrier	2.41
Tricyclist, Revolving	
Trip Hammer	00 · 166
Tripod	00 · 102
Trolley 00 · 27	; 00.157; 0.30; 0.95
" Hand	3.22
" Porter's	00.86
Trowel	00 · 14
" Mason's	00 · 30
Truck	1 · 56
Baggage	00.96
" Bogie	00 · 129
" Cattle	0.21
" Electric	2 · 18
" Fire	2.41
T21-4	00 - 19
Lland	00.93: 00.172
	00.131 - 00.144
" Lumber …	00·19 00·93; 00·172 00·131; 00·144 0·2; 0·100; 1·87 1·226; 2·33 2·7
" Luggage	1.996 . 9.99
" Motor	1.226; 2.33
" Revolving	2.7
" Timber	00.34
" with Sides	1.25
Truss, Compound Tris	angulated 1.9
" Howe	1 · 10
" Howe " Triangulated	1 · 11
Try-your-strength Ma	chine 1·129; 2·50 00·35; 2·21 2·26
Turnstile	00 · 35 ; 2 · 21
Turntable	2.26
Tweezers	00.83
Umbrella Stand	00 · 106
Van Motor	1.132; 2.44
Van, Motor Velocipede	
Viaduct	
Violin	00.42
" and Bow …	1 · 73
Wagon, Dinner	00 · 141 ; 1 · 27
" Steam	3.58
" Tank	3 · 21
" Tea	00 · 165; 0 · 110
Tim	00.65
" Tower 1.4	5; 1.194; 1.216; 3.18
	00 07
" Stick	
Watch and Chain ,, Stand	
	00 · 150
Weather Vane	0 · 112; 1 · 72
Well Driller	00.174
Well Driller " Windlass	00 · 174 0 · 132
Windlass	1 · 34
Chinese	1 · 113
Well	0.132
Windmill	$00 \cdot 167 : 0 \cdot 80 : 2 \cdot 42$
Wire Rope Maker	1 · 101
Wiretail	0.51
Wrestlers	0.64; 1.71
	30
Yacht	00.98
Yacht	00 · 160
" Ice	00.160
" Land	3.40


#### Patents and Designs Great Britain

20.535/13 253,236 22,962/13 648,958 3,869/14 671,484 4,183/14 671,485 4.564/15 671.534 139,125 671,790 680,416 177.430 682,208 250,378

# MECCANO

#### THE TOY THAT MADE ENGINEERING FAMOUS

Millions of boys in every country throughout the world play with Meccano. These are the Meccano Factories and distributing centres.

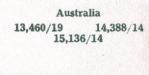

Patents and Designs

Great Britain

718,731

686,112

698,054

718,404

682,209

682,934

683,011



Meccano Ltd., 5/6, Marshall Street, London, W.1.

London Office and Warehouse:


Meccano Ltd.,

Walnut Tree Walk,


Kennington Road, London, S.E.11,

#### Meccano Agencies :

Algiers, Amsterdam, Auckland, Barcelona, Basle, Bogota, Bombay, Brussels, Buenos Aires, Cape Town.

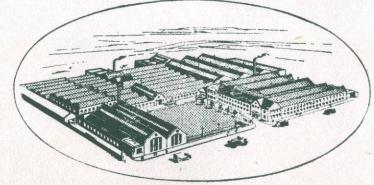

Head Office and Factory: BINNS ROAD, LIVERPOOL.

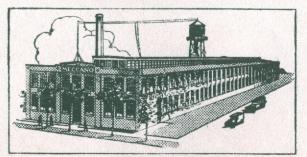

Meccano Company Inc., Elizabeth, New Jersey, U.S.A.



Meccano (France) Ltd., 78-80 Rue Rebeval, Paris XIXeme.

Canadian Office and Warehouse:

Meccano Ltd.,

45, Colborne Street, Toronto.

#### Meccano Agencies:

Constantinople, Durban, Genoa, Iquitos, Johannesburg,

Malta, Monte Video, Oslo, Stockholm, Sydney.